

Form 9-331
(May 1963)UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 078499A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Lively

9. WELL NO.

11

10. FIELD AND POOL, OR WILDCAT

Basin Dakota

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 16, T28N, R8W

12. COUNTY OR PARISH

San Juan

13. STATE

N.M.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL ☐ GAS ☒ OTHER ☐
WELL WELL

2. NAME OF OPERATOR

Lively Exploration Company

3. ADDRESS OF OPERATOR

Box 234, Farmington, New Mexico 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

1480' FSL - 810' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5826' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐

(Other)

PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

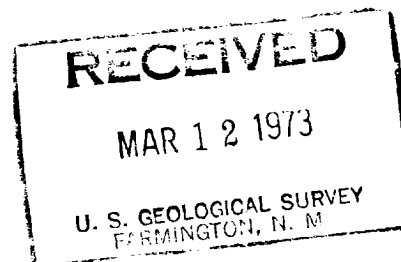
SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☒FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐

(Other)

REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

3-8-73 Drilling at 170' in sand and shale. Spudded at 10:00 p.m. 3-7-73.
13 hrs rig up - 2 hrs drill rat and mouse hole - 6 hrs drill 1 3/4" hole - 3 hrs rig idle.3-9-73 Drilling at 631' with water. 1/4° slope at 270'. 6 3/4 hrs drilling -
1/4 hr survey - 1 hr pull out of hole - 2 1/4 hrs rig up to run casing -
1/2 hr cement casing - 4 hrs W.O.C. - 8 hrs W.O.C. and nipple up - 1/2 hr
pressure up to 600# O.K. - 1/2 hr going in hole - 1/4 hr drill plug and
30' cement. Ran 9 jts 9 5/8" O.D., 32.30#, H-40, 8Rd, ST&C casing
set at 292' RKB. Cemented with 200 sacks, 2% CaCl, Class "A", 1#
gel flake/sack. P.O.B. 11:00 a.m. 3-8-73. Circulated one barrel
cement.

18. I hereby certify that the foregoing is true and correct

SIGNED Original signed by T. A. Dugan

TITLE Engineer

DATE 3-9-73

Thomas A. Dugan

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side