

5 BLM

1 Southland Royalty

1 File

1 Texaco, 1 LAE  
Form Approved.  
Budget Bureau No. 42-R1424

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other

2. NAME OF OPERATOR  
DUGAN PRODUCTION CORP.

3. ADDRESS OF OPERATOR  
P O Box 208, Farmington, NM 87499


4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: 790' FSL - 1850' FEL  
AT TOP PROD. INTERVAL:  
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐  
(other) ☐

SUBSEQUENT REPORT OF:

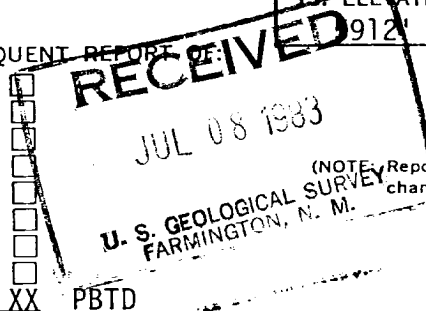

5. LEASE  
NM 33024

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
Kennebec

9. WELL NO.  
1

10. FIELD OR WILDCAT NAME  
Pictured Cliff Wildcat

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Sec. 32 T27N R12W

12. COUNTY OR PARISH  
San Juan

13. STATE  
NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)  
912' GL

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

6-22-83 MI & RU Southwest Surveys and Hinson Inc. Service Co. Ran correlation log from PBTD of 1275' to 350' and swabbed fluid level down to 700'. Perforate 1199-1210' with one 1-11/16" aluminum jet/ft. with 0.38" dia. hole. Total of 12 shots fired. Made one swab run and well started flowing gas. Waited 10 mins. and made 2nd swab run. Recovered 10' of water with fair blow of gas throughout. Waited 20 mins. and made 3rd swab run. Recovered 5' of water with fair blow of gas throughout. Rigged down and moved.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Jim L. Jacobs TITLE Geologist DATE 7-6-83

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

JUL 19 1983