

District I

P.O. Box 1980, Hobbs, NM

District II

P.O. Drawer, Artesia, NM 88211

District III

1000 Rio Brazos Rd. Aztec, NM 87410

State Of New Mexico

Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

SUBMIT 1 COPY TO

APPROPRIATE

DISTRICT OFFICE

AND 1 COPY TO

SANTA FE OFFICE

(Revised 3/9/94)

PIT REMEDIATION AND CLOSURE REPORT

Operator: Conoco Inc.

Telephone: 505-324-5813

Address: 3315 Bloomfield Hwy - Farmington, NM 87401

Facility Or: Holloway Fed. 1E

Well Name

Location: Unit or Qtr/Qtr Sec D Sec 06 T 27N R 11W County San JuanPit Type: Separator ☒ Dehydrator ☐ Other ☐Land Type: BLM ☒ State ☐ Fee ☐ Other ☐Pit Location:
(Attach diagram)

Pit dimension:

length 10' width 10' depth 4'

Reference:

wellhead ☒ other ☐

Footage from reference:

125'

Direction from reference:

64°

Degrees

☒

East

of

North

West

☒

South

Depth To Ground Water:

(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)

50 feet to 99 feet (10 points)

Greater than 100 feet (0 points)

Total

0

Wellhead Protection Area:

(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points)

No (0 points)

Total

0

Distance To Surface Water:

(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points) (20 points)

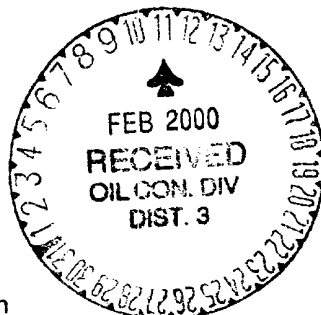
200 feet to 1000 feet (10 points) (10 points)

Greater than 1000 feet (0 points) (0 points)

Total

0

RANKING SCORE (TOTAL POINTS):

0

Date Remediation Started: February 2, 2000 Date Completed: February 2, 2000

Remediation Method: Excavation: _____ Approx. cubic yards _____

(Check all appropriate sections)

Landfarm _____ Insitu Bioremediation _____

Other _____

Remediation Location: Onsite _____ Offsite _____

(ie. landfarmed onsite,
name and location of
offsite facility)

General Description Of Remedial Action: Look sample 3' below bottom of pit.

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit: Sample location Center of pit 3' below.

Closure Sampling: _____

(if multiple samples Sample depth 3' below bottom

attach sample results

and diagram of sample Sample date 2/2/00 Sample time 2:45

locations and depths)

Sample Results

Benzene (ppm) .0181

Total BTEX (ppm) .337

Field headspace (ppm) NOT TAKEN

TPH 4190

Ground Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST
OF MY KNOWLEDGE AND BELIEF

DATE 2/2/00 PRINTED NAME Shirley Ebert

SIGNATURE S Ebert AND TITLE Field Shear Specialist

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

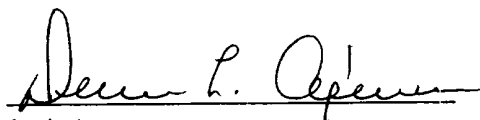
Client:	Conoco	Project #:	707003-124
Sample ID:	SEP.	Date Reported:	02-07-00
Laboratory Number:	G772	Date Sampled:	02-02-00
Chain of Custody No:	7539	Date Received:	02-03-00
Sample Matrix:	Soil	Date Extracted:	02-04-00
Preservative:	Cool	Date Analyzed:	02-04-00
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	857	0.2
Diesel Range (C10 - C28)	3,330	0.1
Total Petroleum Hydrocarbons	4,190	0.1

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: Holloway # 1E.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	707003-124
Sample ID:	SEP.	Date Reported:	02-07-00
Laboratory Number:	G772	Date Sampled:	02-02-00
Chain of Custody:	7539	Date Received:	02-03-00
Sample Matrix:	Soil	Date Analyzed:	02-05-00
Preservative:	Cool	Date Extracted:	02-04-00
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	18.1	1.8
Toluene	70.8	1.7
Ethylbenzene	31.6	1.5
p,m-Xylene	148	2.2
o-Xylene	69.3	1.0
Total BTEX	337	


ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Trifluorotoluene	100 %
	Bromofluorobenzene	100 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: Holloway # 1E.


Analyst


Review

7539

ENVIROTECH INC.

**5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615**

7539

[illegible]

NEW

11/7/99

Date: 4/22/99

Operator: WILL HELLING

Lease Name: HOLLOWAY FED 1E

Site Security
(Indicate North)

