

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Santa Fe**
Lease No. **077177**
Unit **Storey C**

SUNDRY NOTICES AND REPORTS ON WELLS

| | |
|---|---|
| NOTICE OF INTENTION TO DRILL..... | SUBSEQUENT REPORT OF WATER SHUT-OFF..... |
| NOTICE OF INTENTION TO CHANGE PLANS..... | SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING..... |
| NOTICE OF INTENTION TO TEST WATER SHUT-OFF..... | SUBSEQUENT REPORT OF ALTERING CASING..... |
| NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL..... | SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR..... |
| NOTICE OF INTENTION TO SHOOT OR ACIDIZE..... | SUBSEQUENT REPORT OF ABANDONMENT..... |
| NOTICE OF INTENTION TO PULL OR ALTER CASING..... | SUPPLEMENTARY WELL HISTORY..... |
| NOTICE OF INTENTION TO ABANDON WELL..... | Water Frac. X |

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 21, 1961


Well No. **12** is located **800** ft. from **N** line and **1500** ft. from **W** line of sec. **34**
E. W. Section 34 **28-N** **7-W** **N.M.P.M.**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
So. Blanco Pictured Cliffs **San Juan**
(Field) (County or Subdivision)

The elevation of the derrick floor above sea level is **6222** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

8-18-61 total depth 7121'.
Water fractured Upper Dakota & Grangeros perforated intervals
6840-68; 6858-66; 6906-14; 6922-30 with 42,000 gallons water and
40,000# sand. BHP 3500#, max pr 3700#, avg tr pr 3400#. IR
37.5 BPM. Flush 8400 gallons. 4 stages - 3 of 16.

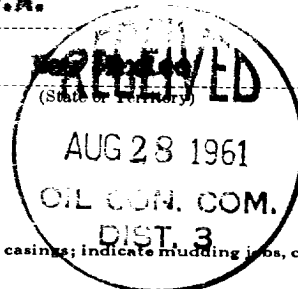

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **El Paso Natural Gas Company**
 Address **Box 990**
Farmington, New Mexico

By **Original Signed D. W. Meehan**
 Title **Petroleum Engineer**