

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 078106
Unit _____

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	RECEIVED JUN 28 1962
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

Gallegos Canyon Unit

June 27, 1962

Well No. 127 is located 1980 ft. from N line and 660 ft. from E line of sec. 21


NF/4 of SE/4 Sec. 21 T-28-N R-12-W NHPM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Undesignated San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5614 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogs, casing points, and all other important proposed work)

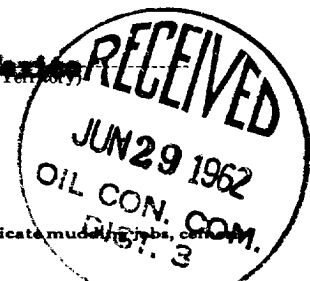

Spud 12-1/4" hole 9:00 AM 6-4-62, drill to 215', set 8-5/8" OD 2 1/2" J-55 Csg. at 206' w/200 sx reg. w/2% CaCl2, circ. 20 sx. to surf., WOC 2 1/2 hrs., test 8-5/8" OD csg. to 1,000' for 30 min., hold OK. Drill 7-7/8" hole to 5460'. Set 4-1/2" OD 11.6# J-55 Csg. at 5459' Baker WDW Shoe Float collar at 5432', stage collar at 1688' & metal petal basket 1702', ent. first stage with 100 sx incore with 1/2 gal followed by 100 sx Incore with 2% CaCl, second stage ent. collar 1688', ent. w/200 sx Incore w/6% gal. WOC 2 1/2 hrs. Test csg. to 2000' for 30 min OK.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Sunray Oil Company

Address Room 200

Petr. Club Plaza Building

Farmington, New Mexico

ORIGINAL SIGNED BY

By HAL M. STIERWALT

Title Engineer