

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Santa Fe**
Lease No. **078282**
Unit **San Juan 29-5 Unit**

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS FEB 20 1963

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	U. S. GEOLOGICAL SURVEY FARMINGTON, NEW MEXICO
NOTICE OF INTENTION TO CHANGE PLANT	SUBSEQUENT REPORT OF SHORTING OR ACIDIZING	
NOTICE OF INTENTION TO STOP WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REPAIR OR REPERF WELL	SUBSEQUENT REPORT OF REPAIRING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO REPAIR OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA

February 19,

19 63

Well No. **32-29(MD)** (OWWO) is located **990** ft. from **XX** line and **1500** ft. from **XX** line of sec. **29**

SW/4 Section 29

T-29-N, R-5-W

N.M.P.M.

Blanco Mesa Verde
Basin Dakota

San Juan


New Mexico

The elevation of the derrick floor above sea level is **6532** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On September 17, 1962 a minor workover was done on this well to eliminate communication between the producing zones. A hole was found in the Dakota tubing between 6080' and 6090'. On Sept. 18, 1962 a tubing stop was set @ 6091' and set an 11' pack off from 6091' to 6080', then set a tubing stop on top @ 6079'.

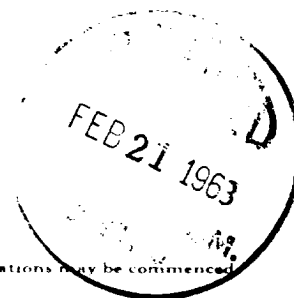

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced

Company **El Paso Natural Gas Company**

Address **Box 990**

Farmington, New Mexico

By

E S O'Leary

Title **Petroleum Engineer**