

New Mexico

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY


Land Office

03188

Lease No.

San Juan 29-5 Unit

Unit

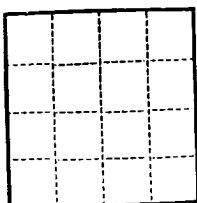

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	Water Frac.	X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 7, 1959

Well No. 22-8(MD) is located 1790 ft. from ^{XXXX}_S line and 890 ft. from ^{XXXX}_E line of sec. 8
SW/4 Sec. 8 29N 5W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco M.V. & Wildcat Dak. Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6559 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

11-27-59 Total Depth 8068'. C.O.T.D. 7567'. Water fractured Point Lookout perf. int. (2 DJ/ft.) at 5676-5704; 5718-32; 5748-50; 5758-64; 5771-75; 5778-82 w/63,500 gallons water and 40,000# sand. BDP 800#, max. pr. 1900#, avg. tr. pr. 1500#. I.R. 62.1 BPM. Flush 13,000 gallons. Dropped 2 sets of 30 balls each for 2 stages.

11-28-59 T.D. 7567'. Temporary bridge plug at 5667'. Water fractured Menefee & Cliff House perf. int. (2 DJ/ft.) @ 5360-68; 5372-84; 5446-50; 5500-04; 5580-90; 5632-38 w/30,500 gallons water and 25,000# sand. BD pr. none, max. pr. 1900#, avg. tr. pr. 1500#. I.R. 50 BPM. Flush 9280 gallons. Dropped 2 sets of 10 balls each.

I understand that this plan of work must receive approval in writing by the Geological Survey before operation is commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By ORIGINAL SIGNED B. J. MEANS

Title Petroleum Engineer

