proved

DEC 3 0 1997

Meter Number:90546 L& GAS INSPECTORLocation Name:SAN JUAN 29-6 #13A Location: TN-29 RG-06 SC-06 UL-D 2 - Federal

> NMOCD Zone:OUTSIDE Hazard Ranking Score:00

RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS LOCATED OUTSIDE OF THE VULNERABLE ZONE IN THE SAN JUAN BASIN

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1.000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

10⁻⁹ to 10⁻¹³ cm/sec 10⁻¹² to 10⁻¹⁶ cm/sec 10⁻¹² to 10⁻¹⁵ cm/sec Sandstone Shale Clav

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.


Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.

FIELD PIT SITE ASSESSMENT FORMEL PASOF



GENERAL	Meter: 90546 Location: SAN JUAN 29-6 # 13 A Operator #: 7035 Operator Name: PHILUPS P/L District: BLOOMFIELD Coordinates: Letter: D Section & Township: 29 Range: 6 Or Latitude Longitude Pit Type: Dehydrator X Location Drip: Other: Site Assessment Date: 5:11.94 Area: 10 Run: 51					
SITE ASSESSMENT	NMOCD Zone: (From NMOCD (From NMOCD Maps) Inside Outside Outside (2) Depth to Groundwater Less Than 50 Feet (20 points) Greater Than 100 Ft (0 points) Wellhead Protection Area: Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction?, or; Is it less than 200 ft from a private domestic water source? Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) (2) Greater Than 1000 Ft (0 points) (3) Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) (2) Greater Than 1000 Ft (10 points) (2) Greater Than 1000 Ft (0 points) (3) Name of Surface Water Body (Surface Water Body: Perennial Rivers,Major Wash,Streams,Creeks, Irrigation Canals,Ditches,Lakes,Ponds) Distance to Nearest Ephemeral Stream (1) < 100'(Navajo Pits Only) (2) > 100' TOTAL HAZARD RANKING SCORE: POINTS					
REMARKS	Remarks: Two Pits on Location, PIT IS DRY, LOCATION IS ON TOP OF SMITH PASS. REDLINE AND TOPO CONFIRMED LOCATION TO BE INSIDE THE. V.Z. PUSH IN					

(SP3190) 04/08/94

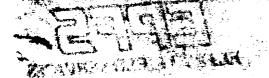


ORIGINAL PIT LOCATION

REMARKS

ORIGINAL PIT LOCATION

Original Pit: a) Degrees from North 315° Footage from Wellhead 125'

b) Length : <u>20'</u> Width : <u>20'</u> Depth : <u>4'</u>

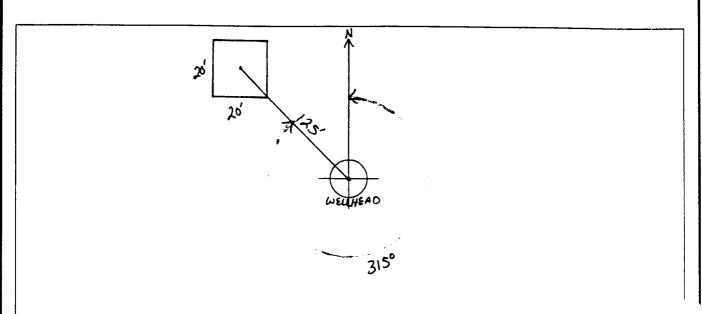

Remarks	•	
1/CIII GI ES	•	

TOOK PICTURES AT 12:26 P.M.

DUMP TRUCK - BOBTAIL

Completed By:

Signature

5.11.94

Date

FIEL PIT REMEDIATION/CLOSULE FORM

Meter: 40546 Location: Son Juan 29-6 #13A Coordinates: Letter: D Section 6 Township: 29 Range: 6 Or Latitude Longitude Date Started: 6-15-44 Area: 10 Run: 51
Sample Number(s): $\sqrt{\omega_{21}}$ Sample Depth: $\sqrt{2}$ Feet Final PID Reading $\sqrt{20}$ PID Reading Depth $\sqrt{2}$ Feet Yes No Groundwater Encountered \square (1) \square (2) Approximate Depth \square Feet
Remediation Method: Excavation
Remarks: No he markers 9'hit hayer of Bendon of Specialist: Vale Wilson



FIELD SERVICES LABORATORY ANALYTICAL REPORT PIT CLOSURE PROJECT - Soil

	SAMPLE	DENTIFICA	HON			
SAMPLE NUMBER: MTR CODE SITE NAME: SAMPLE DATE TIME (Hrs): SAMPLED BY: DATE OF TPH EXT. ANAL.: DATE OF BTEX EXT. ANAL.: TYPE DESCRIPTION:	10 1 N	1A (a)	Lab 10 5461 NIA 445 [1494 A	ry Sand	JClay	
REMARKS:						
		RESULTS	_			
PARAMETER	RESULT	UNITS	QUALIFIERS DF Q M(g) V(ml)			V(ml)
BENZENE		MG/KG				
TOLUENE		MG/KG				
ETHYL BENZENE		MG/KG				
TOTAL XYLENES		MG/KG				
TOTAL BTEX		MG/KG				
TPH (418.1)	225	MG/KG			2.16	28
HEADSPACE PID	220	PPM				
PERCENT SOLIDS	88.0	%				
The Surrogate Recovery was at	- TPH is by EPA Method 4	18.1 and BTEX is by EP/ % for this samp		was accep	otable.	

OF = Dilution Factor Used

Varrative:

7/14/611

****************** Test Method for Oil and Grease and Petroleum Hydrocarbons * in Water and Soil Perkin-Elmer Model 1600 FT-IR Analysis Report ******************

74/06/16 15:04

Sample identification 745461

Initial mass of sample, g 1.160

Volume of sample after extraction, ml 03.000

Petroleum hydrocarbons, ppm 124,541

Net absorbance of hydrocarbons (2930 cm-1)

