

**SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE**

(Revised 3/9/94)

PIT REMEDIATION AND CLOSURE REPORT

Operator: CONOCO INC. Telephone: 505-324-5813
Address: 3315 Bloomfield HWY. FARMINGTON N.M. 87401
Facility Or: State Com. D 11A
Well Name _____
Location: Unit or qtr/qtr sec D sec 16 T29N R8W county SAN JUAN
Pit Type: separator ☒ Dehydrator _____ other Tank Drain Pit
Land Type: BLM _____, State ☒, Fee _____, other _____

Pit Location: Pit dimensions: length 18', width 18', depth 3'
(Attach diagram)
Reference: wellhead ☒ other _____
Footage from reference: _____
Direction from reference: _____ Degrees _____ East North _____
West South _____

Depth To Ground Water:
(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)
50 feet to 99 feet (10 points)
Greater than 100 feet (0 points) 0

Wellhead Protection Area:
(Less than 200 feet from a private domestic water source, or; less than 1000 feet from all other water sources)

Yes (20 points)
No (0 points) 0

Distance To Surface Water:
(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points)
200 feet to 1000 feet (10 points)
Greater than 1000 feet (0 points) 0

RANKING SCORE (TOTAL POINTS): 0

Date Remediation Started: 8-31-99 Date Completed: 8-31-99

Remediation Method: Excavation _____ Approx. cubic yards _____
(Check all appropriate sections) Landfarmed _____ Insitu Bioremediation _____
Other _____

Remediation Location: Onsite _____ Offsite _____
(ie. landfarmed onsite,
name and location of
offsite facility)

General Description Of Remedial Action: SAMPLE TAKEN HIT BED ROCK 1' EN OF
OF BOTTOM, TILL BOTTOM OF P.T, BACK FILL WITH CLEAN SOIL

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit:
Closure Sampling:
(if multiple samples,
attach sample results
and diagram of sample
locations and depths)

Sample location CENTER OF PIT

Sample depth 4'

Sample date 8-16-99 Sample time 1534

Sample Results

Benzene (ppm) _____

Total BTEX (ppm) _____

Field headspace (ppm) 9

TPH 2620

Ground Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST
OF MY KNOWLEDGE AND BELIEF

DATE 11-30-99

SIGNATURE

PRINTED NAME
AND TITLE

Judson Valdez P.L.

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons


Client:	Conoco	Project #:	707003-088
Sample ID:	TDP - Grab	Date Reported:	08-24-99
Laboratory Number:	F961	Date Sampled:	08-16-99
Chain of Custody No:	7133	Date Received:	08-20-99
Sample Matrix:	Soil	Date Extracted:	08-23-99
Preservative:	Cool	Date Analyzed:	08-23-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	4.6	0.2
Diesel Range (C10 - C28)	2,610	0.1
Total Petroleum Hydrocarbons	2,620	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: **State Com O 11 A. OVM Reading 9.
Hit Rock Bed 1' In.**

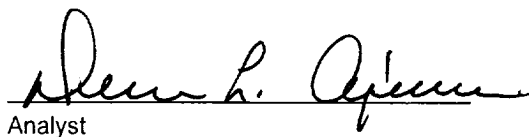
Analyst


Review

7133

ENVIROTECH INC.

5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615


$$\begin{array}{r}
 208.50 \\
 11.73 \\
 \hline
 220.23 \\
 1066.07 \\
 \hline
 886.30
 \end{array}$$

Lease Name: STATE Com 0-11A

Operator: David J. Jind

Date: 8-9-99

Site Security
(Indicate North)

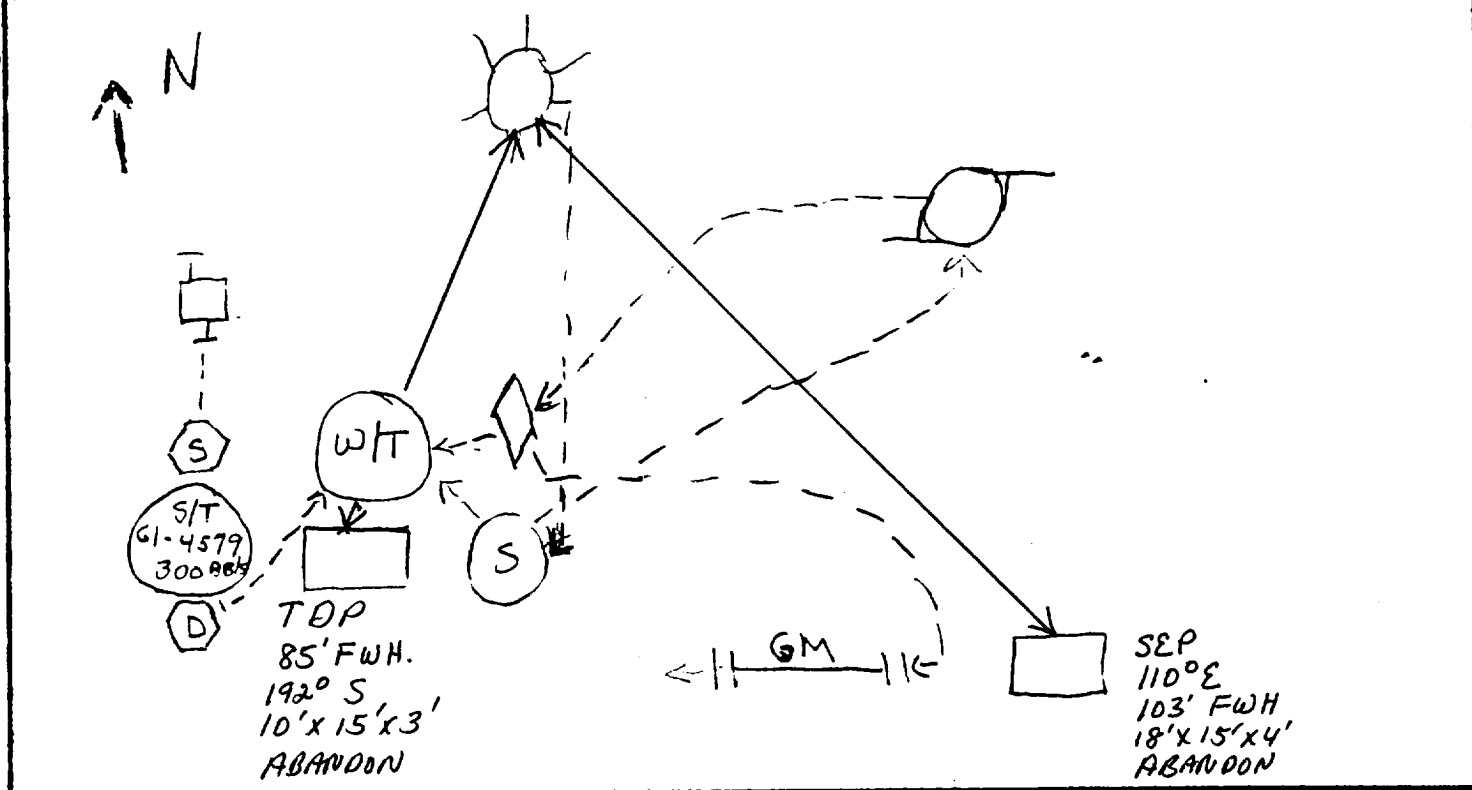

Lease Name: State Com 0 11A
 Federal/ Indian Lease No: 51-5-5224 E 5224
 CA No.: NA
 Unit: 0
 Legal Description: Sect: 16 TP: 29 R: 8W
 County: San Juan, NM

Load line valves :
 Sealed during Production

Drain line valves :
 Sealed during Production

Production Line valve:
 Sealed during sales

This lease is subject to the site security plan for
 San Juan Basin Operations. The plan is located at:
 Conoco Inc.
 3315 Bloomfield Hwy
 Farmington, NM