Denny S. Fourt DEPUTY OIL & GAS INSPECTOR

DEC 3 0 1997

Meter Number:89382
Location Name:HILL #2A
Location:TN-29 RG-08
SC-04 UL-I
2 - Federal
NMOCD Zone:OUTSIDE
Hazard Ranking Score:00

PECEIVED APR 1 4 1997 OIL GON. DIV. DISTL S

## RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS LOCATED OUTSIDE OF THE VULNERABLE ZONE IN THE SAN JUAN BASIN

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1,000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

Sandstone  $10^{-9}$  to  $10^{-13}$  cm/sec Shale  $10^{-12}$  to  $10^{-16}$  cm/sec Clay  $10^{-12}$  to  $10^{-15}$  cm/sec

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.

Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.

## FIELD PIT SITE ASSESSMENT FORM



GENERAL	Meter: 89382 Location:Hi// #2A  Operator #: 2999 Operator Name: METIDIAN P/L District: Bleen Cicil All  Coordinates: Letter: I Section # Township: 29 Range: 8  Or Latitude Longitude  Pit Type: Dehydrator X_ Location Drip: Line Drip: Other:  Site Assessment Date: 4-20-9 4 Area: 10 Run: 441
SITE ASSESSMENT	NMOCD Zone:  (From NMOCD  Maps)  Inside  Outside  Outside  (2)  Depth to Groundwater  Less Than 50 Feet (20 points)  Feet  (3)  Feet  (4)  Feet  (5)  Indian  Depth to Groundwater  Less Than 50 Feet (20 points)  Feet  (5)  Feet  (6)  Feet  (7)  Feet  (8)  Indian  Depth to Groundwater  Less Than 50 Feet (20 points)  (9)  Greater Than 100 Ft (0 points)  Wellhead Protection Area:  Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction?, or; is it less than 200 ft from a private domestic water source?  (1) YES (20 points)  Horizontal Distance to Surface Water Body  Less Than 200 Ft (20 points)  (2)  Greater Than 1000 Ft (10 points)  (2)  Greater Than 1000 Ft (0 points)  (3)  Name of Surface Water Body  (Surface Water Body: Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds)  Distance to Nearest Ephemeral Stream  (1) < 100'(Navajo Pits Only)  (2) > 100'  TOTAL HAZARD RANKING SCORE:  POINTS
RKS	Remarks :
REMARKS	(SP3190) 04/08/94

\_1\_

### FIELD 'T REMEDIATION/CLOSUR' FORM

GENERAL	Meter: 89382 Location: Hill #2A  Coordinates: Letter: Section 4 Township: 29 Range: 8  Or Latitude Longitude Longitude  Date Started: 4-20-94 Area: 10 Run: 41
FIELD OBSERVATIONS	Sample Number(s): E.T. 5  Sample Depth: Feet  Final PID Reading PID Reading Depth Feet  Yes No  Groundwater Encountered
CLOSURE	Remediation Method:  Excavation
	Soil Disposition: Envirotech
REMARKS	Remarks:
	Signature of Specialist: Engine Truly (SP3191) 04/07/94

-2-



# FIELD SERVICES LABORATORY ANALYTICAL REPORT PIT CLOSURE PROJECT - Soil

### SAMPLE IDENTIFICATION

	Field ID	Lab ID		
SAMPLE NUMBER:	ETS	940842		
MTR CODE   SITE NAME:	89382	NIA		
SAMPLE DATE   TIME (Hrs):	4/20194	1355		
SAMPLED BY:	NIA			
DATE OF TPH EXT.   ANAL.:	4-22-94	4-22-94		
DATE OF BTEX EXT. ANAL.:	AIG	NIA		
TYPE   DESCRIPTION:	Vœ	Brown Correse SANd		

REMARKS:
----------

#### **RESULTS**

PARAMETER	RESULT	UNITS	QUALIFIERS			
LYIMILITI			DF	Q	M(g)	V(ml)
BENZENE		MG/KG				
TOLUENE		MG/KG				
ETHYL BENZENE		MG/KG				
TOTAL XYLENES		MG/KG				
TOTAL BTEX		MG/KG				
TPH (418.1)	1830	MG/KG			2.03	28
HEADSPACE PID	[[10	РРМ				
PERCENT SOLIDS	91.2%	%				

-- TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 --

The Surrogate Recovery was at Narrative:	% for this sample	All QA/QC was acceptable.
DF = Dilution Factor Used		- Yhday

Test Method for Oil and Grease and Petroleum Hydrocarbons in Water and Soil

Perkin-Elmer Model 1600 FT-IR Analysis Report \*\*\*\*\*\*\*\*\*\*\*\*\*\*\*\*\*\*\*

4/04/22 12:24


Sample identification 40842

Initial mass of sample, g 030

Volume of sample after extraction, ml 9.000

Petroleum bydrocarbons, ppm 800.803

det absorbance of hyd<mark>rocarbons (29</mark>30 cm-1) .240

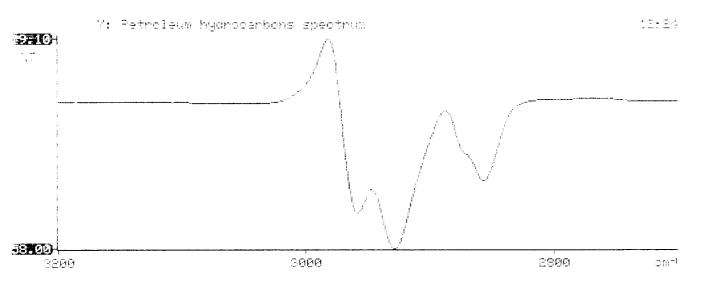

\*

\*

# ILLEGIBLE