

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079060
Unit Northeast Blanco

Unit Agreement No. 1, co. 929

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	☒	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 8, 1963

Well No. 6-29 is located 1770 ft. from [N] line and 1160 ft. from [E] line of sec. 29


EE/4 Sec. 29 30N 7W RM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco San Juan El Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6342 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Pull 2-3/8" tubing, set bridge plug in 5-1/2" liner. Run corrosion log of 7" casing. Run 5-2" casing, with turned down collar, from surface to top of liner at 4855' and circulate sulfate resistant cement to surface. Drill plugs, return 2-3/8" tubing and return well to production.

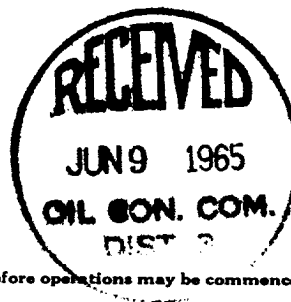

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company BLACKWOOD & NICHOLS COMPANY

Address P. O. Box 1257

Durango, Colorado

Original Signed
by DeLasso Loos

By DeLasso Loos

Title Field Superintendent



errade card.

F. Loc. 1770/N; 1160/E Elev. 6342 DF Re- 3-6-58 Re- 3-15-58 Spd. 10/17/53 Comp. 12/4/53 TD 5625 C.O. 5624
 Casing 10-3/4 @ 214 W 200 Sx. Int. @ W Sx. Pr. 7 @ 5006 W 500 Sx. T. 2 @ 5544
 Csg. Perf. Prod. Stim. 5' 1/2 @ 4855-5553 @ 15 Shot 1730 qts 5090-5624 T 5463
 I.P. 4260 MCF/D After 3 Hrs. SICP 1050 PSI After 24 Days GOR Grav. 1st Del. 2/23/54 EPNG
4124 13185 ROF 815

TOPS		NITD	Well Log	TEST DATA						
				Schd.	PC	Q	PW	PD	D	Ref. No.
Kirtland		C-102	Plat							
Fruitland		C-103	Electric Log							
Pictured Cliffs	5020	C-104	C-110	54	844	348	527	422	406	
Cliff House	5115	5-13-58	5-23-58	55	704	188	497	352	254	
Menefee	5408	Ditr 5-26-58	Dfa	7/30/56	684	38	507	342	56	
Point Lookout	5532	Datr	Dac 3-21-58	10/8/57	688	166	521	344	253	
Mancos		Remarks * 5-14-58 SWP P's 5030-5530 N/320		* 3/27/58	827	1205	554	413	1519	#345
Gallup										
Dakota										
Morrison										
Entrada										

P
o
Blanco MV Co RA s 29 T 30N R 7W UH Oper Blackwood & Nichols Ls NE Blanco U No 6-29
 Jan. | Feb. | Mar. | Apr. | May | June | July | Aug. | Sept. | Oct. | Nov. | Dec.