

COPIES RECEIVED	3
DISTRIBUTION	
SANITARY	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input type="checkbox"/> Federal <input type="checkbox"/>
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - A" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name San Juan 30-4 Unit
2. Name of Operator El Paso Natural Gas Company	8. Farm or Lease Name San Juan 30-4 Unit
Address of Operator PO Box 990, Farmington, NM 87401	9. Well No. 2 (P&A)
Location of Well UNIT LETTER A 667 FEET FROM THE North LINE AND 833 FEET FROM THE East LINE, SECTION 19 TOWNSHIP 30N RANGE 4W NMPM.	10. Field and Pool, or Wildcat East Blanco Pictured Cliffs
15. Elevation (Show whether DF, RT, GR, etc.) 7512' GL.	12. County Rio Arriba


16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

This well has been plugged and abandoned in the following manner:

- 11-9-71 Spotted a 50 sks. cement plug from 4300' to 4000'.
- 11-10-71 Perforated 4 squeeze holes at 3813'. Spotted a 50 sk. cement plug at 3813', and pressure displaced 25 sks. to cover Ojo Alamo outside casing and left 25 sks. inside casing to cover the Ojo Alamo.
- 11-12-71 Did not recover any 7" casing, pumped a 75 sk. cement plug down the 7" - 9 5/8" annulus. Placed a 15 sk. cement plug at the surface with a Plugged & Abandoned marker. Cleaned location.

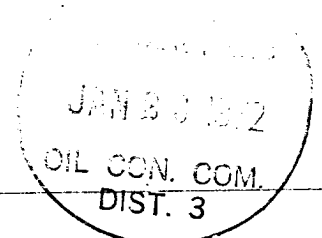

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Original Signed W. D. Dawson

TITLE Petroleum Engineer

DATE January 25, 1972

APPROVED BY

Emmy C. [Signature]

TITLE SUPERVISOR DIST. #3

DATE JAN 26 1972

CONDITIONS OF APPROVAL, IF ANY: