


5 USGS - Farmington
 1 International
 1 Murphy
 1 Lloyd
 1 Morris & Burt (SUBMIT IN TRIPLICATE)
 1 El Paso
 1 File

Land Office Santa Fe
 Lease No. ST 043260 C
 Unit P

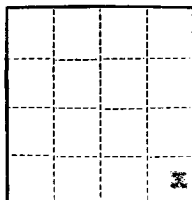

UNITED STATES
 DEPARTMENT OF THE INTERIOR
 GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	☒
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	☐
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	☐
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	☐
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	☐
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	☐
NOTICE OF INTENTION TO ABANDON WELL		☐

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 18, 1962

Well No. 1-4 is located 1190 ft. from N line and 1190 ft. from E line of sec. 4

SE 1/4 Sec. 4 (1/4 Sec. and Sec. No.) 27N (Twp.) 11W (Range) 107N (Meridian)
Dakota (Field) San Juan (County or Subdivision) New Mexico (State or Territory)

The elevation of the ~~drill floor~~ ground above sea level is 5785 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spud 12 1/2" hole at 7:00 p.m. 11-18-61 - Drilled to 205'. Ran 6 joints of 5/8" O.S. 24 1/2 J-55, 8 Rd, STAC casing. T.B. 197.30' set at 199' B.B. cemented with 125 Sx Heat plus 2% HA-5, cement circulated. P.O.B. 11 p.m. T.D. 6765' - Ran Schlumberger E.S. Induction Log and Sonic Log. Laid down drill pipe; ran 216 joints 4 1/2" O.S. 10.5 1/2 J-55, 8 Rd, STAC casing. T.B. 6762.38' set at 6763 B.B., cemented first stage with 150 sacks 8 1/2 gal and 50 Sacks Heat, good mud returns while cementing. Pipe reciprocated free throughout job, bumped plug with 1750 psi, float held o.k. P.O.B. 8:30 p.m. 11-28-61. Cemented second stage through Baker Two-Stage tool at 3889' with 200 sacks, 40% Diacel "D" with 2% CaCl - good mud returns while cementing. Bumped plug with 2500 psi, held o.k. P.O.B. 1:25 a.m. on 11-29-61.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company International Petroleum CorporationAddress 2010 Republic Bank BuildingDallas, TexasBy W. H. DyerTitle Consulting Engineer