


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Budget Bureau No. 42-B358.4.
Approval expires 12-31-60.

Land Office Santa Fe
Lease No. 078378
Unit E/1, Sec. 21



JUL 1 1962

SUNDRY NOTICES AND REPORTS ON WELLS

U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 29, 1962


Well No. 40 is located 1850 ft. from [N] line and 1825 ft. from [E] line of sec. 21
SE/4, Section 21 T-30-N R-2-W NMPS
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Alance Masoverde San Juan New Mexico
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3815 ft. D.F.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Pumped 200 bbls. 8.6# drilling mud down braden head. Well still had pressure on braden head. Well kicking through crater. Pumped 1500 sacks 15# cement down braden head displacing cement in surface casing w/water. Crater dead.

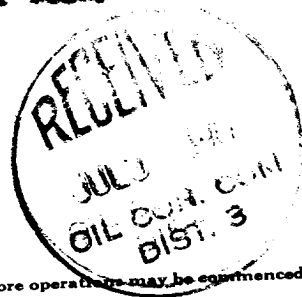

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company DELHI-TAYLOR OIL CORPORATION

Address P. O. Drawer 1198
Farmington, New Mexico

Original signed by
 By G. T. HIGGINBOTHAM
G. T. Higginbotham
 District Superintendent