


Form 9-331a
(Feb. 1951)

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 979211
Unit Small

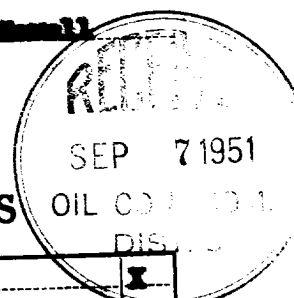

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 5, 1951

Well No. 2-E is located 990 ft. from N line and 990 ft. from E line of sec. 14

NE NE Section 14
(1/4 Sec. and Sec. No.)

30N
(Twp.)

8W
(Range)

T. 1 N. P. 1
(Meridian)

Elanco
(Field)

San Juan
(County or Subdivision)

New Mexico
(State or Territory)

The elevation of the ground ~~surface~~ above sea level is 5203 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

T. D. 3704.

On September 4, 1951, set 10 jts. of 7" 23# J-55 (425') and 77 jts. 20# J-55 (3265') set at 3704 w/300 sacks regular cement, 4 sacks Floccula and 2# Gal. Top of cement by Temperature Survey 1540.

Hold 1000# for 13 hours.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company SAN JUAN PRODUCTION COMPANY

Address P. O. Box 997
Farmington, New Mexico

By

Title

Petroleum Engineer