

STATE OF NEW MEXICO
OIL CONSERVATION
COMMISSION

DISTRICT NO. 3
Phone 99 P. O. Box 697
AZTEC, NEW MEXICO

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Santa Fe

Land Office 013580

Lease No. 10000

Unit

JUN 5 1951

OIL CON. COM.
DIST. 3

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	X
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 4

31

, 19

Well No. 3 is located 390 ft. from N line and 390 ft. from E line of sec. 4
S4 S4 Section 4 30N T. 12 S. R. 12 E.

Blanco Est. (4 Sec. and Sec. No.)

(Twp.)

San Juan

(Meridian)

New Mexico

(Field)

(County or Subdivision)

(State or Territory)

The elevation of the derrick floor above sea level is 6040 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On May 27, 1951, ran Schlumberger Electric log to find suspected hole in casing.

Found hole in 7" at 2029'.

On May 28, 1951, ran Bisco cutter and cut 7" at 2443'.

On May 29, 1951, pulled casing at 2450' and conditioned hole - found parted joint at 2029'.

On June 1, 1951, ran 36 joints (2438') back in hole and secured onto 6-5/8" at 2443' with 0-3/8" Brown overshot dressed with 6-5/8" pack off rubber and spiral slips. Tested with 1150 psi for 10 minutes, held OK.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.


SAN JUAN PRODUCTION COMPANY

Company 102 1/2 North Court Avenue

Address Farmington, New Mexico

By E. J. Coal
Petroleum Engineer

Title

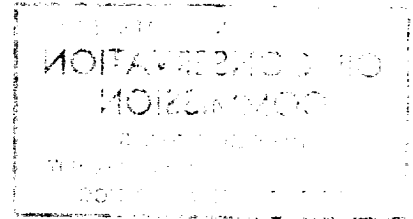

(SUBMIT IN TRIPLICATE)
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office _____
Lease No. _____
Unit _____

SUNDRY NOTICE AND REPORTS ON WELLS

REPORT OF INVESTIGATION TO DRILL	
REPORT OF INVESTIGATION TO CHANGE PLANS	
REPORT OF INVESTIGATION TO TEST WATER SHUT-OFF	
REPORT OF INVESTIGATION TO RE-DRILL OR REPAIR WELL	
REPORT OF INVESTIGATION TO SHOOT OR ACIDIZE	
REPORT OF INVESTIGATION TO PULL OR ALTER CASING	
REPORT OF INVESTIGATION TO ABANDON WELL	
COMPLEMENTARY WELL HISTORY	
SUBSEQUENT REPORT OF ABANDONMENT	
SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
SUBSEQUENT REPORT OF ALTERING CASING	
SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
SUBSEQUENT REPORT OF WATER SHUT-OFF	

(INDICATE ABOVE BY CHECKING NUMBER OF REPORT, NOTICE OR OTHER DATA)

_____ is located _____ ft. from _____ line and _____ ft. from _____ line of _____
_____ (Elevation) _____ (Elevation) _____ (Elevation) _____ (Elevation)
_____ (Pressure) _____ (Pressure) _____ (Pressure) _____ (Pressure)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

_____ (Type of work) _____ (Depth of work) _____ (Direction of work) _____ (Time of work) _____ (Weather) _____ (Remarks)

I hereby certify that this plan of work was received and approved by the U.S. Geological Survey, and that the same was carried out in accordance with the same.

Company _____

Address _____

By _____

Title _____