

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other

2. NAME OF OPERATOR
Northwest Pipeline Corporation

3. ADDRESS OF OPERATOR
P.O. Box 90, Farmington, N.M. 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1800' FSL & 1780' FWL
AT TOP PROD. INTERVAL: Same as above
AT TOTAL DEPTH: Same as above

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) Drlg operations

SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☐
☐
☒

U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

5. LEASE
SF 078766

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME
Rosa Unit

8. FARM OR LEASE NAME
Rosa Unit

9. WELL NO.
#79

10. FIELD OR WILDCAT NAME
Blanco MV & Basin Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec 22 31N R6W


12. COUNTY OR PARISH
Rio Arriba

13. STATE
New Mexico

14. API NO.
30-039-22539

15. ELEVATIONS (SHOW DF, KDB, AND WD)

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

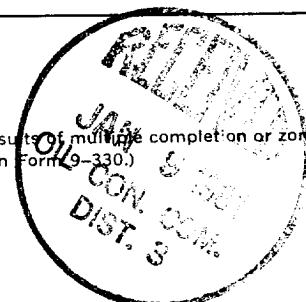

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

12-13-80 to 12-16-80 Drlg ahead to a depth of 7895' (TD)

12-17-80 Ran 192 jts (7881') of 5-1/2", 17#, N-80 Buttress csg and set at 7895' KB. Float collar at 7883'. Bj cemented w/ 220 sx Cl "B" w/ 8% gel, 12-1/2# fine gilsonite/sx and 0.4% HR-4. Tailed w/ 100 sx Cl "B" w/ 1/4# fine tuf plug and 0.4% HR-4. Displaced w/ 183 bbls and down at 1500 hrs 12-17-80. While displacing plug, well slugged approximately 5 bbls of wtr out blooie line. Rig released at 1900 hrs 12-17-80.

12-18-80 Wilson ran temp survey top of cement at 3700' w/ PBTD @ 7865'.
NOW WAITING ON COMPLETION

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Donna J. Brace TITLE Production Clerk DATE Dec 26, 1980

ACCEPTED FOR RECORD

(This space for Federal or State office use)

APPROVED BY JAN 07 1981
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE _____

FARMINGTON DISTRICT

NMOCC

*See Instructions on Reverse Side

djb/