


COPY FOR
STATE OF NEW MEXICO
**OIL CONSERVATION
COMMISSION**
SUBMIT IN TRIPLICATE TO
DISTRICT OFFICE

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 078385-A
Unit REPAIR

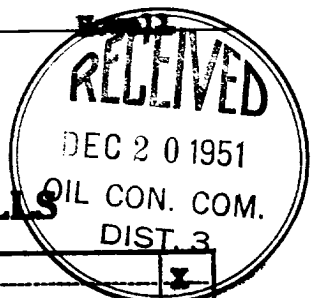

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF REDRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

..... December 14, 1951

Well No. 4-L is located 1650 ft. from N line and 1650 ft. from E line of sec. 34

SW NE Section 34 30N SW N. M. P. M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco - La Plata San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6147 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate muddling jobs, cementing points, and all other important proposed work)

On December 12, 1951:

Total depth 4510'.

Ran 140 joints of 7-inch OD 20 lb. J-55 casing (4498') set at 4510' with 300 sacks regular cement and three sacks Floccals. Top of cement by Temperature Survey 3550'.

Held 1,000 lbs. for ten hours.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company SAN JUAN PRODUCTION COMPANY

Address P. O. Box 997
Farrington, New Mexico

ORIGINAL SIGNED E. J. COEL

By _____

Title Petroleum Engineer