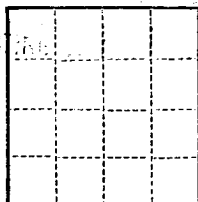


(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYLand Office **Santa Fe**Lease No. **070202**Unit **Schoen**

## SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....	<b>Water Fracture</b>	<b>X</b>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 31, 1956

Well No. 1 is located 790 ft. from N line and 1450 ft. from W line of sec. 27  
Section 27 30N 10W NMPN  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Artec P.C. San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)


The elevation of the derrick floor above sea level is 6077 ft.

## DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1-4-56 Plugback total depth 2750'.

Water fractured Pictured Cliffs through perforations 2586' - 2597', 2608' - 2615, 2624' - 2634', 2656' - 2663' with 41,405 gallons water and 57,400# sand. Breakdown pressure 1350#, maximum pressure 1350#, average treating pressure 1200#. Injection rate 38.9 bbls./min. Flush 4372 gallons. Natural gas none.

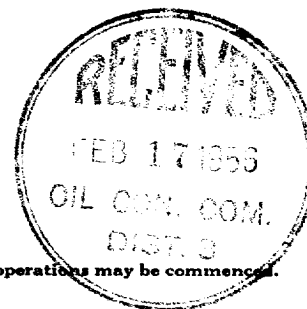

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas CompanyAddress Box 997Farmington, New MexicoBy E. S. OleskyTitle Petroleum Engineer