

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. SP-078107-A
Unit "K"
Co. Loc. No. PR 63-197-57

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

NORTH WATERFLOW UNIT

Farmington, New Mexico March 4, 1958

Well No. 1 is located 1980 ft. from S line and 1980 ft. from W line of sec. 28


NE 1/4 of SW 1/4 (1/4 Sec. and Sec. No.) T-30-N (Twp.) R-15-W (Range) NMPM (Meridian)
Wildcat (Field) San Juan (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 5219 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Set Baker CI Retainer at 4106'. Squeeze perforations from 4170' to 4338' w/100 sacks neat cement. Cut 5-1/2" casing at 3610'. Pull casing and set cement plugs 3650' to 3500' w/40 sacks neat cement and 1100' to 975' w/50 sacks. Spot 25' cement plug in top of surface casing and install markers.

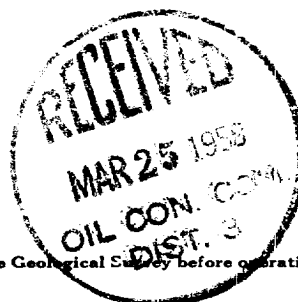

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Humble Oil & Refining Company

Address Box 1268

Farmington, New Mexico

By R. M. LILLY
Russell M. Lilly
Title Agent