

District I

P.O. Box 1980, Hobbs, NM

District II

P.O. Drawer, Artesia, NM 88211

District III

1000 Rio Brazos Rd. Aztec, NM 87410

OK

11/19/01

State Of New Mexico

Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

SUBMIT 1 COPY TO

APPROPRIATE

DISTRICT OFFICE

AND 1 COPY TO

SANTA FE OFFICE

(Revised 3/9/94)

PIT REMEDIATION AND CLOSURE REPORT

Operator:	<u>Conoco Inc.</u>		Telephone:	<u>505-324-5837</u>	
Address:	<u>3315 Bloomfield Hwy - Farmington, NM 87401</u>				
Facility Or:	<u>Federal C-1</u>				
Well Name					
Location:	Unit or Qtr/Qtr Sec	<u>F</u>	Sec	<u>28</u>	T <u>30</u> R <u>11W</u> County <u>San Juan</u>
Pit Type:	Separator		Dehydrator		Other <u>Tank Drain Pit</u>
Land Type:	BLM	<u>X</u>	State		Fee <u>Other</u>
Pit Location: (Attach diagram)	Pit dimension:	length	<u>12'</u>	width	<u>10'</u> depth <u>3'</u>
	Reference:	wellhead	<u>X</u>	other	
	Footage from reference:	<u>109'</u>			
	Direction from reference:	<u>143</u>	Degrees	<u>X</u>	East of <u>North</u> West <u>X</u> South

Depth To Ground Water:
(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)
50 feet to 99 feet (10 points)
Greater than 100 feet (0 points)

Total 0

Wellhead Protection Area:
(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points)
No (0 points)

Total 0

Distance To Surface Water:
(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points) (20 points)
200 feet to 1000 feet (10 points) (10 points)
Greater than 1000 feet (0 points) (0 points)

Total 10

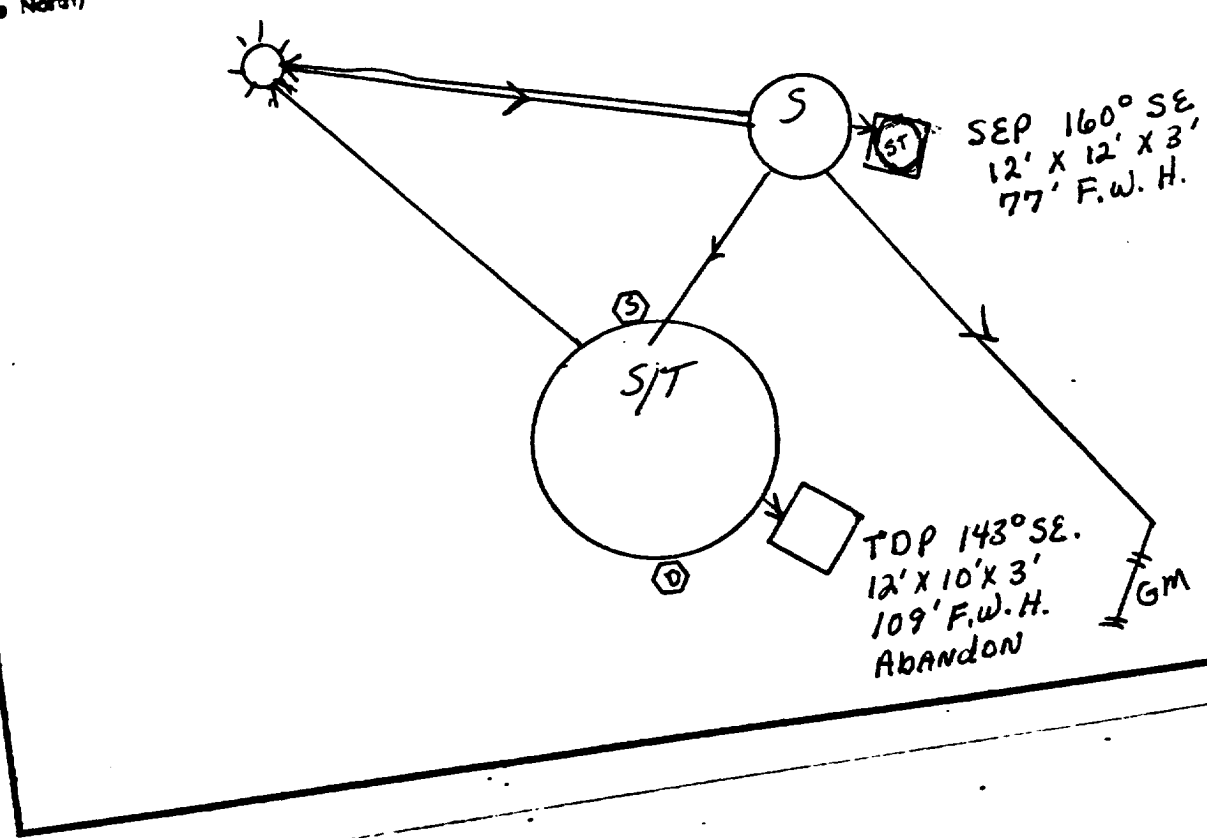
RANKING SCORE (TOTAL POINTS): 10



Date Remediation Started: _____		N/A		Date Completed: _____	
Remediation Method: _____		Excavation: _____		Approx. cubic yards _____	
(Check all appropriate sections)		Landfarm _____		Insitu Bioremediation _____	
Other _____		Landfarm _____		Insitu Bioremediation _____	
Remediation Location: _____		Onsite _____		Offsite _____	
(ie. landfarmed onsite, name and location of offsite facility)		_____		_____	
General Description Of Remedial Action: _____					
Dug pit out to 12' X 12' X 12' - Took samples. _____					
Ran OVM test and got a "zero" reading - no contamination. Backfilled pit with clean fill. Encountered no bad dirt. _____					
Composite sample: TPH = 1,005; _____					
Ground Water Encountered: _____					
No _____ Yes _____					
Sample location _____					
Center of pit bottom _____					
Composite: Center of sidewalls, North, South, East and West _____					
Sample depth _____					
12'					
Sample date _____					
4/1/1999					
Sample time _____					
8:37 AM					
Sample Results					
Benzene (ppm)		N/A		N/A	
Total BTEX (ppm)		N/A		N/A	
Field headspace (ppm)		0		0	
TPH		1		1	
Ground Water Sample:		Yes _____		No _____	
(If yes, attach sample results)		X _____		X _____	
I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF					
DATE		9/6/01		PRINTED NAME John E. Cofer	
SIGNATURE		[Signature]		AND TITLE Environmental Coordinator	

Operator: S. J. J. J. Date: 3-5-94

Lease Name: Federal C1
Site Security
(Indicate North)



Lease Name: Federal C1
Federal/ Indian Lease No: NMSE 078138
CA No.: 7940001810
Unit: F
Legal Description: Sect: 28 TP: 30N R: 11W
County: SAN JUAN, NM

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production

Production Line valve:
Sealed during sales

This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

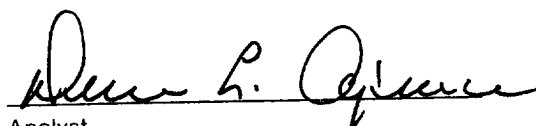
Client:	Conoco, Inc.	Project #:	707003
Sample ID:	TDP - Grab - CP	Date Reported:	04-02-99
Laboratory Number:	E936	Date Sampled:	04-01-99
Chain of Custody No:	6782	Date Received:	04-01-99
Sample Matrix:	Soil	Date Extracted:	04-02-99
Preservative:	Cool	Date Analyzed:	04-02-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	0.7	0.2
Diesel Range (C10 - C28)	0.7	0.1
Total Petroleum Hydrocarbons	1.4	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: Federal C - 1. OVM Reading 0.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons


Client:	Conoco, Inc.	Project #:	707003
Sample ID:	TDP - 4 Pt. Com.	Date Reported:	04-02-99
Laboratory Number:	E937	Date Sampled:	04-01-99
Chain of Custody No:	6782	Date Received:	04-01-99
Sample Matrix:	Soil	Date Extracted:	04-02-99
Preservative:	Cool	Date Analyzed:	04-02-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	673	0.2
Diesel Range (C10 - C28)	332	0.1
Total Petroleum Hydrocarbons	1,005	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: **Federal C - 1.**


Analyst


Review

CHAIN OF CUSTODY RECORD

6782

Client / Project Name		Project Location		ANALYSIS / PARAMETERS							
CONOCO INC.		Federal C-1									
Sampler: J. Valdez		Client No. 97070-03		Remarks							
Sample No./ Identification	Sample Date	Sample Time	Lab Number	Sample Matrix	No. of Containers	BTex 8021	TPH 8015	OVM 886	READING		
SEP - Grab-CP	4-1-99	0843	E934	Soil	1	✓	✓	886			
SEP - 4 PT. COM.	4-1-99	0904	E935	Soil	1	✓	✓				
TDP - Grab-CP	4-1-99	0837	E936	Soil	1	✓	✓	0			
TDP - 4 PT. COM.	4-1-99	0859	E937	Soil	1	✓	✓				
SEP - 4 PT. COM.	4-1-99	0015	E938	Soil - North Wall	1	✓	✓	2	Taken 5' from pit		
SEP Grab	4-1-99	0053	E939	Soil - West Side	1	✓	✓	1	Taken 10' from pit		
SEP Grab	4-1-99	0085	E940	Soil East Side	1	✓	✓	8	Taken 5' out		
SEP Grab	4-1-99	1050	E941	Soil - South Side	1	✓	✓	6	Taken 4' outside		
Relinquished by: (Signature) J. Valdez		Date 4/1/99		Time 10:50am		Received by: (Signature) Shirley Ebert		Date 4/1/99		Time 10:50am	
Relinquished by: (Signature) Shirley Ebert		Date 4/1/99		Time 12:25pm		Received by: (Signature) Joseph B. Mandy		Date 4/1/99		Time 12:30pm	
Relinquished by: (Signature)		Date		Time		Received by: (Signature)		Date		Time	

ENVIROTECH INC.

5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615

Sample Receipt

Received Intact	Y	N	N/A
Cool - Ice/Blue Ice	✓		