


(SUBMIT IN TRIPLICATE)

Land Office Santa Fe

Lease No. 078116

Unit _____

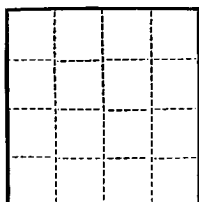

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REPAIR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 23, 19 62

Florence

Well No. 2 is located 920 ft. from [N] line and 990 ft. from [E] line of sec. 20

N1/4 Section 20
(1/4 Sec. and Sec. No.)

T-30-E
(Twp.)

R-9-W
(Range)

107N
(Meridian)

Blanco - Mesaverte
(Field)

San Juan
(County or Subdivision)

New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 3980 ft. G. L.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Killed well with water. Pulled tubing out of hole. Set bridge plug at 4232'. Ran Baker full bore pecker. Located holes in 7" casing between 1980' and 1979'. Squeezed with 300 sacks lacer cement, pressured casing to 1000 psi - held okay. Drilled cement to 1887', pressured to 700# (casing) - held okay. Cleaned out to 4263'. Ran 142 jts. 3-3/8" EUE tubing to 4267.52'. Now blowing well to clean up.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Delhi-Taylor Oil Corporation

Address P. O. Drawer 1193

Farmington, New Mexico

Original signed
by E. W. Guynn

Title District Engineer