

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 87 076194  
Unit E/1 Sec. 19

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	<input type="checkbox"/>
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	<input type="checkbox"/>
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	<input type="checkbox"/>
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	<input type="checkbox"/>
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	<input type="checkbox"/>
NOTICE OF INTENTION TO ABANDON WELL.....		<input type="checkbox"/>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

U. S. GEOLOGICAL SURVEY  
FARMINGTON, NEW MEXICO

June 24, 1960

**Delhi-Ludwick**

Well No. 1 is located 990 ft. from [N] line and 980 ft. from [E] line of sec. 19

NE 1/4 Sec. 19  
(1/4 Sec. and Sec. No.)

30N  
(Twp.)

10W  
(Range)

100M  
(Meridian)

Undes. Dakota  
(Field)

San Juan  
(County or Subdivision)

New Mexico  
(State or Territory)


**G. L.**

The elevation of the ~~delhi-ludwick~~ **G. L.** above sea level is 6340 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

After setting 7-5/8" casing, 6-3/4" hole was drilled w/gas to 4100 where it was wet and was necessary to mud up, hole was drilled and cased to TD of 7545 w/mud. 5-1/2" 17# J-35 casing was set at 7545 and cemented w/12% sz 50/50 pozzin, 4% gel, and 7% sz 50/50 pozzin 2% gel all containing 12-1/2% wilemrite per sz. Pair returns throughout job. Casing was pressured to 2000# for 1 hr. with no drop in pressure. Temperature survey indicated top at 4800'.

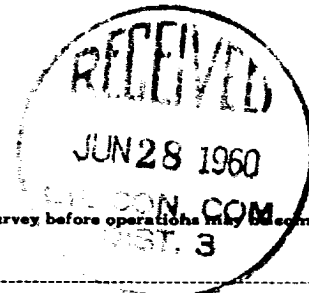

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Delhi-Taylor Oil Corporation

Address P. O. Box 1175

Farmington, New Mexico

By J. B. Howell  
Title Dist. Supt.