

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office New Mexico
Lease No. 53125
Unit San Juan

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	Water Frac. <input checked="" type="checkbox"/>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

12-12-1961

Well No. 11 is located 1080 ft. from XDD line and 1190 ft. from EXX line of sec. 11

S.W. Section 11 (1/4 Sec. and Sec. No.) 30-N (Twp.) 10-W (Range) N.M.P.M. (Meridian)


Blanco Mesa Verde (Field) San Juan (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 521 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 11-10-61, T.D. 5598'. C.O.T.D. 5570'. Perf P. L. @ 5400-04;
5412-1'; 5421-34; 5442-50; 5472-76; 5486-94; 5504-08; 5524-32;
Frac w/50,000 gal water, 50,000# sand. Flush w/7560 gallons,
I.R. 38.3 BPM. Max pr 3500#, BDP 2300#, 8 stages - dropped.
7 sets of 1" balls.

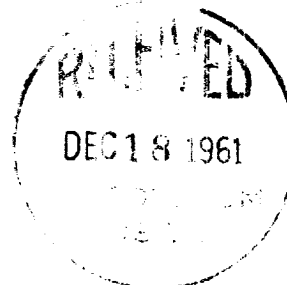

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 900

Farmington, New Mexico

By _____

Title Petroleum Engineer