

EPFS

EL PASO FIELD SERVICES

FIELD PIT SITE ASSESSMENT FORM

GENERAL

Meter: 73383 Location: MCKENZIE B#1 P/A
 Operator #: _____ Operator Name: TENNECO P/L District: KUTZ
UTRIACAL RT 3-14-95
 Coordinates: Letter: K Section 9 Township: 30 Range: 12
 Or Latitude _____ Longitude _____
 Pit Type: Dehydrator ☒ Location Drip: _____ Line Drip: _____ Other: _____
 Site Assessment Date: 3-14-95 Area: 02 in: 63

SITE ASSESSMENT

NMOCD Zone: (From NMOCD Maps) Inside ☒ (1) Outside ☐ (2)

Land Type: BLM ☒ (1) State ☐ (2) Fee ☐ (3) Indian _____

Depth to Groundwater

Less Than 50 Feet (20 points) ☐ (1)
 50 Ft to 99 Ft (10 points) ☒ (2)
 Greater Than 100 Ft (0 points) ☐ (3)

Wellhead Protection Area :

Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction? , or ; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points)

Horizontal Distance to Surface Water Body

Less Than 200 Ft (20 points) ☒ (1)
 200 Ft to 1000 Ft (10 points) ☐ (2)
 Greater Than 1000 Ft (0 points) ☐ (3)

Name of Surface Water Body EPHEMERAL DRAINAGE TO FLORA VISTA AERODROME

(Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds)

Distance to Nearest Ephemeral Stream ☐ (1) < 100' (Navajo Pits Only)
☐ (2) > 100'

TOTAL HAZARD RANKING SCORE: 30 POINTS


REMARKS

Remarks : REDLINE & TOPO SHOW LOCATION INSIDE U.Z. ONLY PIT ON LOCATION. BELONGS TO EPNG. LOCATION IS P/A. WILL CLOSE PIT.

ORIGINAL PIT LOCATION

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 16° Footage from Wellhead 137'
b) Length : 14' Width : 13' Depth : 1'

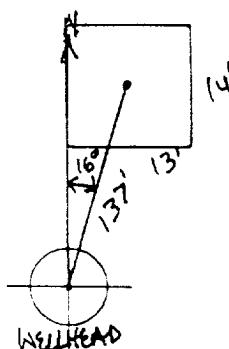

REMARKS

Remarks :

PHOTOS - 1400

Completed By:

Robert Champion
Signature

3.14.95
Date

FIELD PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: <u>73383</u> Location: <u>McKenzie IS #1</u> Coordinates: Letter: <u>K</u> Section <u>9</u> Township: <u>30</u> Range: <u>12</u> Or Latitude _____ Longitude _____ Date Started : <u>5/3/95</u> Run: <u>02</u> <u>63</u>
FIELD OBSERVATIONS	Sample Number(s): <u>KD 416</u> Sample Depth: <u>12'</u> Feet Final PID Reading <u>6 ppm</u> PID Reading Depth <u>12'</u> Feet Groundwater Encountered ☐ Yes ☒ No Approximate Depth _____ Feet
CLOSURE	Remediation Method : Excavation ☐ Approx. Cubic Yards <u>0</u> Onsite Bioremediation ☐ Backfill Pit Without Excavation ☒ Soil Disposition: Envirotech ☐ Tierra ☐ Other Facility ☐ Name: _____ Pit Closure Date: <u>5/3/95</u> Pit Closed By: <u>BEI</u>
REMARKS	Remarks : <u>Dug test Hole to 12', NO sign of Contamination,</u> <u>TOOK PID SAMPLE, closed pit.</u>
	Signature of Specialist: <u>Henry Damm</u>



FIELD SERVICES LABORATORY
ANALYTICAL REPORT

PIT CLOSURE PROJECT - Soil Samples Inside the GWV Zone

SAMPLE IDENTIFICATION

	Field ID	Lab ID
SAMPLE NUMBER:	KD 4/10	946782
MTR CODE SITE NAME:	73382	N/A
SAMPLE DATE TIME (Hrs):	5-3-95	0900
SAMPLED BY:	5-10-95 N/A	
DATE OF TPH EXT. ANAL.:	5-10-95	5-10-95
DATE OF BTEX EXT. ANAL.:	5/4/95	5/10/95
TYPE DESCRIPTION:	VG	Brown sand & clay

REMARKS:

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml)
BENZENE	<0.51	MG/KG	0.20408		4.90	20
TOLUENE	<0.51	MG/KG	1		1	1
ETHYL BENZENE	<0.51	MG/KG	1		1	1
TOTAL XYLENES	<1.53	MG/KG	1		1	1
TOTAL BTEX	<3.06	MG/KG				
TPH (418.1)	64.5	MG/KG			2.01	28
HEADSPACE PID	6	PPM				
PERCENT SOLIDS	94.0835	%				

-- TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 --

The Surrogate Recovery was at 76.4 % for this sample All QA/QC was acceptable.

Narrative:

DF = Dilution Factor Used

Approved By:

[Signature]

Date:

[Signature]