

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 078336  
Unit Lindsay

SUNDRY NOTICES AND REPORTS ON WELLS

|  |  |  |                                     |
|--|--|--|-------------------------------------|
| NOTICE OF INTENTION TO DRILL                   |  | SUBSEQUENT REPORT OF WATER SHUT-OFF        | <input checked="" type="checkbox"/> |
| NOTICE OF INTENTION TO CHANGE PLANS            |  | SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING |                                     |
| NOTICE OF INTENTION TO TEST WATER SHUT-OFF     |  | SUBSEQUENT REPORT OF ALTERING CASING       |                                     |
| NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL |  | SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR |                                     |
| NOTICE OF INTENTION TO SHOOT OR ACIDIZE        |  | SUBSEQUENT REPORT OF ABANDONMENT           |                                     |
| NOTICE OF INTENTION TO PULL OR ALTER CASING    |  | SUPPLEMENTARY WELL HISTORY                 |                                     |
| NOTICE OF INTENTION TO ABANDON WELL            |  |  |                                     |

RECEIVED  
OCT 31 1958

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 30, 1958

Well No. 2 is located 790 ft. from [N] line and 1450 ft. from [E] line of sec. 11


NE Sec. 11 30N 9W N.M.P.M.  
( $\frac{1}{4}$  Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Blanco San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5892 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

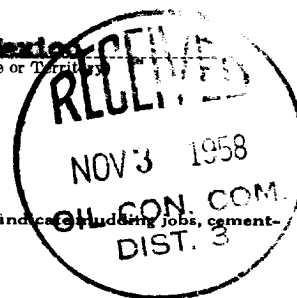

On 10-22-58. Total Depth 5118'.

Ran 23 joints 5 1/2", J-55, 15.50#, liner (886') set from 4202' to 5088' with 75 sacks regular cement, 75 sacks Pozmix, 1/8# Floccula/sk and 6# Gel, followed with 50 sacks Neat cement.

Held 1000# for 30 minutes.

Squeezed liner hanger w/100 sks. Neat.

No temp. survey.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By Original Signed D. W. Meehan

Title Petroleum Engineer