

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Budget Bureau No. 42-R358.4.
Form Approved.

Land Office Santa Fe

Lease No. 078212

Unit _____

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

U. S. GEOLOGICAL SURVEY
SANTA FE, NEW MEXICO

January 4, 1963

Well No. Rourke 1-4 is located 790 ft. from ☒ S line and 790 ft. from ☒ W line of sec. 4

SW/4 4 30N 13W NMPM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)


Basin Dakota San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5574 ft. GL
5586 KB

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled 8-3/4" hole to 6228'. Ran 198 joints of 4-1/2" 9.5 lb. J-55 casing set at 6228'. Cemented through shoe with 292 sx. Diamix "A". Bumped plug with 2000 psi, held OK. Cemented through stage collar at 4186' with 82 sx. 40% Diacel "D". Bumped plug with 1800 psi, held OK. Plug down at 12:30 A.M., 12/13/62.

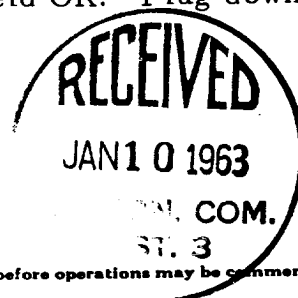

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Consolidated Oil & Gas, Inc.

Address 4150 E. Mexico Avenue

Denver 22, Colorado

By William

Title Chief Engineer