
Denny 2, 745

DEC 22100

Meter Number:73935 bcation Name:L.C. KELLY #4 Location:TN-30 RG-12 SC-03 UL-L 2 - Federal

NMOCD Zone:OUTSIDE Hazard Ranking Score:00

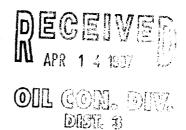

RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS LOCATED OUTSIDE OF THE VULNERABLE ZONE IN THE SAN JUAN BASIN

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1,000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

Sandstone 10^{-9} to 10^{-13} cm/sec Shale 10^{-12} to 10^{-16} cm/sec Clay 10^{-12} to 10^{-15} cm/sec

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.

Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.

GENERAL	Meter: 73935 Location: L.C. KELLY #4 Operator #: 0203 Operator Name: Amoco P/L District: Kurz Goordinates: Letter: M Section 3 Township: 30 Range: 12 Or Latitude Longitude Pit Type: Dehydrator X Location Drip: Line Drip: Other: Site Visit Date: 4.1.94 Run: 02 63					
SITE ASSESSMENT	IMOCD Zone: Inside Land Type: BLM State Maps) Zone Outside Indian Indian Depth to Groundwater Less Than 50 Feet (20 points) Freater Than 100 Ft (0 points) Sit less than 1000 ft from wells, springs, or other sources of resh water extraction?, or; is it less than 200 ft from a private domestic water source? Freater Than 200 Ft (20 points) Morizontal Distance to Surface Water Body Less Than 200 Ft (20 points) Concept Than 1000 Ft (0 points) Concept Than 1000 Ft (0 points) Concept Than 1000 Ft (0 points) Concept Than 1000 Ft (10 points)					
	Irrigation Canals, Ditches, Lakes, Ponds) TOTAL HAZARD RANKING SCORE: POINTS					
REMARKS	Remarks: Two PITS ON LOCATION. WILL CLOSE ONLY ONE. PIT IS					

	ORIGINAL PIT LOCATION
	Original Pit : a) Degrees from North <u>264°</u> Footage to Wellhead <u>124'</u> b) Degrees from North Footage to Dogleg
ATION	Dogleg Name c) Length : Width : Depth :
ORIGINAL PIT LOCATION	12' NEILMENO 264°
REMARKS	Remarks: STARTED TAKING PICTURES AT 10:25 A.M. END DUMP
	Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By: Completed By:

FIEL PIT REMEDIATION/CLOSU : FORM

GENERAL	Meter: 73935 Location: L.C. Kelly #4 Coordinates: Letter: L Section 3 Township: 30 Range: 12 Or Latitude Longitude Longitude Longitude Run: 63
FIELD OBSERVATIONS	Sample Number(s): \(\frac{\lorent \wedge 0}{\lorent \wedge} \) Sample Depth: \(\frac{12}{\sumset \text{Feet}} \) Feet Final PID Reading \(\frac{176}{\sumset \text{Yes}} \) Yes No Groundwater Encountered \(\begin{array}{c} \lorent \wedge 2 \end{array} \) Feet
CLOSURE	Remediation Method: Excavation Onsite Bioremediation Backfill Pit Without Excavation [] (1) Approx. Cubic Yards [] (2) [] (3)
	Other Facility (2) Name:
REMARKS	Remarks: EPNG I.m. Majkes. H. + Rock at 12'
	Signature of Specialist: Vale Wilson (SP3191) 04/07/94



FIELD SERVICES LABORATORY ANALYTICAL REPORT PIT CLOSURE PROJECT - Soil

SAMPLE IDENTIFICATION

	Field	ID		Lab ID		
SAMPLE NUMBER:	VW50			945118		
MTR CODE SITE NAME:				N/A		
SAMPLE DATE TIME (Hrs):	5-10-91		1230			
SAMPLED BY:	N/A					
DATE OF TPH EXT. ANAL.:			5-12-94			
DATE OF BTEX EXT. ANAL.:						
TYPE DESCRIPTION:			Brown Sand/Clay			
REMARKS:	-	RESULTS				
PARAMETER	RESULT UNITS QUALIF		ERS V(ml			
BENZENE		MG/KG				
TOLUENE		MG/KG				
ETHYL BENZENE		MG/KG				
TOTAL XYLENES		MG/KG				
TOTAL BTEX		MG/KG				
ТРН (418.1)	2000	MG/KG			2.0	28
HEADSPACE PID	176	PPM				
PERCENT SOLIDS	38.0	%				
	- TPH is by EPA Method 4	418.1 and BTEX is by EPA!		was acce	ntable.	

DF = Dilution Factor Used

74/05/12 13:07

Sample identification 945118

*4DIIB

Initial mass of sample, g


1.000

Yolume of sample after extraction, ml

Petroleum hydrocarbons, ppm 1996.427

Net absorbance of hydrocarbons (2930 c.m-1)

244

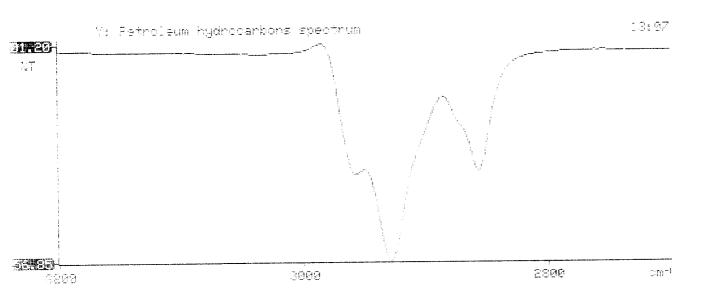

ILLEGIBLE