


ILLEGIBLE

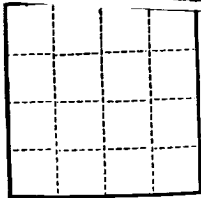

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. SM 078526
Unit SM 1/4, Sec. 1, T-31N,
R-9W, N.M.P.M.
San Juan County,
New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....		SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....		SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....		SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....		SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		<u>Setting 7 5/8" Casing</u>	<u>X</u>
<u>Setting Surface Casing</u>	<u>X</u>	<u>Setting 5 1/2" Casing</u>	<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 2, 1957

Well No 6 Nordhaus is located 220 ft. from N line and 1300 ft. from W line of sec. 1

SM 1/4, Sec. 1 31N 9W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco Reservoir San Juan County New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6606 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

1. Cemented 230' of 10 3/4" casing with 200 sacks cemented and 3% Calcium Chloride on June 23, 1957. Drilled plug and tested with 5-0% pressure on June 24, 1957. 32.75# H-40 Casing
2. Cemented 3645 of 7 5/8" casing with 150 sacks cement and 2% calcium chloride on July 11, 1957. 26.40# J-55 Casing
3. Cemented 5 1/2" liner - bottom at 6118, top at 3420 - with 300 sacks cement and 2% gel on July 17, 1957. 15.50 # J-55 Casing

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Southern Union Gas Company

Address 1104 Hurt Building

Dallas 1, Texas

Attention: Mr. A. P. Wiedersheim

By Paul J. Blate

Title Drilling Supt.