

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

USA-NM-013686

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Tenneco Oil Company

3. ADDRESS OF OPERATOR

1860 Lincoln, 1200 Lincoln Twr. Bldg., Denver, CO 80203

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1840' FNL and 1660' FWL

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Pritchard

9. WELL NO.

1A

10. FIELD AND POOL, OR WILDCAT

Blanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 1, T30N, R9W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6023' GL

12. COUNTY OR PARISH

13. STATE

San Juan

New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7/8- 8/14/75 Waiting on Completion Unit.

8/14 Squeezed 4½ x 7" liner lap with 50 sacks.


8/15 - 8/17 Drilling out and preparing to perforate.

8/18 Perforated Pt. Lookout, 14 holes, 5207, 4, 5200, 5175, 43, 33, 17, 06, 02, 5097, 92, 88, 51, 48. Used acid and ball sealers. Frac'd 37 BPM w/57,600# sd & 1471 bbl wtr.

8/19 Perforated Menefee with 19 holes, 5024, 21, 4983, 30 25, 13, 5, 4899, 88, 17, 13, 9, 6, 4766, 61, 56, 54, 31, 29. Broke down perfs with acid and ball sealers. Frac'd with 54,200# 20/40 sand and 1514 bbl wtr.

8/20 Perforated Cliffhouse with 18 holes, 4690, 4681, 78, 75, 56, 52, 48, 31, 28, 6, 4588, 86, 78, 4481, 4440, 4355, 4351, 4348. Broke down with acid and ball sealers. Frac'd with 1407 barrels fresh water with 67,200# 20/40 sand.

8/21 - 8/24 Ran tubing, swabbed to clean well bore. Installed x-mas tree Aug. 24, 1975.

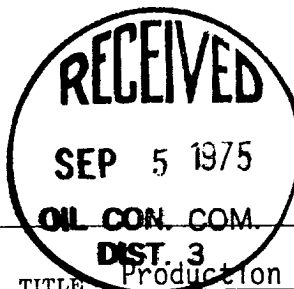

RECEIVED

SEP 4 1975

U. S. GEOLOGICAL SURVEY
FARMINGTON, N.M.

18. I hereby certify that the foregoing is true and correct

SIGNED

Paul H. Decker

TITLE

Production Clerk

DATE 9/2/75

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE