Denny S. Frant
DERITY ON & GAS INSPECTION

DEC 2 2 1997

Meter Number:89987
Location Name:GARTNER A #5A
Location:TN-30 RG-08
SC-27 UL-F
2 - Federal

NMOCD Zone: OUTSIDE Hazard Ranking Score: 00



OIL CON. DIV. Dist. 2

#### RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS LOCATED OUTSIDE OF THE VULNERABLE ZONE IN THE SAN JUAN BASIN

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1,000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

Sandstone 10<sup>-9</sup> to 10<sup>-13</sup> cm/sec Shale 10<sup>-12</sup> to 10<sup>-16</sup> cm/sec Clay 10<sup>-12</sup> to 10<sup>-15</sup> cm/sec

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.

Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.

EPFE


## FIELD PIT SITE ASSESSMENT FORM EL

GENERAL	Meter: 89987 Location: Gartner A No. 5A  Operator #: DAD3 Operator Name: Anno P/L District: Bloomfield  Coordinates: Letter: F Section 27 Township: DD Range: 8  Or Latitude Longitude Pit Type: Dehydrator Location Drip: Line Drip: Other:  Site Assessment Date: 1/19/95 Area: 10 Run: 63				
	NMOCD Zone:       Land Type:       BLM       (1)         (From NMOCD       State       (2)         Maps)       Inside       (1)       Fee       (3)         Outside       (2)       Indian				
SITE ASSESSMENT	Wellhead Protection Area:  Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction?, or; Is it less than 200 ft from a private domestic water source? (1) YES (20 points) (2) NO (0 points)				
	Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) (1) 200 Ft to 1000 Ft (10 points) (2) Greater Than 1000 Ft (0 points) (3) Name of Surface Water Body				
	(Surface Water Body: Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds)  Distance to Nearest Ephemeral Stream (1) < 100'(Navajo Pits Only)  (2) > 100'				
	TOTAL HAZARD RANKING SCORE: POINTS				
RKS	Remarks: Realine Book: Outside Vulnerable Zone Topo: Outside				
REMARKS	Lists. Closel. Dehy on pit. Pit also used as location drip for Meter. House # 9590b.				
<u>R</u>	PUZH-IN				

#### ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 60° Footage from Wellhead 30′

b) Length : <u>31'</u> Width : <u>48'</u> Depth : <u>4'</u>

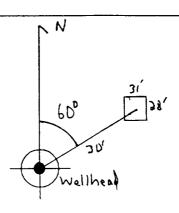

Remarks	:	
_		

Pictures @ 0903 hr 9-12 roll 2

Completed By:

Signature

1/19/95 Date

## FIELD PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: 89987 Location: GarTner A No. 5A  Coordinates: Letter: F Section 27 Township: 30 Range: 8  Or Latitude Longitude Date Started: 2.22-95 Run: 10 63
FIELD OBSERVATIONS	Sample Number(s): $\cancel{KP427}$
SURE	Remediation Method:  Excavation
SOTO	Soil Disposition:  Envirotech
REMARKS	Remarks: Some Live markers dug A Test To 12' Sampled Closed Pit.
	Signature of Specialist: Kelly Padille



# FIELD SERVICES LABORATORY ANALYTICAL REPORT

### PIT CLOSURE PROJECT - Soil Samples Outside the GWV Zone

#### SAMPLE IDENTIFICATION

Field	I ID		Lab ID			
8: KP 427 E: 89987		946691 N/A				
2 - 22	2-22-95 0915		_			
N/A						
2-28-	2-28-95		2-28-95			
		Dark Gray-				
				Claw	ı	
1000 T						
RESULT	UNITS	DF	QUALIFIERS Q M(g)		V(ml)	
19600	MG/KG			0.51	58	
462	PPM					
91.2	%	1				
	TPH is by EPA Metho	od 418.1				
	\$9987 2-22 2-28-	19600 MG/KG 1960 MG/KG 1960 MG/KG 1960 MG/KG 1960 MG/KG 1960 MG/KG	89987 2 - 22 - 95  N/A  2 - 28 - 95  RESULTS  RESULT  UNITS  DF  19600  MG/KG  PPM	\$9987   N/A     2 - 22 - 95   O915     N/A     2 - 28 - 95   2 - 28 - 95     N G	\$9987   N/A	

