

U.S. GEOLOGICAL SURVEY
May 1977

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

(Other instructions on reverse side)

PROJECT NUMBER NO. 522142
5. LEASE DESIGNATION AND SERIAL NO.

82-080003

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals.)


1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Tenneco Oil Company		8. FARM OR LEASE NAME Florance
3. ADDRESS OF OPERATOR 720 So. Colorado Blvd., Denver, Colorado 80222		9. WELL NO. 3B
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1460' FSL and 840' FEL, Unit I		10. FIELD AND POOL, OR WILDCAT Blanco Mesaverde
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 22, T30N, R9W
15. ELEVATIONS (Show whether DF, RT, GK, etc.) 6080' GL		12. COUNTY OR PARISH San Juan
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF	☐	WATER SHUT-OFF	☒
FRACTURE TREATMENT	☐	FRACTURE TREATMENT	☐
SHOOT OR ACIDIZE	☐	SHOOTING OR ACIDIZING	☐
REPAIR WELL	☐	(Other)	☐
(Other)	☐	(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	
PULL OR ALTER CASING	☐	REPAIRING WELL	☐
MULTIPLE COMPLETE	☐	ALTERING CASING	☐
ABANDON*	☐	ABANDONMENT*	☐
CHANGE PLANS	☐		

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting a proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

2/21 - 2/27/78 Drilled 8-3/4" hole to 3120'. Set and cemented 75 jts of 7" 23#K-55 ST & C csg. at 3120' with 350 sacks of 65/35 poz w/12% Gel and 12-1/2 lb/sack of gilsonite. Tailed in with 150 sacks of Class B cement with 3% CaCl₂. Drilled 6-1/4" hole to 5118'. Set and cemented 70 jts of 4-1/2" 10.5 lb., K-55, ST & C csg. liner from 2916' - 5118' with 270 sacks of Class B cement. Present status = Waiting on completion unit.

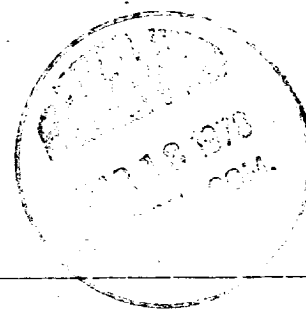

18. I hereby certify that the foregoing is true and correct.

SIGNED A. P. Meyer TITLE Div. Production Manager DATE 3-6-78

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

MAR 10 1978

*See Instructions on Reverse Side

U.S. Geological Survey
Farmington, N.M.