

| | |
|------------------------|--|
| NO. OF COPIES RECEIVED | |
| DISTRIBUTION | |
| SANTA FE | |
| FILE | |
| U.S.G.S. | |
| LAND OFFICE | |
| OPERATOR | |

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

| | |
|--|--|
| 5a. Indicate Type of Lease State <input type="checkbox"/> Fee <input checked="" type="checkbox"/> | |
| 5. State Oil & Gas Lease No. | |
| 7. Unit Agreement Name | |
| 8. Farm or Lease Name Fee | |
| 9. Well No. 9 | |
| 10. Field and Pool, or Wildcat Blanco MV | |
| 12. County San Juan | |

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
 USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☐ GAS WELL ☒ OTHER-
 Name of Operator
E Operators, Inc.
 Address of Operator
Energy Square, Suite 170, Dallas, Texas 75206
 Location of Well
 UNIT LETTER D 152' FEET FROM THE North LINE AND 900 FEET FROM
West LINE, SECTION 9 TOWNSHIP 30N RANGE 11W NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
5629' Gr.; 5641' KB

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
 NOTICE OF INTENTION TO:

FORM REMEDIAL WORK ☐
 TEMPORARILY ABANDON ☐
 OR ALTER CASING ☐
 OTHER ☐

PLUG AND ABANDON ☐
 CHANGE PLANS ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
 COMMENCE DRILLING OPNS. ☒
 CASING TEST AND CEMENT JOB ☐
 OTHER ☐

ALTERING CASING ☐
 PLUG AND ABANDONMENT ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1-21 & 22, 1981. Drilled 12 1/4" hole & drove/set 48' of 13-3/8" conductor pipe to 48' GL. through boulder section by Corrosion Control.
 1-30-81 Moved in Young Drilg. Co. Rig No. 2. Spud w/rotary @ 2:00 PM. @ 74' KB
 Drilled 12-1/4" hole to 284'. Ran 7 jts. 9-5/8" 36# J Rg. 2 & 3 Cl. A casing, tally 260.41' Set @ 272' and cemented by HOWCO w/160 sx. Cl. "B", 3% CaCl. & #/sx. flocele. Displaced to 245'. Cement circulated. Comp. @ 8:15 PM
 1-30-81. WOC - 14 hrs. Nipped up BOP's and bleed-off manifold. Press. test to 600 psi. 30 min. OK. Drilled out cement w/8-3/4" bit to set 7" casing.

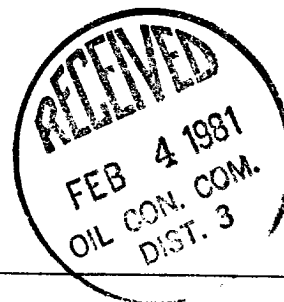

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Frank T. Chavez

TITLE ConsultantDATE 2-3-81

Original Signed by FRANK T. CHAVEZ

SUPERVISOR DISTRICT 3DATE FEB 4 1981

CONDITIONS OF APPROVAL, IF ANY: