

District I
P.O. Box 1980, Hobbs, NM
District II
P.O. Drawer DD, Artesia, NM 88211
District III
600 Rio Brazos Rd, Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

BR-310
SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE

sep-bedrock

Blow-bedrock

Dhy-bedrock

OCT 21 1999

PIT REMEDIATION AND CLOSURE REPORT

OIL CON. DIV.
DIST. 3

Operator: R. C. RESOURCES COMPANY INC. Telephone: (505) 326-6903

Address: 501 AIRPORT DR., SUITE 161, FARMINGTON, NEW MEXICO 87499

Facility Or: MCCORD 7E
Well Name

Location: Unit or Qtr/Qtr Sec P Sec 4 T30N R13W County SAN JUAN

Pit Type: Separator ☒ Dehydrator ☐ Other ☐ PRODUCTION TANK COMBO

Land Type: BLM ☒, State ☐, Fee ☐, Other ☐

Pit Location: Pit dimensions: length 18', width 20', depth 5'
(Attach diagram) Reference: wellhead ☒, other ☐

Footage from reference: 100'

Direction from reference: 76 Degrees ☒ East North ☐
of ☐ West South ☒

Depth To Ground Water:
(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)
50 feet to 99 feet (10 points)
Greater than 100 feet (0 Points) 0

Wellhead Protection Area:
(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points)
No (0 points) 0

Distance To Surface Water:
(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points)
200 feet to 1000 feet (10 points)
Greater than 1000 feet (0 points) 0

RANKING SCORE (TOTAL POINTS) 0

BK 310

Date Remediation Started: _____

Date Completed: 10/12/95Remediation Method: Excavation ☒
(Check all appropriate sections) Landfarmed ☒Approx. cubic yards 40

Insitu Bioremediation _____

Other _____

Remediation Location:
(ie. landfarmed onsite,
name and location of
offsite facility)Onsite ☒ offsite _____

General Description Of Remedial Action: _____

Excavation - BEDROCK BOTTOM

Ground Water Encountered: _____

No ☒

Yes _____

Depth _____

Final Pit:

Closure Sampling:

(if multiple samples,
attach sample results
and diagram of sample
locations and depths)Sample location see Attached DocumentsSample depth 1'Sample date 10/12/95Sample time 1125

Sample Results

Benzene(ppm) _____

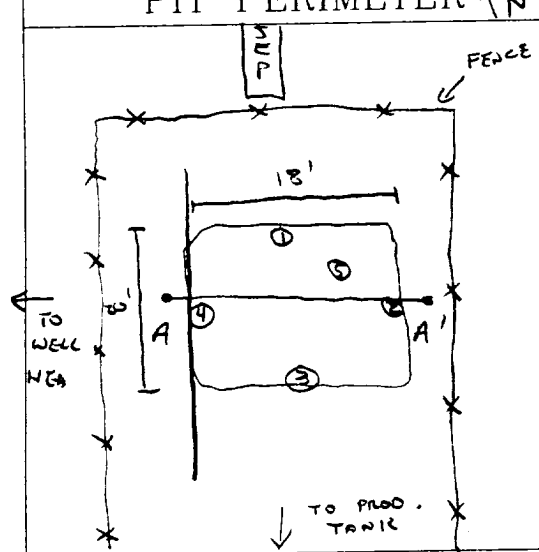
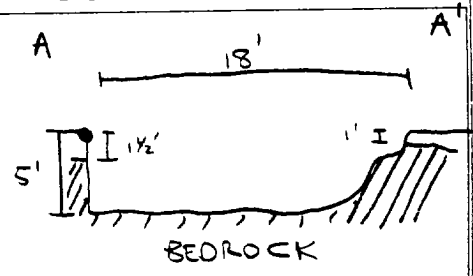
Total BTEX(ppm) _____

Field headspace(ppm) 4.3TPH 840 ppmGround Water Sample: Yes _____ No ☒ (If yes, attach sample results)I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST
OF MY KNOWLEDGE AND BELIEFDATE 10/12/95

SIGNATURE

PRINTED NAME
AND TITLERobert R. Clark - President

3004524744

CLIENT: <u>R.R. CLICK</u>	BLAGG ENGINEERING, INC. P.O. BOX 87, BLOOMFIELD, NM 87413 (505) 632-1199	LOCATION NO: <u>BR310</u> C.O.C. NO: _____																																								
FIELD REPORT: CLOSURE VERIFICATION		PAGE No: <u>1</u> of <u>1</u>																																								
LOCATION: NAME: <u>McCord</u> WELL #: <u>7E</u> PIT: <u>SEP/PROD</u>		DATE STARTED: <u>10/12/95</u> DATE FINISHED: _____																																								
QUAD/UNIT: <u>P</u> SEC: <u>4</u> TWP: <u>30N</u> RNG: <u>13W</u> PM: <u>NM</u> CNTY: <u>ST</u> ST: <u>NM</u>		ENVIRONMENTAL SPECIALIST: <u>NV</u>																																								
QTR/FOOTAGE: <u>1000' FSL / 310' FEL</u> CONTRACTOR: <u>EPC</u>																																										
EXCAVATION APPROX. <u>18</u> FT. x <u>20</u> FT. x <u>5'</u> FT. DEEP. CUBIC YARDAGE: <u>40</u>																																										
DISPOSAL FACILITY: <u>ON-SITE</u> REMEDIATION METHOD: <u>LANDFARMED</u>																																										
LAND USE: <u>RANGE</u> LEASE: <u>SF - 078212</u> FORMATION: <u>DR</u>																																										
FIELD NOTES & REMARKS: PIT LOCATED APPROXIMATELY <u>100'</u> FT. <u>576E</u> FROM WELLHEAD.																																										
DEPTH TO GROUNDWATER: <u>2100'</u> NEAREST WATER SOURCE: <u>21000'</u> NEAREST SURFACE WATER: <u>21200'</u>																																										
NMOC RANKING SCORE: <u>0</u> NMOC TPH CLOSURE STD: <u>5000</u> PPM																																										
SOIL AND EXCAVATION DESCRIPTION: <u>ELEV. 5701'</u>		CHECK ONE: ☐ PIT ABANDONED ☒ <u>STEEL</u> TANK INSTALLED <u>FIBERGLASS</u>																																								
EAST SIDEWALL - DK. YELL. BROWN SAND NON-COHESIVE, SLIGHTLY MOIST FIRM, NO APPARENT HC ODOR IN OVM SAMPLE. REMAINING SIDEWALLS + BOTTOM - SANDSTONE, DENSE TO VERY HARD, COLOR VARYING W/ BOTTOM BEING BLACK, STRONG HC ODOR IN ALL OVM SAMPLES.																																										
FIELD 418.1 CALCULATIONS																																										
<table border="1" style="width:100%; border-collapse: collapse;"> <thead> <tr> <th>TIME</th> <th>SAMPLE I.D.</th> <th>LAB No:</th> <th>WEIGHT (g)</th> <th>mL. FREON</th> <th>DILUTION</th> <th>READING</th> <th>CALC. ppm</th> </tr> </thead> <tbody> <tr> <td>1125</td> <td>② @ 1'</td> <td>TM-1615</td> <td>5</td> <td>20</td> <td>1:1</td> <td>210</td> <td>840</td> </tr> <tr><td> </td><td> </td><td> </td><td> </td><td> </td><td> </td><td> </td><td> </td></tr> <tr><td> </td><td> </td><td> </td><td> </td><td> </td><td> </td><td> </td><td> </td></tr> <tr><td> </td><td> </td><td> </td><td> </td><td> </td><td> </td><td> </td><td> </td></tr> </tbody> </table>			TIME	SAMPLE I.D.	LAB No:	WEIGHT (g)	mL. FREON	DILUTION	READING	CALC. ppm	1125	② @ 1'	TM-1615	5	20	1:1	210	840																								
TIME	SAMPLE I.D.	LAB No:	WEIGHT (g)	mL. FREON	DILUTION	READING	CALC. ppm																																			
1125	② @ 1'	TM-1615	5	20	1:1	210	840																																			
SCALE  0 FT PIT PERIMETER  OVM RESULTS <table border="1" style="width:100%; border-collapse: collapse;"> <thead> <tr> <th>SAMPLE ID</th> <th>FIELD HEADSPACE PID (ppm)</th> </tr> </thead> <tbody> <tr><td>1 @ 2'</td><td>188.5</td></tr> <tr><td>2 @ 1'</td><td>4.3</td></tr> <tr><td>3 @ 4'</td><td>1010</td></tr> <tr><td>4 @ 2'</td><td>922</td></tr> <tr><td>5 @ 5'</td><td>1078</td></tr> <tr><td> </td><td> </td></tr> <tr><td> </td><td> </td></tr> <tr><td> </td><td> </td></tr> <tr><td> </td><td> </td></tr> <tr><td> </td><td> </td></tr> </tbody> </table> PIT PROFILE 			SAMPLE ID	FIELD HEADSPACE PID (ppm)	1 @ 2'	188.5	2 @ 1'	4.3	3 @ 4'	1010	4 @ 2'	922	5 @ 5'	1078																												
SAMPLE ID	FIELD HEADSPACE PID (ppm)																																									
1 @ 2'	188.5																																									
2 @ 1'	4.3																																									
3 @ 4'	1010																																									
4 @ 2'	922																																									
5 @ 5'	1078																																									
LAB SAMPLES <table border="1" style="width:100%; border-collapse: collapse;"> <thead> <tr> <th>SAMPLE ID</th> <th>ANALYSIS</th> <th>TIME</th> </tr> </thead> <tbody> <tr><td> </td><td> </td><td> </td></tr> <tr><td> </td><td> </td><td> </td></tr> <tr><td> </td><td> </td><td> </td></tr> <tr><td> </td><td> </td><td> </td></tr> <tr><td> </td><td> </td><td> </td></tr> </tbody> </table> TRAVEL NOTES: CALLOUT: <u>5/12/95 MORN.</u> ONSITE: <u>5/12/95 MORN.</u>			SAMPLE ID	ANALYSIS	TIME																																					
SAMPLE ID	ANALYSIS	TIME																																								

BLAGG ENGINEERING, INC.

P.O. Box 87, Bloomfield, New Mexico 87413

Phone: (505)632--1199 Fax: (505)632--3903

**FIELD MODIFIED EPA METHOD 418.1
TOTAL PETROLEUM HYDROCARBONS**

Client: R.R. CLICK
Sample ID: 2 @ 1'
Project Location: McCord 7E
Laboratory Number: TPH-1615

Project #:
Date Analyzed: 10-12-95
Date Reported: 10-12-95
Sample Matrix: Soil

Parameter	Result, mg/kg	Detection Limit, mg/kg
Total Recoverable Petroleum Hydrocarbons	840	20

ND = Not Detectable at stated detection limits.

QA/QC:	QA/QC Sample TPH mg/kg	Duplicate TPH mg/kg	% *Diff.
	920	910	1.09

*Administrative Acceptance limits set at 30%.

Method: Modified Method 418.1, Petroleum Hydrocarbons, Total
Recoverable, Chemical Analysis of Water and Waste,
USEPA Storet No.4551, 1978

Comments: Separator/Production Tank Pit - BR310

Nelson Velez
Analyst

R. E. O'Neill
Review

District I
P.O. Box 1980, Hobbs, NM
District II
P.O. Drawer DD, Artesia, NM 88211
District III
000 Rio Brazos Rd, Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE

PIT REMEDIATION AND CLOSURE REPORT

Operator: R. C. RESOURCES COMPANY INC. Telephone: (505) 326-6903

Address: 501 AIRPORT DR., SUITE 161, FARMINGTON, NEW MEXICO 87499

Facility Or: MCCORD 7E
Well Name

Location: Unit or Qtr/Qtr Sec P Sec 4 T30N R13W County SAN JUAN

Pit Type: Separator Dehydrator Other BLOW

Land Type: BLM ✓, State , Fee , Other

Pit Location: Pit dimensions: length 80', width 35', depth 6'
(Attach diagram) Reference: wellhead X, other

Footage from reference: 75'

Direction from reference: 61 Degrees East North X
X West South

Depth To Ground Water:
(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)
50 feet to 99 feet (10 points) 0
Greater than 100 feet (0 Points)

Wellhead Protection Area:
(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points)
No (0 points) 0

Distance To Surface Water:
(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points)
200 feet to 1000 feet (10 points) 0
Greater than 1000 feet (0 points)

RANKING SCORE (TOTAL POINTS): 0

BR310

Date Remediation Started: _____

Date Completed: 10/12/95Remediation Method: Excavation ☒
(Check all appropriate sections)Landfarmed ☒Approx. cubic yards 325

Insitu Bioremediation _____

Other _____

Remediation Location:
(ie. landfarmed onsite,
name and location of
offsite facility)Onsite ☒ Offsite _____

General Description of Remedial Action: _____

Excavation - BEDROCK BOTTOM

Ground Water Encountered: _____

No ☒

Yes _____

Depth _____

Final Pit:

Closure Sampling:
(if multiple samples,
attach sample results
and diagram of sample
locations and depths)Sample location see Attached DocumentsSample depth 3'Sample date 10/12/95Sample time 1210

Sample Results

Benzene(ppm) _____

Total BTEX(ppm) _____

Field headspace(ppm) 27.4TPH 48 ppmGround Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE 10/12/95

SIGNATURE

PRINTED NAME
AND TITLERobert R. Clark - President

BLAGG ENGINEERING, INC.

P.O. Box 87, Bloomfield, New Mexico 87413

Phone: (505)632-1199 Fax: (505)632-3903

FIELD MODIFIED EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client: R.R. CLICK
Sample ID: 3 @ 3'
Project Location: McCord 7E
Laboratory Number: TPH-1616

Project #:
Date Analyzed: 10-12-95
Date Reported: 10-12-95
Sample Matrix: Soil

Parameter	Result, mg/kg	Detection Limit, mg/kg
Total Recoverable Petroleum Hydrocarbons	48	20

ND = Not Detectable at stated detection limits.

QA/QC:	QA/QC Sample TPH mg/kg	Duplicate TPH mg/kg	% *Diff.
	920	910	1.09

*Administrative Acceptance limits set at 30%.

Method: Modified Method 418.1, Petroleum Hydrocarbons, Total
Recoverable, Chemical Analysis of Water and Waste,
USEPA Storet No.4551, 1978

Comments: Blow Pit - BR310

Nicholas Velazquez
Analyst

R. E. O'Neill
Review

District I
P.O. Box 1980, Hobbs, NM
District II
P.O. Drawer DD, Artesia, NM 88211
District III
100 Rio Brazos Rd, Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

BR310

SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

PTT REMEDIATION AND CLOSURE REPORT

Operator: R. C. RESOURCES COMPANY INC. Telephone: (505) 326-6903

Address: 501 AIRPORT DR., SUITE 161, FARMINGTON, NEW MEXICO 87499

Facility Or: McCord TE
Well Name

Location: Unit or Qtr/Qtr Sec P Sec 4 T30N R13W County SAN JUAN

Pit Type: Separator Dehydrator ☒ Other

Land Type: BLM ☒ State Fee Other

Pit Location: Pit dimensions: length 12', width 14', depth 7'
(Attach diagram) Reference: wellhead ☒ other

Footage from reference: 120'

Direction from reference: 15 Degrees ☒ East North
of West South ☒

Depth To Ground Water:
(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)
50 feet to 99 feet (10 points)
Greater than 100 feet (0 points) 0

Wellhead Protection Area:
(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points) 0
No (0 points)

Distance To Surface Water:
(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points)
200 feet to 1000 feet (10 points) 0
Greater than 1000 feet (0 points)

RANKING SCORE (TOTAL POINTS): 0

BR310

Date Remediation Started: _____ Date Completed: 10/18/95
Remediation Method: Excavation ☒ Approx. cubic yards 25
(Check all appropriate sections) Landfarmed ☒ Insitu Bioremediation _____
Other _____

Remediation Location: Onsite ☒ Offsite _____
(ie. landfarmed onsite, name and location of offsite facility)

General Description Of Remedial Action: _____
Excavation - BEDROCK BOTTOM

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit: Closure Sampling: _____
(if multiple samples, attach sample results and diagram of sample locations and depths)
Sample location see Attached Documents
Sample depth 4'
Sample date 10/12/95 Sample time 1305

Sample Results
Benzene(ppm) 0.0369
Total BTEX(ppm) 10.390
Field headspace(ppm) 906
TPH 1,840 ppm

Ground Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE 10/18/95
SIGNATURE Robert R. Click PRINTED NAME AND TITLE ROBERT R. Click - President

CLIENT: <u>R.R. CLICK</u>	BLAGG ENGINEERING, INC. P.O. BOX 87, BLOOMFIELD, NM 87413 (505) 632-1199	LOCATION NO: <u>BR310</u> C.O.C. NO: <u>4516</u>
---------------------------	--	---

FIELD REPORT: CLOSURE VERIFICATION	PAGE No: <u>1</u> of <u>1</u>
------------------------------------	-------------------------------

LOCATION: NAME: <u>McCord</u> WELL #: <u>7E</u> PIT: <u>DEHY</u>	DATE STARTED: <u>10/12/95</u> DATE FINISHED: _____
QUAD/UNIT: <u>P</u> SEC: <u>4</u> TWP: <u>30N</u> RNG: <u>13W</u> PM: <u>NM</u> CNTY: <u>SJ</u> ST: <u>NM</u>	ENVIRONMENTAL SPECIALIST: <u>NV</u>
QTP/FOOTAGE: <u>1000' FSL</u> <u>810' FEL</u> CONTRACTOR: <u>EPC</u>	

EXCAVATION APPROX. <u>12</u> FT. x <u>14</u> FT. x <u>7</u> FT. DEEP. CUBIC YARDAGE: <u>25</u>
DISPOSAL FACILITY: <u>ON-SITE</u> REMEDIATION METHOD: <u>LANDFARMED</u>
LAND USE: <u>RANGE</u> LEASE: <u>SF-078212</u> FORMATION: <u>OK</u>

FIELD NOTES & REMARKS: PIT LOCATED APPROXIMATELY 120 FT SISE FROM WELLHEAD.
 DEPTH TO GROUNDWATER: >100' NEAREST WATER SOURCE: >1000' NEAREST SURFACE WATER: >1000'
 NMOCB RANKING SCORE: 0 NMOCB TPH CLOSURE STD 5000 PPM

SOIL AND EXCAVATION DESCRIPTION: <u>ELEV. 5701'</u>	CHECK ONE: ☐ PIT ABANDONED ☒ <u>STEEL</u> TANK INSTALLED <u>FIBERGLASS</u>
---	--

SIDEWALLS:
OK. YELL. BROWN SAND W/ SOME GRAVEL, NON-COHESIVE,
SLIGHTLY MOIST, FIRM, STRONG HC ODOOR IN ALL
OVUM SAMPLES.

BOTTOM - SANDSTONE HARD, OLIVE GRAY, STRONG HC ODOOR IN OVUM SAMPLE.

SCALE

0 FT

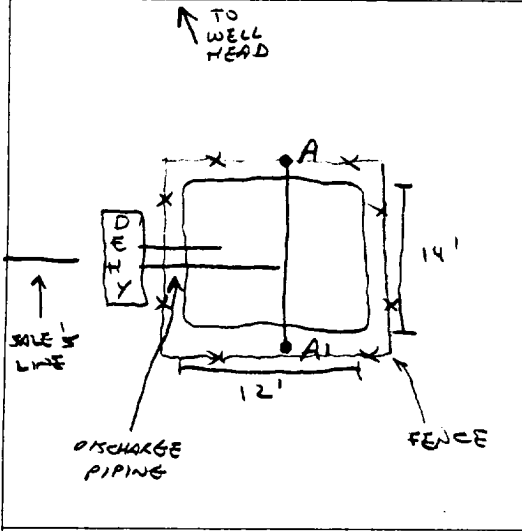
FIELD 418.1 CALCULATIONS

TIME	SAMPLE I.D	LAB No:	WEIGHT (g)	mL. FREON	DILUTION	READING	CALC. ppm
1305	<u>DE 4'</u>	<u>TPH-1817</u>	<u>5</u>	<u>20</u>	<u>1:1</u>	<u>460</u>	<u>1840</u>

PIT PERIMETER N

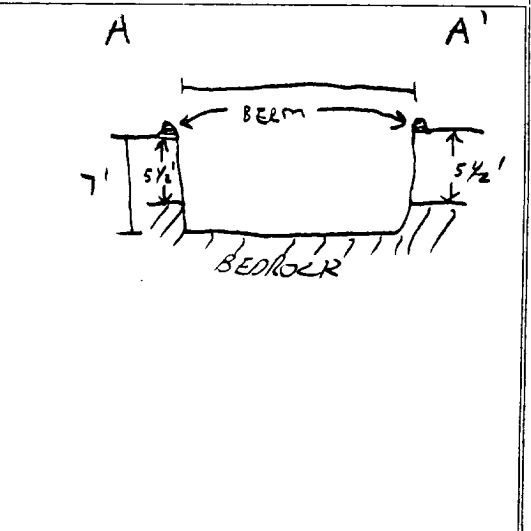
OVUM RESULTS

PIT PROFILE



SAMPLE ID	FIELD HEADSPACE PID (ppm)
1 <u>DE 4'</u>	<u>906</u>
2 <u>DE 4'</u>	<u>474</u>
3 <u>DE 4'</u>	<u>206.1</u>
4 <u>DE 4'</u>	<u>677</u>
5 <u>DE 7'</u>	<u>621</u>

LAB SAMPLES		
SAMPLE ID	ANALYSIS	TIME
<u>DE 4'</u>	<u>BTEX</u>	<u>1305</u>



TRAVEL NOTES: CALLOUT: 10/12/95 MORN. ONSITE: 10/12/95 MORN.

BLAGG ENGINEERING, INC.

P.O. Box 87, Bloomfield, New Mexico 87413

Phone: (505)632-1199 Fax: (505)632-3903

**FIELD MODIFIED EPA METHOD 418.1
TOTAL PETROLEUM HYDROCARBONS**

Client: R.R. CLICK
Sample ID: 1 @ 4'
Project Location: McCord 7E
Laboratory Number: TPH-1617

Project #:
Date Analyzed: 10-12-95
Date Reported: 10-12-95
Sample Matrix: Soil

Parameter	Result, mg/kg	Detection Limit, mg/kg
-----	-----	-----
Total Recoverable Petroleum Hydrocarbons	1,800	20


ND = Not Detectable at stated detection limits.


QA/QC:	QA/QC Sample TPH mg/kg	Duplicate TPH mg/kg	% *Diff.
	-----	-----	-----
	920	910	1.09

*Administrative Acceptance limits set at 30%.

Method: Modified Method 418.1, Petroleum Hydrocarbons, Total
Recoverable, Chemical Analysis of Water and Waste,
USEPA Storet No.4551, 1978

Comments: Dehydrator Pit - BR310


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8020 AROMATIC VOLATILE ORGANICS

Client:	Blagg Eng. / RC Resources	Project #:	04034
Sample ID:	1 @ 4'	Date Reported:	10-13-95
Laboratory Number:	9276	Date Sampled:	10-12-95
Chain of Custody:	4516	Date Received:	10-13-95
Sample Matrix:	Soil	Date Analyzed:	10-13-95
Preservative:	Cool	Date Extracted:	10-13-95
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	36.9	29.7
Toluene	185	33.9
Ethylbenzene	1,050	31.7
p,m-Xylene	3,440	26.7
o-Xylene	5,670	29.4
Total BTEX	10,380	

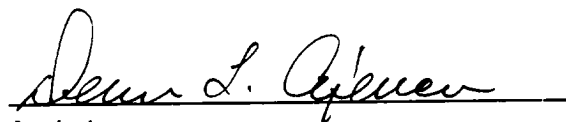
ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Trifluorotoluene	101 %
	Bromofluorobenzene	100 %

References: Method 5030, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, July 1992.

Method 8020, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, Sept. 1994.

Comments: McCord 7E Dehydrator Pit. BR310.


Analyst


Review

04034

DEHYDRATOR P.I.T.

ANALYSIS/PARAMETERS

BLAGG ENG. / RC RESOURCES

McCord 7E

Sampler: (Signature)

Chain of Custody | Ape No.

Adam Vitz

Sample No./
Identification

**Sample
Date**

**Sample
Time**

Lab Number

Sample Matrix

No. of Containers

BTEX
(8020)

Remarks

① ② ③

10/12/95

1305

9276

5012

1	✓
---	---

PRESERV. - COOL

Relinquished by: (Signature)

Date _____
Page _____

Time

Received by: A signature/

•

Relinquished by: (Signature)

Received by: (signature)

Relinquished by: (Signature)

Received by: (Signature)

ENVIROTECH INC.

5796 U.S. Highway 64-3014

Farmington, New Mexico 87401

(505) 632-0615

CLIENT: <u>RC RESOURCES</u>	BLAGG ENGINEERING, INC. P.O. BOX 87, BLOOMFIELD, NM 87413 (505) 632-1199	LOCATION NO: <u>32310</u> C.O.C. NO: <u>7277</u>
-----------------------------	--	---

FIELD REPORT: LANDFARM/COMPOST PILE CLOSURE VERIFICATION

LOCATION: NAME: <u>McCord</u>	WELL #: <u>7E</u>	PITS: <u>SEP/PROD, DEMO, BLOW</u>	DATE STARTED: <u>8-13-99</u>
QUAD/UNIT: <u>P</u>	SEC: <u>4</u>	TWP: <u>30N</u> RNG: <u>13W</u> PM: <u>NM</u> CNTY: <u>SJ</u> ST: <u>NM</u>	DATE FINISHED: <u>8-17-99</u>
QTR/FOOTAGE: <u>1000's/810'E</u>	CONTRACTOR: <u>EPC</u>	ENVIRONMENTAL SPECIALIST: <u>REP</u>	

SOIL REMEDIATION:

REMEDICATION SYSTEM: LANDFARM

APPROX. CUBIC YARDAGE: 390

LAND USE: RANGE

LIFT DEPTH (ft): 2'

FIELD NOTES & REMARKS:

DEPTH TO GROUNDWATER: >100' NEAREST WATER SOURCE: >1000' NEAREST SURFACE WATER: >1000'

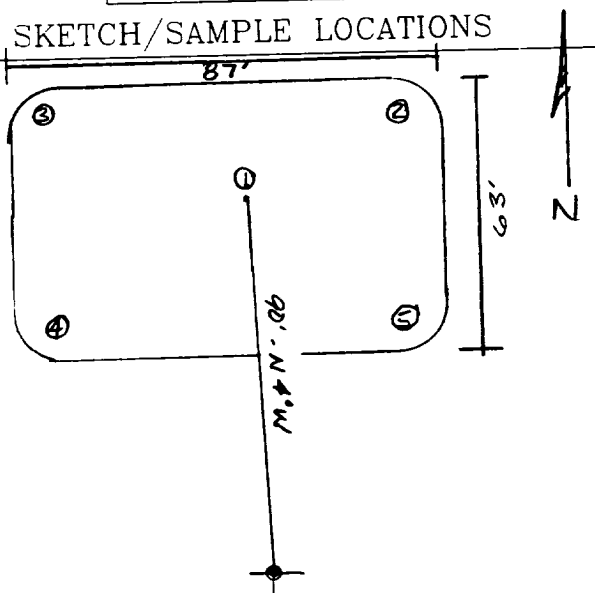
NMOCB RANKING SCORE: 0 NMOCB TPH CLOSURE STD: 5000 PPM

MODERATE YELLOWISH BROWN SAND, NON COHESIVE, SLIGHTLY MOIST, FIRM
NO APPARENT STAINING, NO H₂S ODOR DETECTED. SAMPLING DEPTHS RANGE
FROM 6" - 18", COLLECTED A SPT. COMPOSITE SAMPLE FOR LAB ANALYSIS.

FIELD 418.1 CALCULATIONS

SAMP. TIME	SAMPLE I.D.	LAB No:	WEIGHT (g)	mL. FREON	DILUTION	READING	CALC. ppm

SKETCH/SAMPLE LOCATIONS




OVM RESULTS

LAB SAMPLES

SAMPLE ID	FIELD HEADSPACE PID (ppm)	SAMPLE ID	ANALYSIS	TIME	RESULTS
LF-1	0.0	LF-1	TPH (8015)	1240	9.4

SCALE



TRAVEL NOTES:

CALLOUT: N/A

ONSITE: 8-13-99

EPA METHOD 8015 Modified
Nonhalogenated Volatile Organics
Total Petroleum Hydrocarbons

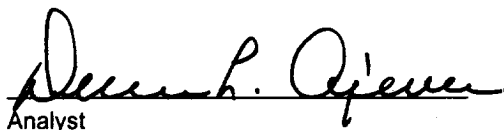
Client:	Blagg / RC Resources	Project #:	403410
Sample ID:	LF - 1	Date Reported:	08-17-99
Laboratory Number:	F919	Date Sampled:	08-13-99
Chain of Custody No:	7277	Date Received:	08-13-99
Sample Matrix:	Soil	Date Extracted:	08-16-99
Preservative:	Cool	Date Analyzed:	08-17-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	9.4	0.1
Total Petroleum Hydrocarbons	9.4	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: **McCord 7 E LF. 5 Pt. Composite.**


Analyst


Review

CHAIN OF CUSTODY RECORD

7277

Client / Project Name			Project Location			ANALYSIS / PARAMETERS															
BAA/RESOURCES			1166RD 7E																		
Sampler: REP			Client No. 403410			No. of Containers															
Sample No./ Identification	Sample Date	Sample Time	Lab Number	Sample Matrix	TPH (B&S)																
LF-1	8/13/99	1240	F919	5012	1 ✓		SPR CARTRIDGE														
							SAMPLE PRESERVE -														
							COOL														
Relinquished by: (Signature)			Date	Time	Received by: (Signature)	Date	Time														
Relinquished by: (Signature)			8/13/99	14:15	James F. Edwards	8/13/99	14:15														
Relinquished by: (Signature)					Received by: (Signature)																
Relinquished by: (Signature)					Received by: (Signature)																
ENVIROTECH INC. 5796 U.S. Highway 64 Farmington, New Mexico 87401 (505) 632-0615												Sample Receipt <table border="1"> <tr> <td>Received Intact</td> <td>Y</td> <td>N</td> <td>N/A</td> </tr> <tr> <td>Cool - Ice/Blue Ice</td> <td>✓</td> <td></td> <td></td> </tr> </table>		Received Intact	Y	N	N/A	Cool - Ice/Blue Ice	✓		
Received Intact	Y	N	N/A																		
Cool - Ice/Blue Ice	✓																				