

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

**SUNDRY NOTICES AND REPORTS ON WELLS**

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well  gas well  other

2. NAME OF OPERATOR  
Northwest Pipeline Corporation

3. ADDRESS OF OPERATOR  
P.O. Box 90, Farmington, N.M. 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: 1910 FSL & 1840 FEL  
AT TOP PROD. INTERVAL: Same as above  
AT TOTAL DEPTH: Same as above

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

5. LEASE  
SF 078996

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME  
San Juan 32-7 Unit Com

8. FARM OR LEASE NAME  
San Juan 32-7 Unit Com

9. WELL NO.  
#79

10. FIELD OR WILDCAT NAME  
Blanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Sec 7, T31N, R7W

12. COUNTY OR PARISH  
San Juan

13. STATE  
New Mexico

14. API NO.  
30-045-25207

15. ELEVATIONS (SHOW DF, KDB, AND WD)  
6548' GR

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

PULL OR ALTER CASING

MULTIPLE COMPLETE

CHANGE ZONES

ABANDON\*

(other) Spud Operations

SUBSEQUENT REPORT OF:


RECEIVED

OCT 27 1981

U.S. GEOLOGICAL SURVEY

FARMINGTON, N.M.

(NOTE: Report results of multiple completion or zone change on Form 9-331-C)

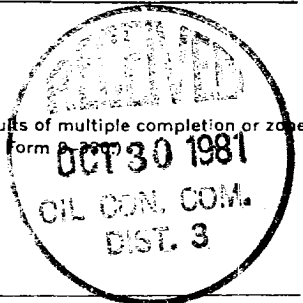

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

10-19-81 Spudded 12-1/4" surface hole @ 1730 hrs. Ran 8 jts (359') of 9-5/8", 32.3#, H-40, csg & set @ 373' KB. Woodco cmt'ed w/ 200 sx C1 "B" w/ 3% CaCl<sub>2</sub> & 1/4# flocele/sx. Plug down @ 0300 hrs 10-20-81. Circ out 1 bbl cmt.

10-20-81 to 10-23-81 Drlg ahead to a depth of 3930'.

10-24-81 GO ran IES SNL/FDC/GR logs. Ran 104 jts (3914') of 7", 20#, K-55, ST&C USS seamless & set @ 3926'. National cmt'ed w/ 125 sx 65/35 poz w/ 12% gel. Tailed w/ 75 sx C1 "B" w/ 2% CaCl<sub>2</sub>. Displaced plug w/ 150 bbls wtr & down @ 1215 hrs 10-24-81. Wilson ran temp survey: Top of cmt @ 1500'.

10-25-81 to 10-26-81 Drlg ahead w/ gas to a depth of 5950' (TD).

Subsurface Safety Valve: Manu. and Type 125 75 200 Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Donna J. Brace TITLE Production Clerk DATE 10-26-81

Donna J. Brace

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side

*[Handwritten signature]*