

		X

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency Navajo TribalContract

Allottee _____

Lease No. 14-20-403-207

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL		SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		<u>Sandall Frac.</u>	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Chimney RockMarch 3, 19 59Well No. 9-A is located 600 ft. from [N] line and 1900 ft. from [E] line of sec. 25NW 1/4 Sec. 2581N17WMMPM

(1/4 Sec. and Sec. No.)

(Twp.)

(Range)

(Meridian)

Horseshoe-Gallup Ext.San JuanNew Mexico

(Field)

(County or Subdivision)

(State or Territory)

The elevation of the derrick floor above sea level is 5847 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate casing joints, cementing points, and all other important proposed work)

2-17-59 Total Depth 1615'. Clean Out Total Depth 1575'.

Sandall fractured Lower Gallup perforated intervals 1540-1558' (perf. 1540-50
3 sh./ft.; 1550-1558 4 sh./ft.) with 36,838 gals. oil & 27,000 sand. Breakdown pressure
16750; Minimum treating pressure 13000; Average treating pressure 11250. Injection Rate
62.5 bbls./min. Flush 1638 gals. oil.


2-20-59 Total Depth 1615. Temporary Bridge Plug at 1475'.

Sandall fractured Lower Gallup perforated intervals 1451-61 (perf. 3 sh./ft.)
with 10,654 gals. oil and 12,000 sand. Breakdown pressure 13000; Minimum treating pressure
16000; Average Treating Pressures 1300-15750. Injection Rate 55.5 bbls./min. Flush 1670 gals
oil. Drugged 15 rubber balls cap time.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Products CompanyAddress Post Office Box 1546Farmington, New MexicoORIGINAL SIGNED BY: WILLIAM K. GLAENENTitle Petroleum Engineer

18

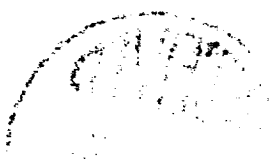

18

18

18