

(SUBMIT IN TRIPLICATE)

Indian Agency Ignacio

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Allottee Ute Indian

Lease No. 21-00-004-02

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF REDRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

U. S. GEOLOGICAL SURVEY  
DURANGO, COLO.


Well No. 9-2 is located 660 ft. from S line and 1000 ft. from W line of sec. 20  
1/4 Sec. and Sec. No. Twp. Range Meridian  
Field San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5596 ft. 6-1-60

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Well was spudded 4/22/60  
Set 3 jcs., 55' of 5 1/8" surface casing, landed at 151' with 150 sacks cement  
Tested casing with 200 psi pressure for 30 minutes. No leaks.  
Drilled cement plug 4/25/60  
Tested casing with 200 psi pressure for 30 minutes.  
No drop in pressure.

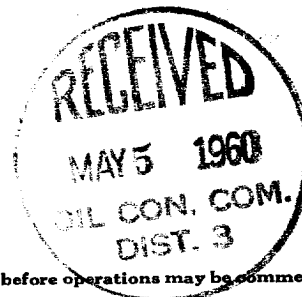

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Apache Oil & Gas Company

Address Box 4 T&E, Farmington

New Mexico

ORIGINAL SIGNED BY JOE C. SALMON  
By Joe C. Salmon

Title District Superintendent

