


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. SF - 074096
Unit E/2 Sec. 21

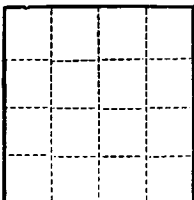

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	X
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 17, 1960

Delhi-Hodge
Well No. 2 is located 1740 ft. from N line and 1000 ft. from E line of sec. 21


NE/4 Sec. 21 31N 11W 104PM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Under. Dakota San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5889 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

After setting 7-5/8" casing a 6-3/4" hole was drilled w/gas to T.D. of 7300', 5-1/2" 17# J-55 casing was set at 7300' w/200 sha. 30/30 permix, 41 gal. 12-1/2# gilsonite per sack followed w/50 sha latex cement. Casing was pressured to 2000# for 1 hr. with no drop in pressure. Temperature survey indicated top at 4750'.

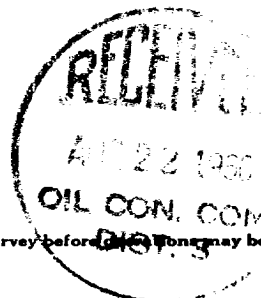

I understand that this plan of work must receive approval in writing by the Geological Survey before drilling may be commenced.

Company Delhi-Taylor Oil Corporation

Address P. O. Drawer 1198

Farmington, New Mexico

By J. B. Howell
District Superintendent