


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 078096
Unit Hudge

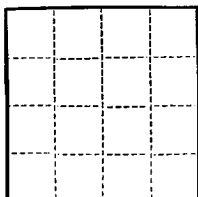

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		<u>Water Frac.</u>	<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 25, 1961

Well No. 1300 is located 1500 ft. from N line and 1775 ft. from E line of sec. 20

N.E. Section 20 31-N 11-W N.M.P.M.

($\frac{1}{4}$ Sec. and Sec. No.)

(Twp.)

(Range)

(Meridian)

Blanco M.V. & Basin D. kote

(Field)

San Juan

(County or Subdivision)

New Mexico

(State or Territory)


The elevation of the derrick floor above sea level is 6156 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 6-15-61 Total Depth 7423'. P.B.T.D. 5147'.

Water fractured Mesa Verde perforated intervals 4992-5000; 5020-28; 5062-72; 5072-84; 5092-5102; 5112-5128 with 49,418 gal water and 60,000# sand. HSP 1200#, max pr 3700#, avg tr pr 1325-3200#. Injection rate 38.8 BPM. 5 stages - Dropped 4 sets of 18 balls each.

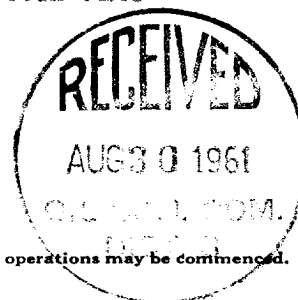

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 990

Farmington, New Mexico

By Original Signed R. G. MILLER

Title Petroleum Engineer