


Santa Fe

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office _____
Lease No. 077652
Unit Last

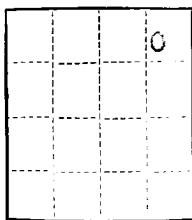

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. 11 is located 1100 ft. from [N] line and 200 ft. from [E] line of sec. 24
[S] [W]
NE Section 24 T-31N R-12E N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Basin: Sakota San Juan NEW MEXICO
(Field) (County or Subdivision) (State or Territory)

RECEIVE [

SEP 11 1962


The elevation of the derrick floor above sea level is 6020 ft. G.I.

DETAILS OF WORK

U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

P.B.T.D.- 7177'
Sand-water fraced with 58,296 gals. water, 60,000 sand
Breakdown pr.-1000
Avg. treating pr.-1500
Avg. I.R.- 37.2 bpt
dropped 120 rubber ball sealers
Flushed with 130 Bbls.
Instant shut in-1100
5 Min. shut in-700
Ran 219 jts., 6939' of 2 3/8" tubing, landed at 6950'
Shut in for gauge.

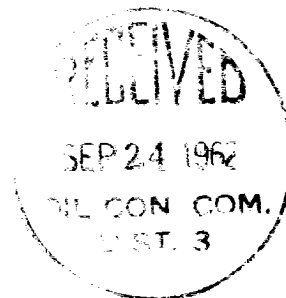

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Aztec Oil & Gas Company

Address Crewer

Farmington, N.M.

By JOE C. SALMON
Title District Superintendent