

(SUBMIT IN TRIPLICATE)

Indian Agency **Navajo-Ute Tribal**

			X

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee _____
Lease No. **14-20-604-1951**

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	FEB 8 1960
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL		SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 29, 19 **60**

Horseshoe Ute

Well No. **34** is located **575** ft. from **N** line and **905** ft. from **E** line of sec. **34**

NE NE/4 Section 34

31N

16W

NMPM

(1/4 Sec. and Sec. No.)

(Twp.)

(Range)

(Meridian)

Horseshoe Gallup

San Juan

New Mexico

(Field)

(County or Subdivision)

(State or Territory)

The elevation of the derrick floor above sea level is **5473** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spud Date: January 27, 1960. January 28, 1960 Total Depth 125'.

Ran 4 joints, 8-5/8", 36.00#, J-55 Csg. (113') set at 120' with 125 sacks regular cement, 2% Gel. circulated to surface. Held 500#/30 Minutes.




I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **El Paso Natural Gas Products Company**

Address **Post Office Box 1565**
Farmington, New Mexico

ORIGINAL SIGNED BY: **JOSEPH E. KREGER**

By _____
Title **Petroleum Engineer**

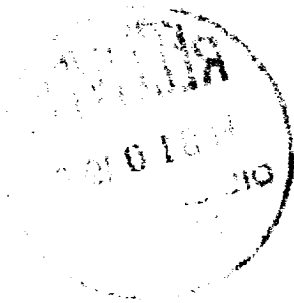

RECEIVED 1810 1814