Form 9-331
(May 1963)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other Instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF-078215

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

1.

OIL WELL ☐   GAS WELL ☒   OTHER

7. UNIT AGREEMENT NAME

2. NAME OF OPERATOR

Aztec Oil & Gas Company

8. FARM OR LEASE NAME

Page

3. ADDRESS OF OPERATOR

P. O. Drawer 570, Farmington, New Mexico

9. WELL NO.

#2-Y

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

790' FSL & 830' FWL
Section 7-32N-10W

10. FIELD AND POOL, OR WILDCAT

Blanco Mesaverde

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Section 7-32N-10W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6816 GR

12. COUNTY OR PARISH   13. STATE

San Juan   New Mexico

16. ### Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
(Other) ☐

PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
ABANDON* ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☒
FRACTURE TREATMENT ☐
SHOOTING OR ACIDIZING ☐
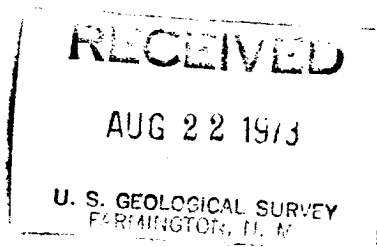(Other) _____

REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

8-12-73   Ran 181 Joints 5½" 15.50# Casing, Shoe Set @ 5770', Float Collar Set @ 5738', Stage Collar Set @ 3709'. Cemented 1st Stage With 220 Sacks Halliburton Lite, 12½# Gil, 50 Sacks Class "A", 2% CaCl. Cemented 2nd Stage With 434 Sacks Halliburton Lite, 12½# Gil.

8-18-73   Ran 13 Joints 3" 7.70# Casing, Shoe Set @ 6088', Float Collar Set @ 6057', Hanger Set @ 5676'. Cemented With 35 Sacks Class "A".

RECEIVED
AUG 23 1973
OIL CON. COM.
DIST. 3

RECEIVED
AUG 22 1973
U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

18. I hereby certify that the foregoing is true and correct

SIGNED _____   TITLE District Superintendent   DATE August 21, 1973

(This space for Federal or State office use)

APPROVED BY _____   TITLE _____   DATE _____
CONDITIONS OF APPROVAL, IF ANY:

See Instructions on Reverse Side