


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency _____
Havajo Tribal
Allottee **Havajo**
Lease No. **11-20-60-1013**

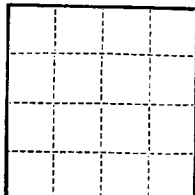

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 4, 1959

Well No. **5** is located **2145** ft. from **N** line and **430** ft. from **W** line of sec. **33**

N1/4 Section 33
(1/4 Sec. and Sec. No.)

32N
(Twp.)

17W
(Range)

N.M.P.M.
(Meridian)

Chimney Rock (Gallup Nat.)
(Field)

San Juan County
(County or Subdivision)

New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is **3400** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Pumped cement plug down $4\frac{1}{2}$ " CD casing, squeezing casing perforations 1133-40' with 10 sacks of cement. Perforations did not squeeze. Cemented casing perforations 1133-40' with 10 sacks of cement. Cement plug to 1083'. Ran Dialog free point indicator and found $4\frac{1}{2}$ " CD casing free at 676'. Cut $4\frac{1}{2}$ " CD casing off at 676'. Set 25 sack cement plug 576-676'. Palled 672' WTH of $4\frac{1}{2}$ " CD casing. Put 5 sacks of cement in top of 3-1/8" CD casing at surface and set 4" pipe marker in top of surface casing and extended 4' above ground level.

Plugged and abandoned August 3, 1959.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **SKELLY OIL COMPANY**

Box 426

Address **Farmington, New Mexico**

By **(Signed) P. E. Cosper**

Title **District Superintendent**

