

District I
O. Box 1088, Hobbs, NM
District II
O. Drawer DD, Artesia, NM 88211
District III
100 Rio Grande Rd, Artesia, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE

(Revised 3/9/94)

Non-vulnerable
TPH-high

PIT REMEDIATION AND CLOSURE REPORT

Operator: CANOCO INC. Telephone: 505-324-5813

Address: 3315 Bloomfield Hwy. FARMINGTON N.M. 87401

Facility Or: MOORE COM 1
Well Name

Location: Unit or qtr/qtr sec F Sec 25 T 32N R 12W County SAN JUAN

Pit Type: Separator ☒ Dehydrator ☐ Other ☐

Land Type: BLM ☒ State ☐ Fee ☐ Other ☐


Pit Location: Pit dimensions: length 12', width 10', depth 3'
(Attach diagram)

Reference: wellhead ☒ other ☐

Footage from reference: 80'

Direction from reference: 292° Degrees ☐ East ☐ North ☐
☒ West ☐ South ☐

Depth To Ground Water:
(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

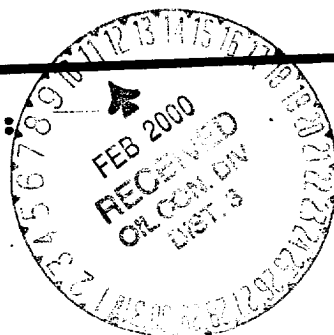

Less than 50 feet	(20 points)
50 feet to 99 feet	(10 points)
Greater than 100 feet	(0 points) <u>0</u>

Wellhead Protection Area:
(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes	(20 points)
No	(0 points) <u>0</u>

Distance To Surface Water:
(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet	(20 points)
200 feet to 1000 feet	(10 points)
Greater than 1000 feet	(0 points) <u>0</u>

RANKING SCORE (TOTAL POINTS): 0

Date Remediation Started: 6-1-99 Date Completed: 7-6-99

Remediation Method: Excavation _____ Approx. cubic yards _____
(check all appropriate sections) Landfarmed _____ Insitu Bioremediation _____
Other _____

Remediation Location: Onsite _____ offsite _____
(ie. landfarmed onsite, name and location of offsite facility)

General Description Of Remedial Action: SAMPLE TAKEN, Till Bottom of Pit 1 IN.
Back Fill with clean soil

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit: Sample location CENTER OF PIT.
Closure Sampling: _____
(if multiple samples, attach sample results and diagram of sample locations and depths) Sample depth 6'
Sample date 6-30-99 Sample time 1059

Sample Results

Benzene (ppm) .64

Total BTEX (ppm) .250

Field headspace (ppm) 317

TPH 24,410

Ground Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE 8/4/99

SIGNATURE Jud Valdez

PRINTED NAME AND TITLE Judson Valdez P.L.

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons


Client:	Conoco Inc.	Project #:	707003-042
Sample ID:	SEP - Grab	Date Reported:	07-02-99
Laboratory Number:	F624	Date Sampled:	06-30-99
Chain of Custody No:	7117	Date Received:	07-01-99
Sample Matrix:	Soil	Date Extracted:	07-01-99
Preservative:	Cool	Date Analyzed:	07-02-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	19,390	0.2
Diesel Range (C10 - C28)	5,020	0.1
Total Petroleum Hydrocarbons	24,410	0.2


ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: **Moore Com 1. OVM Reading 317.**

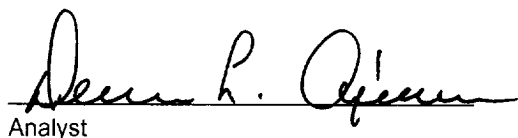
Analyst


Review

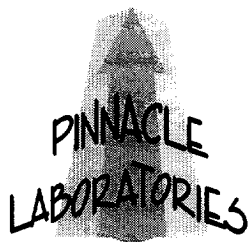

2709-D Pan American Freeway NE
Albuquerque, New Mexico 87107
Phone (505) 344-3777
Fax (505) 344-4413

GAS CHROMATOGRAPHY RESULTS

TEST : EPA 8021 MODIFIED
CLIENT : ENVIROTECH, INC.
PROJECT # : 0707003
PROJECT NAME : CONOCO

PINNACLE I.D.: 907036

SAMPLE ID. #	CLIENT I.D.	MATRIX	DATE SAMPLED	DATE EXTRACTED	DATE ANALYZED	DIL. FACTOR
06	SEP-GRAB1/F624	NON-AQ	6/30/99	7/1/99	7/14/99	20

PARAMETER	DET. LIMIT	UNITS	SEP-GRAB1/F624
BENZENE	0.025	MG/KG	0.64
TOLUENE	0.025	MG/KG	21
ETHYLBENZENE	0.025	MG/KG	14
TOTAL XYLENES	0.025	MG/KG	250

SURROGATE:
BROMOFLUOROBENZENE (%) 170 *
SURROGATE LIMITS (65 - 120)

CHEMIST NOTES:

* = SURROGATE RECOVERY OUTSIDE CONTROL LIMITS DUE TO MATRIX INTERFERENCE.

7117

[illegible]


Revised:

Lease Name: Moore Com 1

Operator: Conoco Inc.

Date: 6-21-99

Site Security
(Indicate North)

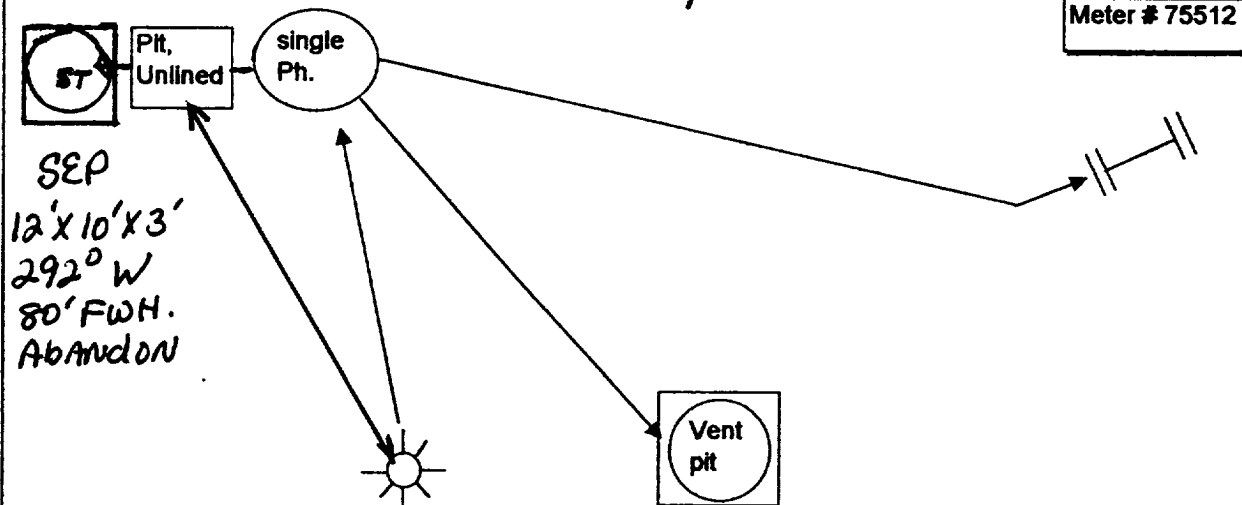

Lease Name: Moore Com. 1

Federal/ Indian Lease No: SW379

CA No.:

Unit: F

Legal Description: Sec.25-T32N-R12W

County: San Juan

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production


Production Line valve:
Sealed during sales

This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM

MOORE Comp 1

6-21-79

SEP.
12' X 15' X 3'
292° W
80' F.M.

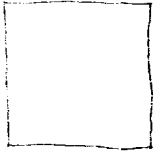

SEP

SET 80 Bbs Super P.M.

