

District I
P.O. Box 1980, Hobbs, NM
District II
P.O. Drawer DD, Artesia, NM 88211
District III
1000 Rio Brazos Rd, Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

Bev...
New...
SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE
(Revised 3/9/94)

PIT REMEDIATION AND CLOSURE REPORT

Operator: CONDOL INC. Telephone: 505-324-5814

Address: 3315 Bloomfield HWY. FARMINGTON N.M. 87401

Facility Or: NEWBERRY B1
Well Name

Location: Unit or qtr/qtr sec C sec 35 T32N R12W county SAN JUAN

Pit Type: Separator ☐ Dehydrator ☐ Other TANK DRUM PIT

Land Type: BLM ☒, State ☐, Fee ☐, Other ☐

Pit Location: Pit dimensions: length 10', width 10', depth 2'
(Attach diagram)

Reference: wellhead ☒, other ☐

Footage from reference: 113'

Direction from reference: 350° Degrees East North ☐
West South ☒

Depth To Ground Water:
(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)
50 feet to 99 feet (10 points)
Greater than 100 feet (0 points) 0


Wellhead Protection Area:
(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points)
No (0 points) 0

Distance To Surface Water:
(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points)
200 feet to 1000 feet (10 points)
Greater than 1000 feet (0 points) 0

RANKING SCORE (TOTAL POINTS): 0

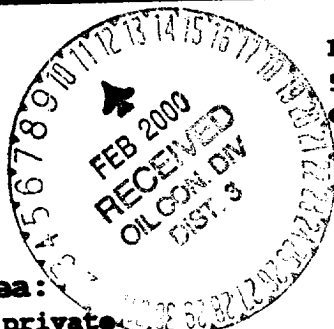

Date Remediation Started: 7-21-99 Date Completed: 7-22-99

Remediation Method: Excavation _____ Approx. cubic yards _____
(Check all appropriate sections) Landfarmed _____ Insitu Bioremediation _____
Other _____

Remediation Location: Onsite _____ offsite _____
(ie. landfarmed onsite, name and location of offsite facility)

General Description Of Remedial Action: SAMPLE TAKEN, Till Bottom of P. + 1' EN
BACK FILL with clean SOIL. Hit Bed Rock 2' IN.

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit: Sample location CENTER OF PIT.
Closure Sampling: _____
(if multiple samples, attach sample results and diagram of sample locations and depths) Sample depth 4'

Sample date 7-14-99 Sample time 1410

Sample Results

Benzene (ppm) 8.880

Total BTEX (ppm) 63.880

Field headspace (ppm) 503

TPH 9220

Ground Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE 12/13/99

SIGNATURE Judson Valdez

PRINTED NAME AND TITLE Judson Valdez P.L.

EPA METHOD 8015 Modified
Nonhalogenated Volatile Organics
Total Petroleum Hydrocarbons


Client:	Conoco Inc.	Project #:	707003-061
Sample ID:	TDP - Grab	Date Reported:	07-19-99
Laboratory Number:	F692	Date Sampled:	07-14-99
Chain of Custody No:	6957	Date Received:	07-15-99
Sample Matrix:	Soil	Date Extracted:	07-16-99
Preservative:	Cool	Date Analyzed:	07-19-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	5,740	0.2
Diesel Range (C10 - C28)	3,480	0.1
Total Petroleum Hydrocarbons	9,220	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: Newberry B 1 OVM Reading 503. Hit Bed Rock 2' In.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	707003-061
Sample ID:	TDP - Grab	Date Reported:	07-22-99
Laboratory Number:	F692	Date Sampled:	07-14-99
Chain of Custody:	6957	Date Received:	07-15-99
Sample Matrix:	Soil	Date Analyzed:	07-22-99
Preservative:	Cool	Date Extracted:	07-16-99
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	8,880	8.8
Toluene	7,830	8.4
Ethylbenzene	5,390	7.6
p,m-Xylene	28,940	10.8
o-Xylene	12,840	5.2
Total BTEX	63,880	


ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Trifluorotoluene	96 %
	Bromofluorobenzene	96 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: Newberry B 1 OVM Reading 503 Hit Bed Rock 2' In.

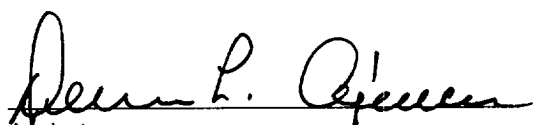
Analyst


Review

6957

[illegible]

Revised 11-16-98

Lease Name: Newberry B1

Operator: conoco Inc

Date:

7-22-99


Site Security

(Indicate North)

DEHY



Pit,
Unline
d

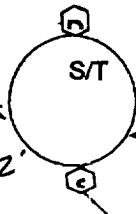

TDP
10'X10'X2'
113'FWH
350°W
ABANDON



DEP
12'X12'X4'
88'FWH
24°N



Meter #

75515



Lease Name: Newberry B1

Federal/ Indian Lease No: SF-078147

CA No.: _____

Unit: C

Legal Description: Sec.35-T32N-R12W

County: San Juan

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production

Production Line valve:
Sealed during sales

This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM