

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYLand Office Navajo TribalLease No. 1-149-IND-7653

Unit _____

SUNDRY NOTICES AND REPORTS ON WELLS

| | | |
|--|--|----------|
| NOTICE OF INTENTION TO DRILL | SUBSEQUENT REPORT OF WATER SHUT-OFF | |
| NOTICE OF INTENTION TO CHANGE PLANS | SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING | |
| NOTICE OF INTENTION TO TEST WATER SHUT-OFF | SUBSEQUENT REPORT OF ALTERING CASING | |
| NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL | SUBSEQUENT REPORT OF REDRILLING OR REPAIR | |
| NOTICE OF INTENTION TO SHOOT OR ACIDIZE | SUBSEQUENT REPORT OF ABANDONMENT | X |
| NOTICE OF INTENTION TO PULL OR ALTER CASING | SUPPLEMENTARY WELL HISTORY | |
| NOTICE OF INTENTION TO ABANDON WELL | | |

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Pampa, Texas, April 22, 1953Well No. 1 is located 10980 ft. from SW line and 660 ft. from E line of sec. 34NE 1/4 of Sec. 34 31-N 17-W 100-1-100
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)Wildcat
(Field)San Juan
(County or Subdivision)New Mexico
(State or Territory)The elevation of the derrick floor above sea level is 5226 ft.

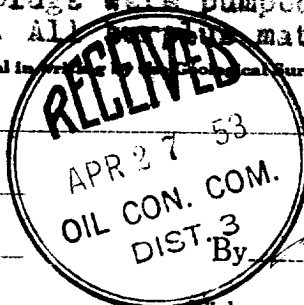
DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

This well, which was drilled to a T.D. of 8147', with 13-3/8" surface casing set at 669' and cemented to the surface, and 9-5/8" casing set at 4410' and cemented with 250 sacks, penetrated the Pennsylvanian and Mississippian formations, but did not encounter any commercially productive gas, oil or water zones, and has been plugged and abandoned as follows:

Hole was filled with heavy mud and cement plugs spotted as follows: 35 sacks 8147'-8050'; 30 sacks 7750'-7670'; 30 sacks 7120'-7040'; 65 sacks 6880'-6710', and 35 sacks 4600'-4390'. After parting and pulling 2437' of 9-5/8" casing, spotted 90 sacks 2510'-2390', 55 sacks 710'-640'; and 35 sacks 43' to surface with a 4" pipe marker cemented at the surface. All mud and cement plugs were pumped in thru drill pipe. Completed at 12:15 P.M. 6-18-52. All casing material has since been

I understand that this plan of work must receive approval in writing from the Geological Survey before operations may be commenced. (OVER)

Company THE TEXAS COMPANYAddress Box 1221Pampa, TexasTitle Asst. Dist. Supt.

| | | |
|------------------------------|------------------|-------------------------------------|
| OIL CONSERVATION COMMISSION | | |
| AZTEC DISTRICT OFFICE | | |
| No. Copies Received <u>2</u> | | |
| DISTRIBUTION | | |
| | NO. FURNISHED | |
| Operator | | |
| Santa Fe | <u>1</u> | |
| Migration Office | | |
| State Land Office | | |
| U. S. G. S. | | |
| Transporter | | |
| Site | <u>1</u> | <input checked="" type="checkbox"/> |

removed and the location is cleared and leveled.