


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe

Lease No. 078459

Unit San Juan 32-7 Unit

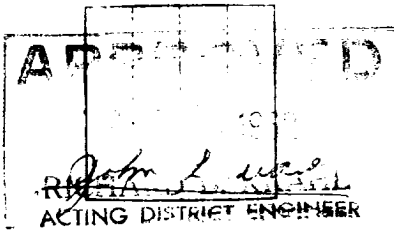

SUNDRY NOTICES AND REPORTS ON WELLS

RECEIVED

APR 3 1962

NOTICE OF INTENTION TO DRILL
NOTICE OF INTENTION TO CHANGE PLANS
NOTICE OF INTENTION TO TEST WATER IN CUTOFF
NOTICE OF INTENTION TO RE DRILL OR REPAIR WELL
NOTICE OF INTENTION TO SHOOT OR ABANDON
NOTICE OF INTENTION TO PULL OR ALTER Casing
NOTICE OF INTENTION TO ABANDON WELL

SUBSEQUENT REPORT OF WATER SHUT OFF
SUBSEQUENT REPORT OF SHOOTING OR ABANDONING
SUBSEQUENT REPORT OF ALTERING Casing
SUBSEQUENT REPORT OF RE DRILLING OR REPAIR
SUBSEQUENT REPORT OF ABANDONMENT
SUPPLEMENTARY WELL HISTORY

X

U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

April 2, 1962

19

Fruit 4-22 is located 890 ft from XXX line and 1650 ft from XXX line of sec. 22

SW/4 Section 22

32-N

7-W

N.M.P.M.

Pictured Cliffs Wildcat

San Juan

New Mexico

The elevation of the derrick floor above sea level is 6529 ft.

DETAILS OF WORK

(State names of all exploratory wells to objective or to show size, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work.)

Due to non-commercial production this well will be plugged & abandoned as follows:

1. Spot a 310' cement plug from 3488-3178' to cover open hole 3488-3228;
2. Spot a 250' cement plug from 3170' to 2920' to cover perforations 3120-2970'.
3. Determine 7" casing free point and cut.
4. Spot a 100' cement plug across cut-off, pull casing.
5. Spot a 10 sack cement plug with a 4" x 4' permanent type dry hole marker in top of surface pipe.
6. Clean location.

I understand that this plan of work must be approved in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 990

Farmington, New Mexico

By

Title Petroleum Engineer

