



December 30, 2024

New Mexico Oil Conservation Division

506 W. Texas Ave
Artesia, NM 88210

RE: **RDX Federal Com 28 #009H- Closure Request Report**

Incident Number: nAPP2432323847

API: 30-015-43294

GPS: 32.0196704°, -103.8904924°

Eddy County, New Mexico

Project No. 2692

To Whom It May Concern:

Earth Systems Response and Restoration (ESRR), presents the following Closure Request Report (CRR) to document the findings during a recent liner inspection conducted at the RDX Federal Com 28 #009H (Site) following an inadvertent release of produced water within a lined secondary containment (LSC). Based on initial release response and liner inspection activities, WPX is requesting No Further Action (NFA) at the Site.

Site Location

The Site is located in Unit C, Section 28, Township 26 South, Range 30 East, in Eddy County, New Mexico (32.0196704°, -103.8904924°) and is associated with oil and gas exploration and production operations on Federal Land managed by the Bureau of Land Management (BLM) (**Figure 1**).

Incident Description & Background

On November 17, 2024, a water transfer pump plug washed out, releasing approximately 521 barrels (bbls) of produced water within a LSC (**Figure 2**). The release was fully contained within the LSC with no fluids escaping to the production pad or adjacent pasture. A vacuum truck was immediately dispatched to the Site recovering the 521 bbls of produced water.

Immediate notice was given to the New Mexico Oil Conservation Division (NMOCD) on November 18, 2024, by Notification of Release (NOR) and a Corrective Action Form C-141 (Form C-141) and subsequently assigned Incident Number nAPP2432323847.

On December 11, 2024, WPX coordinated the LSC to be power washed clearing all debris and residual fluid for an accurate inspection of the LSC and submitted a 48-hour Notification of Liner Inspection (Form C-141 L) for December 16, 2024.

RDX Federal Com 28 #009H- Closure Request Report
 Incident Number: nAPP2432323847
 Eddy County, New Mexico
 Project No. 2692



Site Characterization

ESRR characterized the Site according to Table I, Closure Criteria for Soils Impacted by a Release, of Title 19, Chapter 15, Part 29, Section 12 (19.15.29.12) of the New Mexico Administrative Code (NMAC). The following proximities were estimated:

- o Between 1,000 feet and 1/2 mile of any continuously flowing watercourse or any other significant watercourse;
- o Greater than 5 miles of any lakebed, sinkhole or playa lake (measured from the ordinary high-water mark);
- o Greater than 5 miles of any occupied permanent residence, school, hospital, institution or church;
- o Between 1 and 5 miles of any spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes;
- o Between 1 and 5 miles of any other freshwater well or spring;
- o Greater than 5 miles of any incorporated municipal boundary or a defined municipal fresh water well field covered under a municipal ordinance;
- o Between 1,000 feet and 1/2 mile of any wetland;
- o Greater than 5 miles of any subsurface mine;
- o Between 1 and 5 miles of any unstable area (i.e. high karst potential); and
- o Between 1,000 feet and 1/2 mile of a 100-year floodplain.

Receptor details used to determine the Site characterization are included in **Figure 2** and **Figure 3**. **Referenced Well Records** for the closest depth to water well are attached.

Based on the results from the desktop review and depth to water estimated to be greater than 100 feet below ground surface (bgs), the following Closure Criteria was applied:

Constituents of Concern (COCs)	Closure Criteria [‡]
Chloride	20,000 milligram per kilogram (mg/kg)
Total Petroleum Hydrocarbon (TPH)	2,500 mg/kg
Gasoline Range Organics (GRO) + Diesel Range Organics (ORO)	2,500 mg/kg
Benzene	10 mg/kg
Benzene, Toluene, Ethylbenzene, Total Xylenes (BTEX)	50 mg/kg

[‡]The reclamation concentration requirements of 600 mg/kg Chloride and 100 mg/kg TPH apply to the top 4 feet of areas to be immediately reclaimed following remediation pursuant to NMAC 19.15.17.13.

Liner Inspection

On December 16, 2024, ESRR conducted a thorough visual inspection of the LSC and found no tears, cracks, cuts, breaks, or other signs of damage, confirming no evidence of a breach to the LSC. The liner appears to be in good condition and is performing as designed. **Photographic Documentation** of liner inspection activities is attached.

Closure Request

Based on initial release response and liner inspection activities, WPX believes the completed remedial actions meet the requirements set forth in NMAC 19.15.29.13 regulations in order to be protective of human health, the environment, and groundwater. WPX believes NFA is warranted at the Site and respectfully requests Closure for Incident Number nAPP2432323847.

RDX Federal Com 28 #009H- Closure Request Report
Incident Number: nAPP2432323847
Eddy County, New Mexico
Project No. 2692



If you have any questions or comments, please do not hesitate to contact Gilbert Moreno at (832) 541-7719 or gmoreno@earthsys.net. NMOCD Documentation of correspondence are attached.

Sincerely,

EARTH SYSTEMS RESPONSE & RESTORATION

A handwritten signature in black ink, appearing to read "Gilbert Moreno".

Gilbert Moreno
Carlsbad Operations Manager-Project Geologist

cc: Jim Raley, WPX Energy Permian, LLC
Bureau of Land Management

Attachments:

- Figure 1 - Site Map
- Figure 2 - Release Extent
- Figure 3 - Ground Water
- Figure 4 - Karst Potential
- Referenced Well Records
- Photographic Documentation
- NMOCD Documentation & Correspondence

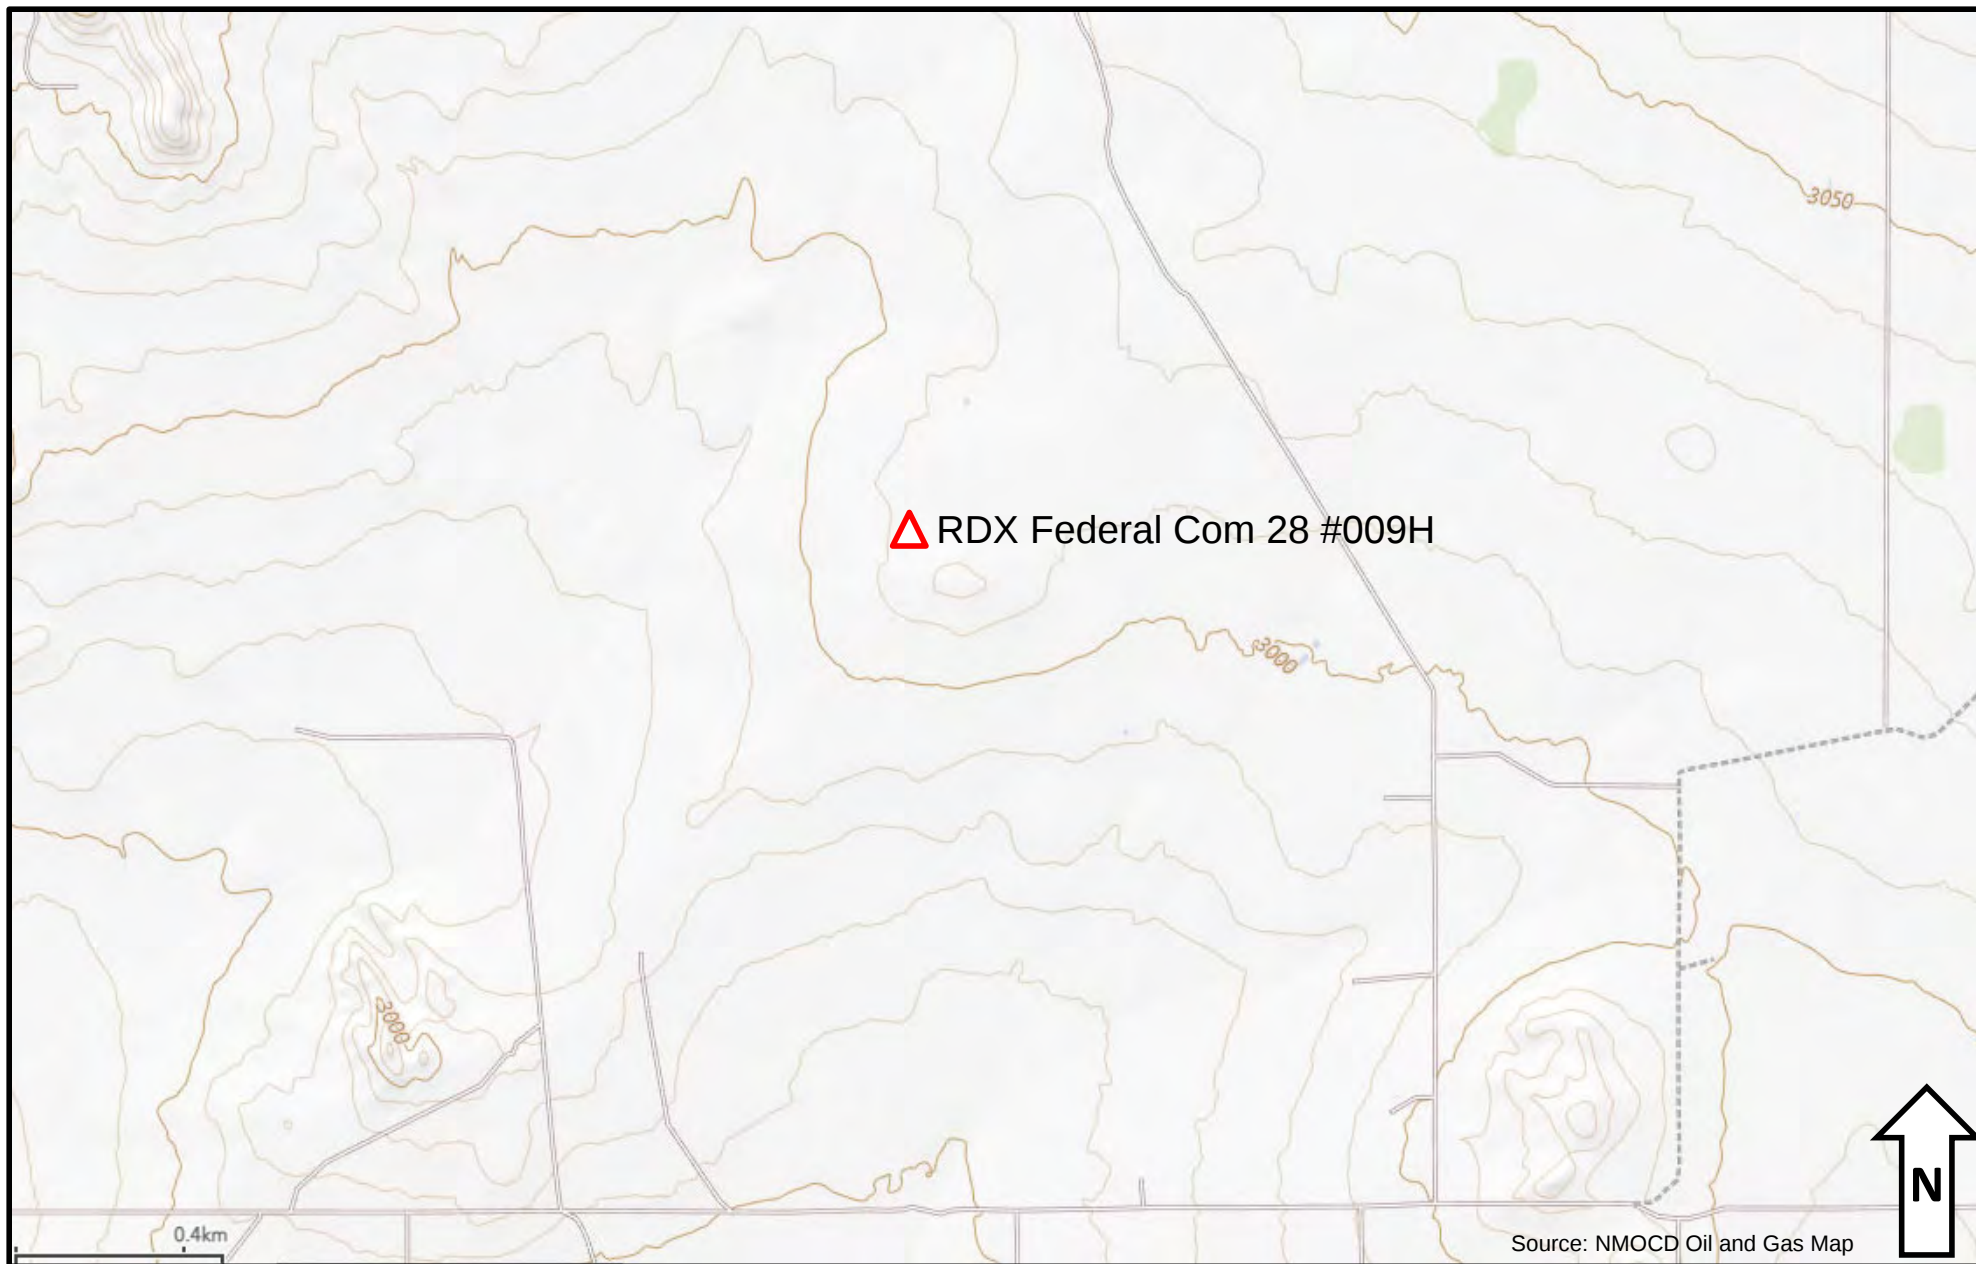


Figure 1 – Site Map

WPX Energy Permian – RDX Federal Com 28 #009H
GPS: 32.0196704°, -103.8904924°
Eddy County, New Mexico



Figure 2 – Release Extent

WPX Energy Permian – RDX Federal Com 28 #009H
GPS: 32.0196704°, -103.8904924°
Eddy County, New Mexico

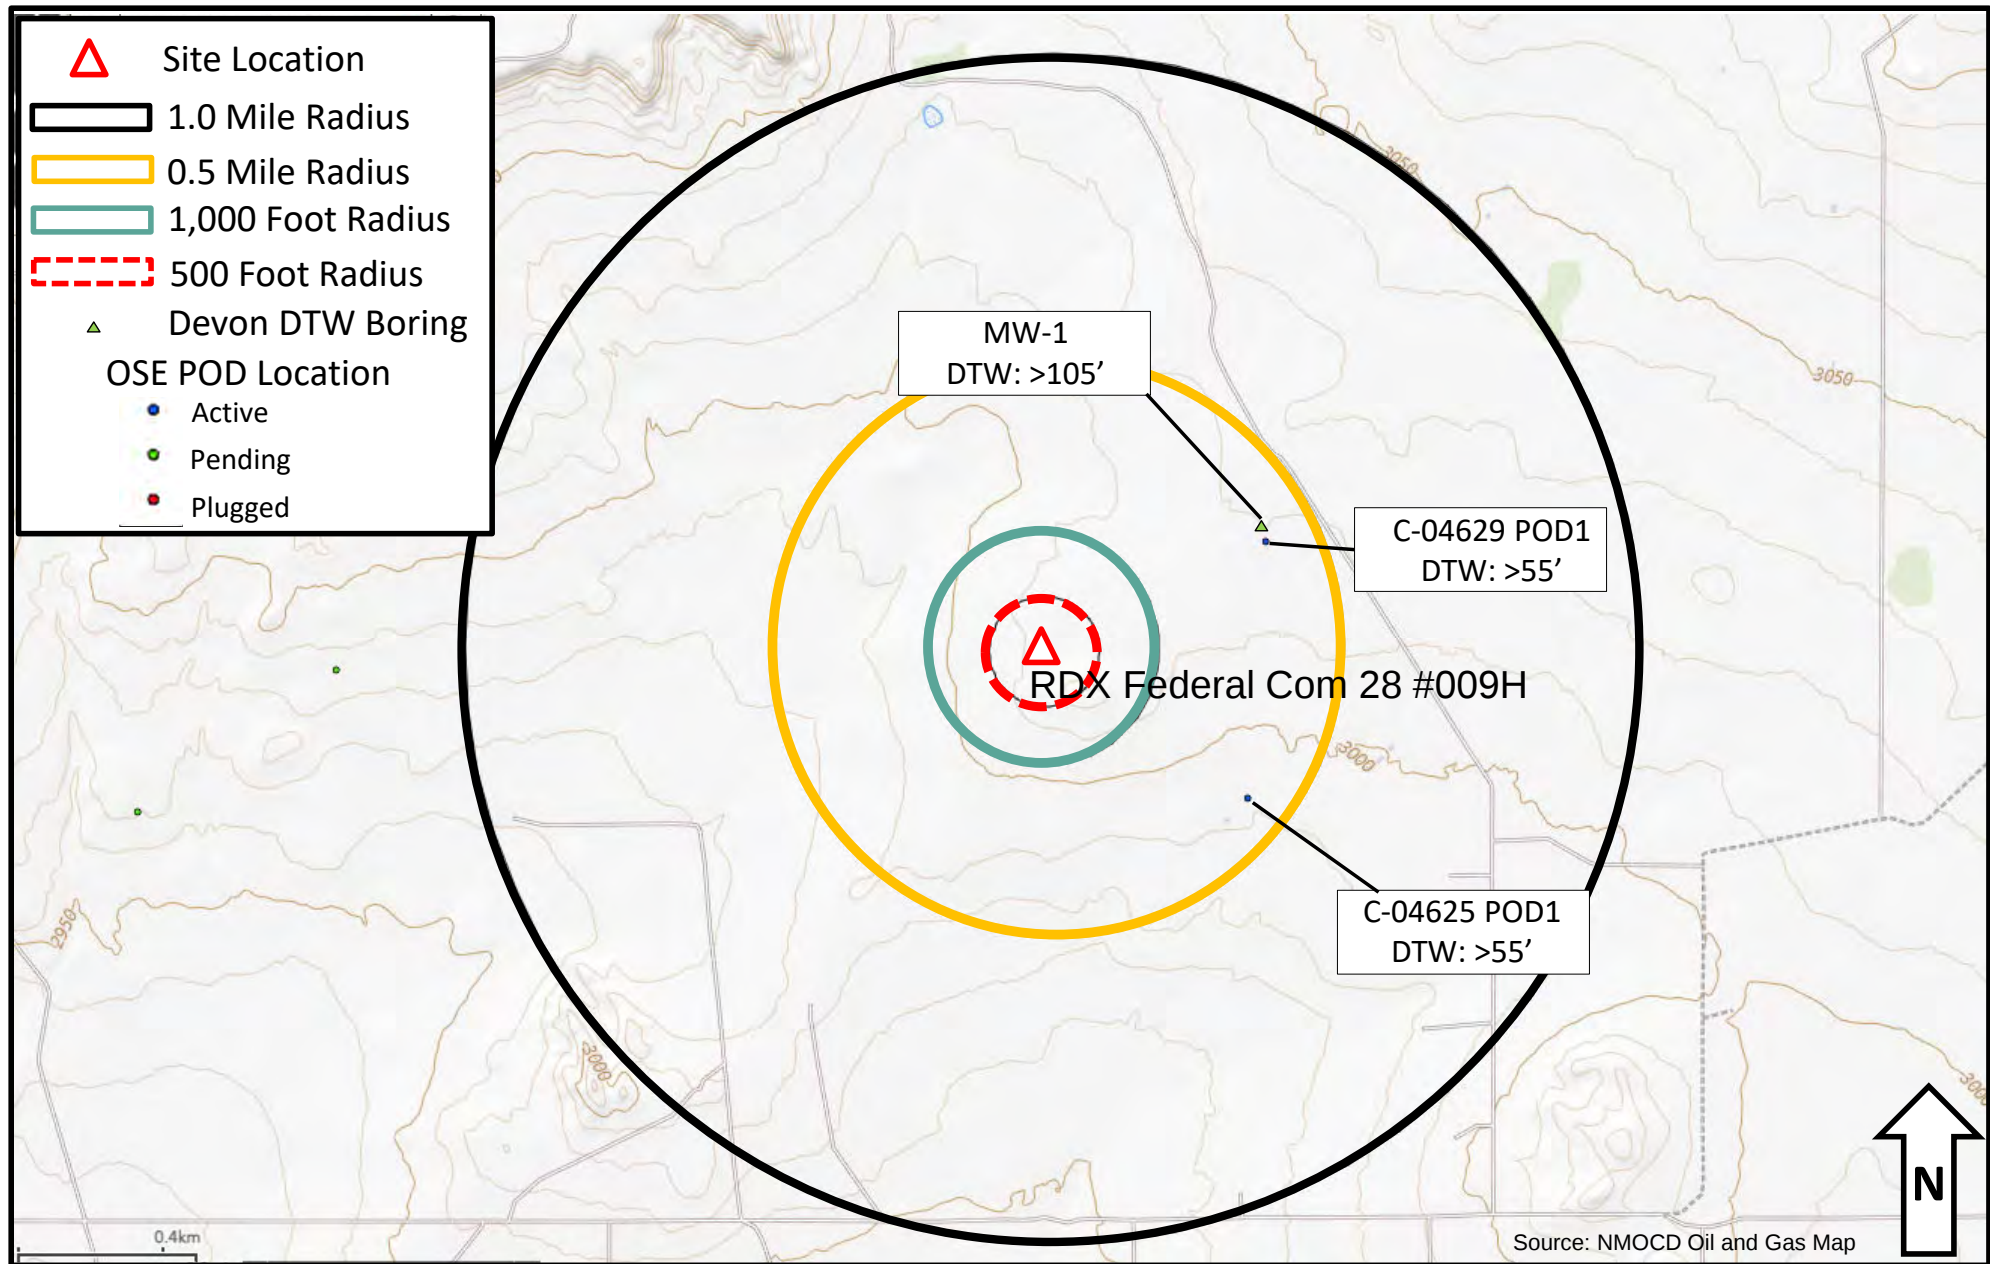


Figure 3 – Ground Water

WPX Energy Permian – RDX Federal Com 28 #009H
 GPS: 32.0196704°, -103.8904924°
 Eddy County, New Mexico

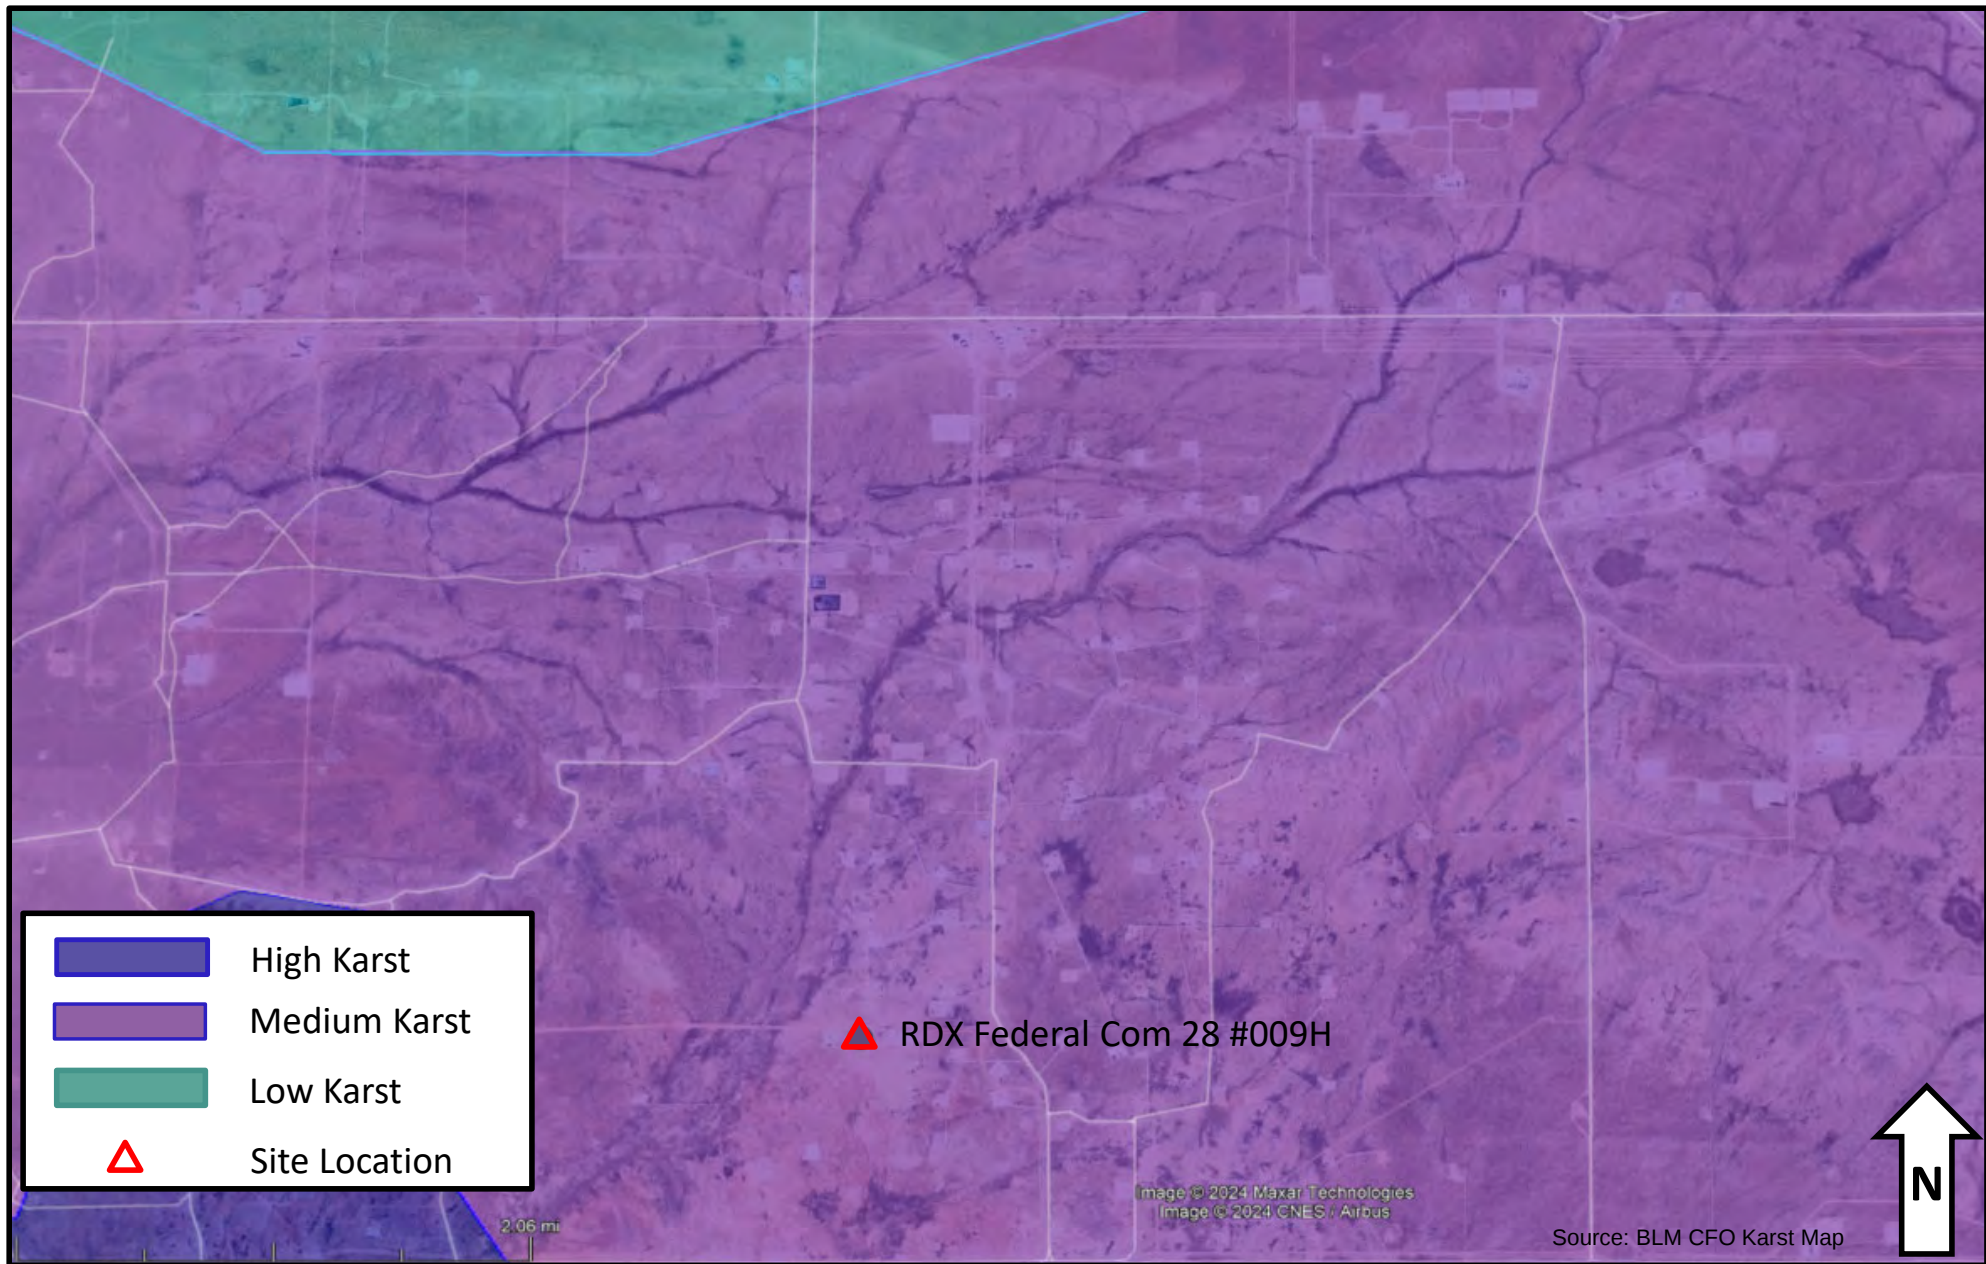


Figure 4 – Karst Potential

WPX Energy Permian – RDX Federal Com 28 #009H
GPS: 32.0196704°,-103.8904924°
Eddy County, New Mexico



							BORING LOG/MONITORING WELL COMPLETION DIAGRAM																	
Drilling Method: Air Rotary							Sampling Method: None			Boring/Well Number: MW-1			Location: RDX Federal Com 21-43											
Gravel Pack Type: 10/20 Sand							Gravel Pack Depth Interval: 3 Bags			Date: 12/9/2020			Client: WPX Energy											
Casing Type: PVC							Diameter: 2-inch			Depth Interval: 0-100 feet bgs			Logged By: J. Linn, P.G.			Drilled By: Talon LPE								
Screen Type: PVC							Slot: 0.010-inch			Diameter: 2-inch			Depth Interval: 100 - 105 ft			Seal Type: None			Seal Depth Interval: None			Latitude: 32.022571		
										Boring Total Depth (ft. BGS): 110			Longitude: -103.884371											
										Well Total Depth (ft. BGS): 105			Depth to Water (ft. BTOW): > 105			DTW Date: 12/16/2020								
Depth Interval (ft)	Recovery (ft)	Plasticity	Moisture	Odor	Staining	PID (ppm)	USCS	Sample ID	Lithology/Remarks				Well Completion											
0	NM	L	D	N	N	NM	SP	NS	Pale orange to tan poorly graded fine sand															
5																								
10																								
15																								
20	NM	H	D	N	N	NM	CL	NS	Pale orange/tan/pale red clay, dry, with silt, fine sand, and minor caliche															
25																								
30																								
35																								
40	NM	L	D	N	N	NM	SP	NS	Pale orange to pale red poorly graded fine sand															
45																								
50																								
55																								
60	NM	L	D	N	N	NM	SP	NS	Golden yellow poorly graded fine sand with minor silt and clay															
65																								
70																								
75																								
80	NM	L	D	N	N	NM	SP	NS	Pale orange to pale red poorly graded fine sand with minor silt/clay															
85																								
90																								
95																								
100	NM	M	D	N	N	NM	SC	NS	Buff to orange color fine sand with medium sand and clay															
85																								
90																								
95																								
95	NM	H	D	N	N	NM	CL	NS	Brown orange clay with silt and fine sand															
100																								
105																								
105																								
100	NM	H	D	N	N	NM	SC	NS	Golden yellow and buff colored clay with fine sand - TD Boring: 110' BGS; Sand 110' - 105' BGS															
105																								



WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER

www.ose.state.nm.us

FILED 1/6/2022 #16-18

1. GENERAL AND WELL LOCATION	OSE POD NO. (WELL NO.) POD 1 (TW-1)		WELL TAG ID NO. N/A		OSE FILE NO(S). C-4625			
	WELL OWNER NAME(S) Devon Energy				PHONE (OPTIONAL) 575-748-1838			
	WELL OWNER MAILING ADDRESS 6488 7 Rivers Hwy				CITY Artesia	STATE NM	ZIP 88210	
	WELL LOCATION (FROM GPS)	DEGREES 32	MINUTES 0	SECONDS 58.53	N	* ACCURACY REQUIRED: ONE TENTH OF A SECOND		
		LONGITUDE 103	53	4.54	W	* DATUM REQUIRED: WGS 84		
DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS – PLSS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE NW SW NE Sec.28 T26S R30S NMPM								
2. DRILLING & CASING INFORMATION	LICENSE NO. 1249		NAME OF LICENSED DRILLER Jackie D. Atkins			NAME OF WELL DRILLING COMPANY Atkins Engineering Associates, Inc.		
	DRILLING STARTED 6/15/2022		DRILLING ENDED 6/15/2022		DEPTH OF COMPLETED WELL (FT) Temporary Well		BORE HOLE DEPTH (FT) ±55	
	DEPTH WATER FIRST ENCOUNTERED (FT) n/a							
	COMPLETED WELL IS: ☐ ARTESIAN ☒ DRY HOLE ☐ SHALLOW (UNCONFINED)					STATIC WATER LEVEL IN COMPLETED WELL (FT) n/a		
	DATE STATIC MEASURED 6/15/22, 7/12/22							
	DRILLING FLUID: ☐ AIR ☐ MUD ADDITIVES – SPECIFY:							
	DRILLING METHOD: ☐ ROTARY ☐ HAMMER ☐ CABLE TOOL ☒ OTHER – SPECIFY: Hollow Stem Auger					CHECK HERE IF PITLESS ADAPTER IS INSTALLED ☐		
	DEPTH (feet bgl) FROM TO		BORE HOLE DIAM. (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE (add coupling diameter)	CASING INSIDE DIAM. (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	0	55	±6.5	Boring-HSA	--	--	--	--
	3. ANNULAR MATERIAL	DEPTH (feet bgl) FROM TO		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL		AMOUNT (cubic feet)	METHOD OF PLACEMENT

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 01/28/2022)

FILE NO. <u>C-04625</u>	POD NO. <u>1</u>	TRN NO. <u>726170</u>
LOCATION <u>26S.30E.28.1.3.2</u>	WELL TAG ID NO. <u>—</u>	PAGE 1 OF 2

4. HYDROGEOLOGIC LOG OF WELL

5. TEST; RIG SUPERVISION

6. SIGNATURE

WR-20 WELL RECORD & LOG (Version 01/28/2022)



2904 W 2nd St.
Roswell, NM 88201
voice: 575.624.2420
fax: 575.624.2421
www.atkinseng.com

August 4, 2022

DII-NMOSE
1900 W 2nd Street
Roswell, NM 88201

Hand Delivered to the DII Office of the State Engineer

Re: Well Record C-4625 Pod1

To whom it may concern:

Attached please find a well log & record and a plugging record, in duplicate, for a one (1) soil borings, C-4625 Pod1.

If you have any questions, please contact me at 575.499.9244 or lucas@atkinseng.com.

Sincerely,

A handwritten signature in black ink that reads "Lucas Middleton". The signature is written in a cursive, flowing style.

Lucas Middleton

Enclosures: as noted above

RECEIVED AUG 6 2022 PM 1:00



WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER

www.ose.state.nm.us

OSE 001 AUG 8 2022 11:01:18

1. GENERAL AND WELL LOCATION	OSE POD NO. (WELL NO.) POD 1 (TW-1)		WELL TAG ID NO. N/A		OSE FILE NO(S). C-4629			
	WELL OWNER NAME(S) Devon Energy				PHONE (OPTIONAL) 575-748-1838			
	WELL OWNER MAILING ADDRESS 6488 7 Rivers Hwy				CITY Artesia	STATE NM	ZIP 88210	
	WELL LOCATION (FROM GPS)	DEGREES LATITUDE 32	MINUTES 1	SECONDS 20.62 N	* ACCURACY REQUIRED: ONE TENTH OF A SECOND			
		LONGITUDE 103	53	2.72 W	* DATUM REQUIRED: WGS 84			
DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS - PLSS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE SE SW SE Sec.21 T26S R30S NMPM								
2. DRILLING & CASING INFORMATION	LICENSE NO. 1249		NAME OF LICENSED DRILLER Jackie D. Atkins			NAME OF WELL DRILLING COMPANY Atkins Engineering Associates, Inc.		
	DRILLING STARTED 6/15/2022	DRILLING ENDED 6/15/2022	DEPTH OF COMPLETED WELL (FT) Temporary Well		BORE HOLE DEPTH (FT) ±55	DEPTH WATER FIRST ENCOUNTERED (FT) N/A		
	COMPLETED WELL IS: ☐ ARTESIAN ☒ DRY HOLE ☐ SHALLOW (UNCONFINED)				STATIC WATER LEVEL IN COMPLETED WELL (FT) n/a	DATE STATIC MEASURED 6/15/22, 7/12/22		
	DRILLING FLUID: ☐ AIR ☐ MUD ADDITIVES - SPECIFY:							
	DRILLING METHOD: ☐ ROTARY ☐ HAMMER ☐ CABLE TOOL ☒ OTHER - SPECIFY: Hollow Stem Auger					CHECK HERE IF PITLESS ADAPTER IS INSTALLED ☐		
	DEPTH (feet bgl) FROM TO		BORE HOLE DIAM (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE (add coupling diameter)	CASING INSIDE DIAM. (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	0	55	±6.5	Boring-HSA	--	--	--	--
3. ANNULAR MATERIAL	DEPTH (feet bgl) FROM TO		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL		AMOUNT (cubic feet)	METHOD OF PLACEMENT	

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 01/28/2022)

FILE NO. <u>C-4629</u>	POD NO. <u>1</u>	TRN NO. <u>726185</u>
LOCATION <u>26S.30E.21.4.3.4.</u>	WELL TAG ID NO. <u>---</u>	PAGE 1 OF 2

4. HYDROGEOLOGIC LOG OF WELL

FOR OSE INTERNAL USE		WR-20 WELL RECORD & LOG (Version 01/28/2022)	
FILE NO. C-4629	POD NO. 1	TRN NO. 726185	
LOCATION 765.30E.21.4.34	WELL TAG ID NO. —	PAGE 2 OF 2	



2904 W 2nd St.
Roswell, NM 88201
voice: 575.624.2420
fax: 575.624.2421
www.atkinseng.com

August 4, 2022

DII-NMOSE
1900 W 2nd Street
Roswell, NM 88201

Hand Delivered to the DII Office of the State Engineer

Re: Well Record C-4629 Pod1

To whom it may concern:

Attached please find a well log & record and a plugging record, in duplicate, for a one (1) soil borings, C-4629 Pod1.

If you have any questions, please contact me at 575.499.9244 or lucas@atkinseng.com.

Sincerely,

A handwritten signature in black ink, appearing to read "Lucas Middleton". The signature is fluid and cursive.

Lucas Middleton

Enclosures: as noted above

USE DTI AUG 8 2022 AM 10:12

RDX Federal Com 28 #009H- Closure Request Report
Incident Number: nAPP2432323847
GPS: 32.0196704°, -103.8904924°
Eddy County, New Mexico
Project No. 2692

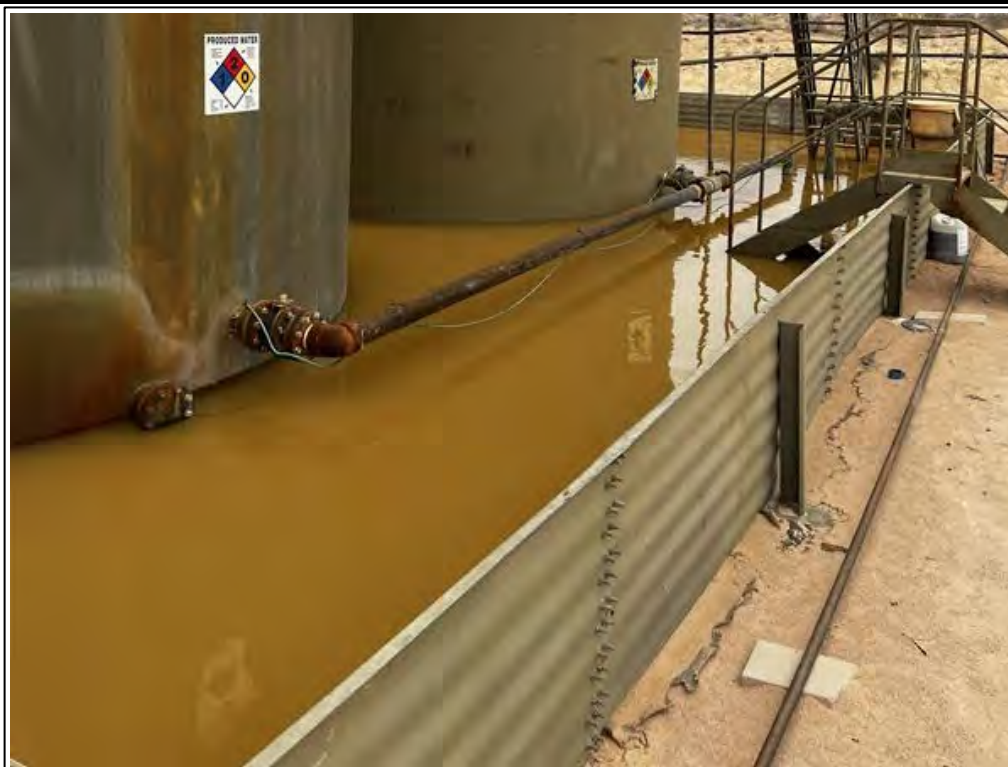


PHOTO 1: Southeast view of the lined secondary containment during initial assessment activities. 11/17/2024



PHOTO 2: Northeastern view of the lined secondary containment during liner inspection. 12/16/2024

RDX Federal Com 28 #009H- Closure Request Report
Incident Number: nAPP2432323847
GPS: 32.0196704°, -103.8904924°
Eddy County, New Mexico
Project No. 2692



PHOTO 3: Southeast view of the lined secondary containment during liner inspection. 12/16/2024



PHOTO 4: Northwest view of the lined secondary containment during liner inspection. 12/16/2024

RDX Federal Com 28 #009H- Closure Request Report
Incident Number: nAPP2432323847
GPS: 32.0196704°, -103.8904924°
Eddy County, New Mexico
Project No. 2692



PHOTO 5: Southeast view of the lined secondary containment during liner inspection. 12/16/2024



PHOTO 6: Southeast view of the lined secondary containment during liner inspection. 12/16/2024

RDX Federal Com 28 #009H- Closure Request Report
Incident Number: nAPP2432323847
GPS: 32.0196704°, -103.8904924°
Eddy County, New Mexico
Project No. 2692

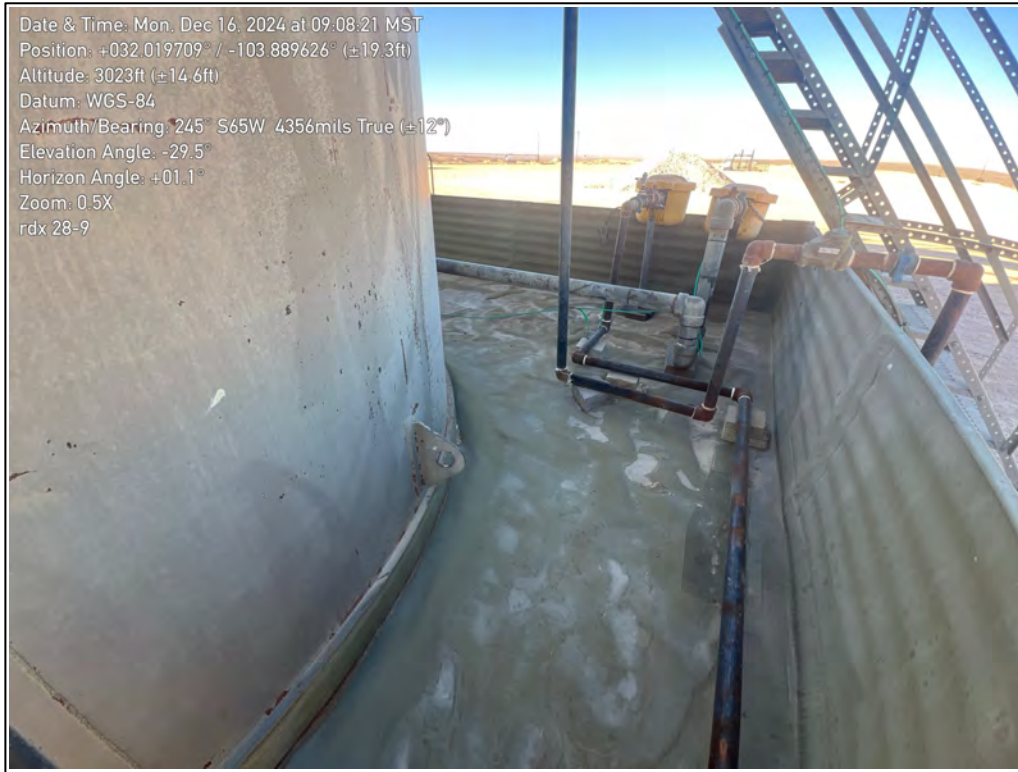


PHOTO 7: Southwest view of the lined secondary containment during liner inspection. 12/16/2024



PHOTO 8: Southwest view of the lined secondary containment during liner inspection. 12/16/2024

RDX Federal Com 28 #009H- Closure Request Report
Incident Number: nAPP2432323847
GPS: 32.0196704°, -103.8904924°
Eddy County, New Mexico
Project No. 2692



PHOTO 9: Northeast exterior view of the lined secondary containment during liner inspection. 12/16/2024



PHOTO 10: Southwest exterior view of the lined secondary containment during liner inspection. 12/16/2024

RDX Federal Com 28 #009H- Closure Request Report
Incident Number: nAPP2432323847
GPS: 32.0196704°, -103.8904924°
Eddy County, New Mexico
Project No. 2692



PHOTO 11: Southeast exterior view of the lined secondary containment during liner inspection. 12/16/2024

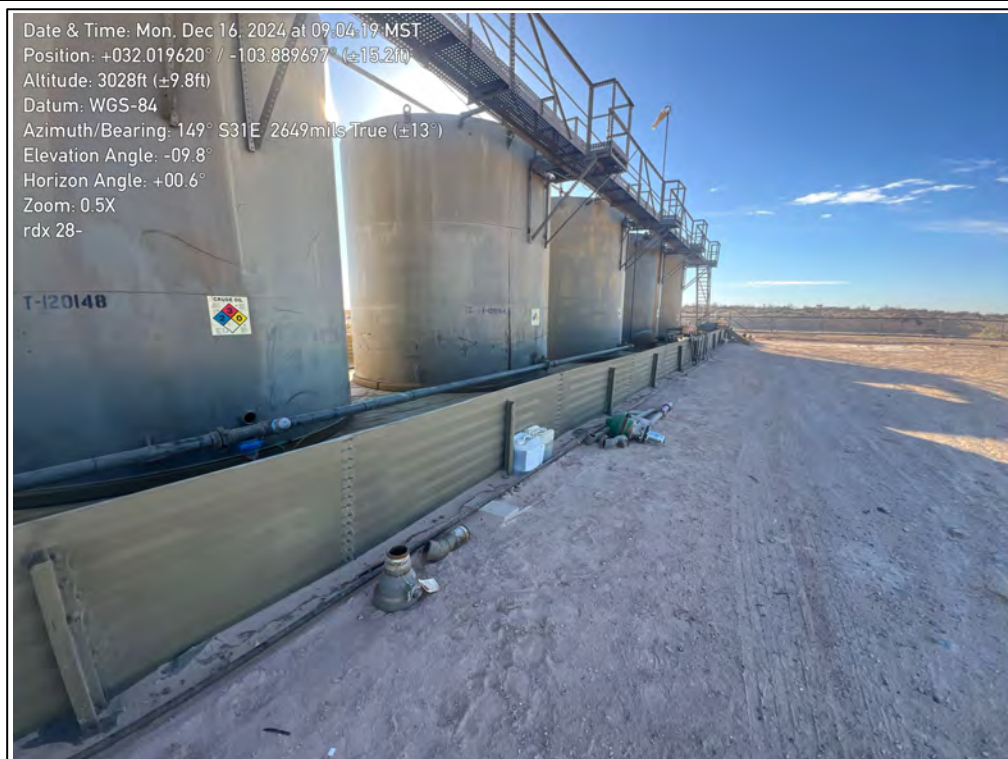


PHOTO 12: Southeast exterior view of the lined secondary containment during liner inspection. 12/16/2024

RDX Federal Com 28 #009H- Closure Request Report
Incident Number: nAPP2432323847
GPS: 32.0196704°, -103.8904924°
Eddy County, New Mexico
Project No. 2692



PHOTO 11: View of well location sign.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 410871

QUESTIONS

Operator: WPX Energy Permian, LLC Devon Energy - Regulatory Oklahoma City, OK 73102	OGRID: 246289
	Action Number: 410871
	Action Type: [NOTIFY] Notification Of Liner Inspection (C-141L)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2432323847
Incident Name	NAPP2432323847 RDX FEDERAL COM 28 #009H @ 30-015-43294
Incident Type	Produced Water Release
Incident Status	Initial C-141 Approved
Incident Well	[30-015-43294] RDX FEDERAL COM 28 #009H

Location of Release Source	
Site Name	RDX FEDERAL COM 28 #009H
Date Release Discovered	11/17/2024
Surface Owner	Federal

Liner Inspection Event Information	
<i>Please answer all the questions in this group.</i>	
What is the liner inspection surface area in square feet	3,468
Have all the impacted materials been removed from the liner	Yes
Liner inspection date pursuant to Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC	12/16/2024
Time liner inspection will commence	08:00 AM
Please provide any information necessary for observers to liner inspection	Gilbert Moreno (832) 541-7719
Please provide any information necessary for navigation to liner inspection site	From the intersection of HWY 285 & Longhorn Rd/Whitehorn Rd-Head East on Longhorn Rd/Whitehorn Rd 2.5 mi.-slight left to stay on Longhorn Rd 2.8 mi.-Turn left onto Pipeline Rd-continue E 2.8 mi.-Turn right onto Tarbrush Rd-continue 0.3 mi-Turn left and continue E 0.5 mi- Turn right and continue SE 0.6 mi.-Turn left and continue E 0.7 mi-Keep left and continue E 2.1 mi-Turn right and continue S 0.68 mi.- Turn right and continue W 0.54 mi.- Turn left and continue S 0.36 mi.- Turn right and continue 0.05 mi to location.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 410871

CONDITIONS

Operator: WPX Energy Permian, LLC Devon Energy - Regulatory Oklahoma City, OK 73102	OGRID: 246289
	Action Number: 410871
	Action Type: [NOTIFY] Notification Of Liner Inspection (C-141L)

CONDITIONS

Created By	Condition	Condition Date
jralej	Failure to notify the OCD of liner inspections including any changes in date/time per the requirements of 19.15.29.11.A(5)(a)(ii) NMAC, may result in the inspection not being accepted.	12/11/2024

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 417523

QUESTIONS

Operator: WPX Energy Permian, LLC Devon Energy - Regulatory Oklahoma City, OK 73102	OGRID: 246289
	Action Number: 417523
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2432323847
Incident Name	NAPP2432323847 RDX FEDERAL COM 28 #009H @ 30-015-43294
Incident Type	Produced Water Release
Incident Status	Remediation Closure Report Received
Incident Well	[30-015-43294] RDX FEDERAL COM 28 #009H

Location of Release Source*Please answer all the questions in this group.*

Site Name	RDX FEDERAL COM 28 #009H
Date Release Discovered	11/17/2024
Surface Owner	Federal

Incident Details*Please answer all the questions in this group.*

Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release*Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.*

Crude Oil Released (bbls) Details	Not answered.
Produced Water Released (bbls) Details	Cause: Equipment Failure Pump Produced Water Released: 521 BBL Recovered: 521 BBL Lost: 0 BBL.
Is the concentration of chloride in the produced water >10,000 mg/l	Yes
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Water Transfer Pump Plug washed out, releasing 521 bbls produced water to lined secondary containment. Fluids fully recovered

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 417523

QUESTIONS (continued)

Operator: WPX Energy Permian, LLC Devon Energy - Regulatory Oklahoma City, OK 73102	OGRID: 246289
	Action Number: 417523
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	Yes
Reasons why this would be considered a submission for a notification of a major release	From paragraph A. "Major release" determine using: (1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.
<i>With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.</i>	

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	Not answered.

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: James Raley Title: EHS Professional Email: jim.raley@dvsn.com Date: 01/06/2025
--	---

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 3

Action 417523

QUESTIONS (continued)

Operator: WPX Energy Permian, LLC Devon Energy - Regulatory Oklahoma City, OK 73102	OGRID: 246289
	Action Number: 417523
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Site Characterization	
<i>Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 100 and 500 (ft.)
What method was used to determine the depth to ground water	NM OSE iWaters Database Search
Did this release impact groundwater or surface water	No
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	Between 1000 (ft.) and ½ (mi.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Greater than 5 (mi.)
An occupied permanent residence, school, hospital, institution, or church	Greater than 5 (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Between 1 and 5 (mi.)
Any other fresh water well or spring	Between 1 and 5 (mi.)
Incorporated municipal boundaries or a defined municipal fresh water well field	Greater than 5 (mi.)
A wetland	Between 1000 (ft.) and ½ (mi.)
A subsurface mine	Greater than 5 (mi.)
An (non-karst) unstable area	Between 1 and 5 (mi.)
Categorize the risk of this well / site being in a karst geology	Medium
A 100-year floodplain	Between 1000 (ft.) and ½ (mi.)
Did the release impact areas not on an exploration, development, production, or storage site	No

Remediation Plan	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
Requesting a remediation plan approval with this submission	Yes
<i>Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.</i>	
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	Yes
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
On what estimated date will the remediation commence	12/16/2024
On what date will (or did) the final sampling or liner inspection occur	12/16/2024
On what date will (or was) the remediation complete(d)	12/16/2024
What is the estimated surface area (in square feet) that will be remediated	3374
What is the estimated volume (in cubic yards) that will be remediated	0
<i>These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed.</i>	
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 4

Action 417523

QUESTIONS (continued)

Operator: WPX Energy Permian, LLC Devon Energy - Regulatory Oklahoma City, OK 73102	OGRID: 246289
	Action Number: 417523
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Remediation Plan (continued)	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:	
<i>(Select all answers below that apply.)</i>	
Is (or was) there affected material present needing to be removed	Yes
Is (or was) there a power wash of the lined containment area (to be) performed	Yes
OTHER (Non-listed remedial process)	Not answered.
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.	
I hereby agree and sign off to the above statement	Name: James Raley Title: EHS Professional Email: jim.raley@dv.n.com Date: 01/06/2025
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 6

Action 417523

QUESTIONS (continued)

Operator: WPX Energy Permian, LLC Devon Energy - Regulatory Oklahoma City, OK 73102	OGRID: 246289
	Action Number: 417523
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Liner Inspection Information	
Last liner inspection notification (C-141L) recorded	410871
Liner inspection date pursuant to Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC	12/16/2024
Was all the impacted materials removed from the liner	Yes
What was the liner inspection surface area in square feet	3468

Remediation Closure Request

Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.

Requesting a remediation closure approval with this submission	Yes
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	Yes
What was the total surface area (in square feet) remediated	3374
What was the total volume (cubic yards) remediated	0
Summarize any additional remediation activities not included by answers (above)	The release was contained laterally by the lined containment and the liner was performing as designed.

The responsible party must attach information demonstrating they have complied with all applicable closure requirements and any conditions or directives of the OCD. This demonstration should be in the form of a comprehensive report (in .pdf format) including a scaled site map, sampling diagrams, relevant field notes, photographs of any excavation prior to backfilling, laboratory data including chain of custody documents of final sampling, and a narrative of the remedial activities. Refer to 19.15.29.12 NMAC.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations. The responsible party acknowledges they must substantially restore, reclaim, and re-vegetate the impacted surface area to the conditions that existed prior to the release or their final land use in accordance with 19.15.29.13 NMAC including notification to the OCD when reclamation and re-vegetation are complete.

I hereby agree and sign off to the above statement	Name: James Raley Title: EHS Professional Email: jim.raley@dv.com Date: 01/06/2025
--	---

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/oed/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 417523

CONDITIONS

Operator: WPX Energy Permian, LLC Devon Energy - Regulatory Oklahoma City, OK 73102	OGRID: 246289
	Action Number: 417523
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

CONDITIONS

Created By	Condition	Condition Date
scott.rodgers	App ID 417523 Liner Inspection approved	1/8/2025