



1. Continue O&M & sampling as stated in Discussions and Recommendations in report. 2. Submit next quarterly report by January 15, 2026.

October 13, 2025

New Mexico Oil Conservation Division

New Mexico Energy, Minerals, and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, New Mexico 87505

**Re: Third Quarter 2025 – Remediation System Operation and Monitoring Report
Standard #1
San Juan County, New Mexico
Hilcorp Energy Company
NMOCD Incident Number: NCS1735235018
Abatement Plan Number: AP-126**

To Whom it May Concern:

Ensolum, LLC (Ensolum), on behalf of Hilcorp Energy Company (Hilcorp), presents this *Third Quarter 2025 - Remediation System Operation and Monitoring Report* summarizing remediation system performance during the third quarter of 2025 at the Standard #1 (Site, Figure 1). The duration of operation and monitoring activities included in this report is for the period from June 27 and September 29, 2025.

This report was prepared following the approval from the New Mexico Oil Conservation Division (NMOCD) regarding the dual-phase extraction (DPE) remediation system described in the *Stage 2 Abatement Plan* submitted by LT Environmental, Inc. in September 2019. Although no formal conditions of approval (COAs) have been provided in response to the aforementioned report, this report includes the following information based on COAs issued for similar Sites:

- A summary of remediation activities during the quarter;
- The system run time summary (90 percent (%) run time typically required);
- Total system flow and vacuum measurements;
- Individual well flow rates, photoionization detector (PID) measurements of volatile organic compounds (VOCs), vacuum measurements, and oxygen/carbon dioxide measurements via hand-held analyzers; and
- The petroleum mass removal and fluid product recovery from the remediation system.

Per correspondence with the NMOCD in April 2024, the quarterly remediation summary reports also include data and summaries from groundwater sampling events conducted at the Site during each reporting period. This report summarizes groundwater data gathered during the third quarter of 2025.

REMEDIATION SYSTEM DESCRIPTION

The remediation system at the Site includes a DPE system, which uses a high vacuum rotary claw blower to apply vacuum to remediation wells (MW01, MW02, MW03, MW06, MW10, and MW15) connected to the blower via subsurface piping (Figure 2). The extracted air, petroleum vapors, and fluids enter a vapor/liquid separator or “knock out” tank. Air and petroleum vapors are

passed through the high vacuum extraction blower and discharged to the atmosphere via an exhaust stack. Separated liquid, which includes light non-aqueous phase liquids (LNAPL) and potentially impacted groundwater, is pumped to an aboveground storage tank for storage and off-site disposal. The system layout is depicted on Figure 3.

THIRD QUARTER 2025 OPERATION AND MAINTENANCE

Since startup on January 2, 2024, all Site DPE wells have been operated in order to recover LNAPL, draw down the groundwater table, and induce air flow in impacted soil zones. Field visits were conducted bi-weekly throughout the third quarter of 2025. Field forms completed during operations and maintenance (O&M) visits are presented as Appendix A.

Between June 27 and September 29, 2025, the DPE system operated for 1,977 hours for a runtime efficiency of 88%. System downtime in both July and September 2025 was the result of conducting deep cleaning and replacement of system components that had become fouled and were restricting flow. Appendix B presents photographs of the runtime meter for calculating the third quarter of 2025 runtime efficiency. Table 1 presents the DPE system operational hours and calculated percent runtime.

Vapor Recovery

Influent vapor samples from the DPE system are collected quarterly following the first year of operation. An influent vapor sample was collected on August 11, 2025. The sample was collected into two 1-Liter Tedlar® bags and submitted to Eurofins Environment Testing (Eurofins) in Albuquerque, New Mexico for analysis of VOCs following United States Environmental Protection Agency (EPA) EPA Method 8260B, total volatile petroleum hydrocarbons (TVPH, also referred to as total petroleum hydrocarbons-gasoline range organics (TPH-GRO)) following EPA Method 8015D, and fixed gas analysis of oxygen and carbon dioxide following Gas Processors Association (GPA) Method 2261. A summary of field measurements and analytical results are presented in Tables 2 and 3, respectively. The full laboratory analytical report is attached as Appendix C. Graphs 1 and 2 also present oxygen and carbon dioxide levels over time, respectively.

Vapor sample data and measured influent flow rates are used to estimate total mass recovered and total emissions generated by the DPE system (Table 4). Based on these estimates, 12,286 pounds (6.14 tons) of TVPH in the vapor phase have been removed by the system to date.

Liquid Recovery

Total liquid recovery volumes are measured using a totalizing flow metering device. Since the startup of the system on January 2, 2024, through September 29, 2025, approximately 145,032 gallons of liquid have been recovered. The impacted groundwater and recovered LNAPL are emulsified and homogenously commingled enough during extraction that product thickness is unmeasurable in the liquid recovery tank. Therefore, the estimated volume of LNAPL recovered is not measurable and not reported. Liquid recovery is summarized in Table 5.

GROUNDWATER MONITORING

Since October 2018, groundwater gauging and sampling activities have been conducted at the Site. Groundwater gauging and sampling at the Site was completed on September 15 and September 16, 2025, as part of the third quarter 2025 system activities.

Fluid Level Measurements

Prior to purging and sampling, static depth to groundwater and total depth of each monitoring well was measured using an oil/water interface probe. Depth to phase-separated hydrocarbons (PSH, synonymous with LNAPL) was also recorded when present and a correction factor of 0.8 was applied to the calculated groundwater elevation to account for the depression of the water column caused by the presence of overlying PSH. The interface probe was decontaminated with Alconox® soap and rinsed with distilled water prior to each measurement to prevent cross contamination. Depth to groundwater, depth to PSH, and calculated groundwater elevations are summarized in Table 6. Potentiometric surface maps were drafted with groundwater elevations and PSH thickness measured during the third quarter 2025 quarterly monitoring event (Figure 4).

During the third quarter 2025 gauging event, a trace (less than 0.01 feet) of PSH was observed in monitoring wells MW01 through MW06, MW10, MW14, and MW15.

In general, the presence of groundwater at the Site is highly variable and no apparent continuous groundwater aquifer has been observed during drilling and/or groundwater monitoring activities. Groundwater flow direction and gradient is generally difficult to interpret, as dry wells often exist around the perimeter of the Site, as well as between wells containing groundwater. Based on historical measurements, groundwater flow direction is variable across the Site, but is generally to the west-northwest and west-southwest.

Groundwater Sampling Activities and Analytical Results

Groundwater samples were collected for laboratory analysis from monitoring wells containing sufficient water to sample and those that did not contain trace PSH. Disposable polyvinyl chloride (PVC) bailers were used to collect groundwater samples due to limited water volume within several of the monitoring wells. Prior to collecting groundwater samples, Ensolum purged a minimum of three casing volumes or until the well was bailed dry to ensure water from the adjacent formation, representative of actual aquifer conditions, was sampled. If a well was purged dry, the well was allowed to recharge before samples were collected. Water quality parameters including pH, electrical conductivity, and temperature were measured in each well using a multi-probe water quality field meter during purging.

Groundwater samples were collected into laboratory provided sample bottles and immediately placed on ice for preservation. Samples were submitted to Eurofins Environment Testing in Albuquerque, New Mexico for analysis of benzene, toluene, ethylbenzene, and xylenes (BTEX). Of the wells sampled, one or more BTEX constituent exceeded the New Mexico Water Quality Control Commission (NMWQCC) standards in groundwater within monitoring wells MW09, MW12, MW16, MW18, and MW19. All five aforementioned wells also contained BTEX concentrations exceeding the NMWQCC standards during the second quarter 2025 monitoring event and BTEX constituent trends remain stable or decreasing at each location. A summary of groundwater analytical results is presented in Table 7 and on Figure 5, with complete laboratory analytical report attached as Appendix D.

DISCUSSIONS AND RECOMMENDATIONS

Based on the periodic downtime documented during this and previous reporting periods and the diminished recovery associated with fouling of the system piping and instrumentation, Hilcorp will implement a chemical injection pilot test in the fourth quarter of 2025. A metering chemical injection pump will be installed and an antiscalant will be injected into the system piping where

the individual extraction well legs manifold together. Following a three-month long pilot test, Hilcorp will evaluate whether antiscalant injection has aided in system uptime and performance. Bi-weekly (every other week) to monthly O&M visits and bi-monthly (every other month) sampling events will be performed by Ensolum and/or Hilcorp personnel to ensure the DPE system is operating within normal working ranges (i.e., temperature, pressure, and vacuum). Deviations from regular operations will be noted on field logs and included in the following quarterly report.

Reporting

Updated remediation reports will be prepared and submitted to the NMOCD on a quarterly basis within 15 days following the end of the quarter and will contain the following:


- A summary of remediation and monitoring activities during the period;
- System run-time summary;
- Petroleum hydrocarbon mass removal and fluid recovery from the remediation system;
- DPE volume liquid removal; and
- Groundwater monitoring results, when applicable.

We appreciate the opportunity to provide this report to the NMOCD. If you should have any questions or comments regarding this report, please contact the undersigned.

Sincerely,
Ensolum, LLC



Stuart Hyde, LG (licensed in WY, WA & TX)
Senior Managing Geologist
(970) 903-1607
shyde@ensolum.com




Daniel R. Moir, PG (licensed in WY & TX)
Senior Managing Geologist
(303) 887-2946
dmoir@ensolum.com

Attachments:

Figure 1	Site Location Map
Figure 2	Site Features
Figure 3	Dual Phase Extraction System Layout
Figure 4	Groundwater Elevation Map – Q4 2024
Figure 5	Groundwater Analytical Results – Q4 2024
Table 1	Dual Phase Extraction System Runtime Calculations
Table 2	Dual Phase Extraction System Field Measurements
Table 3	Dual Phase Extraction System Air Analytical Results
Table 4	Dual Phase Extraction System Mass Removal and Emissions
Table 5	Dual Phase Extraction System Liquid Recovery
Table 6	Groundwater Elevation
Table 7	Groundwater Analytical Results
Graph 1	Oxygen vs Time
Graph 2	Carbon Dioxide vs Time
Appendix A	Field Notes
Appendix B	Project Photographs
Appendix C	Vapor Laboratory Analytical Report
Appendix D	Groundwater Laboratory Analytical Report



Figures

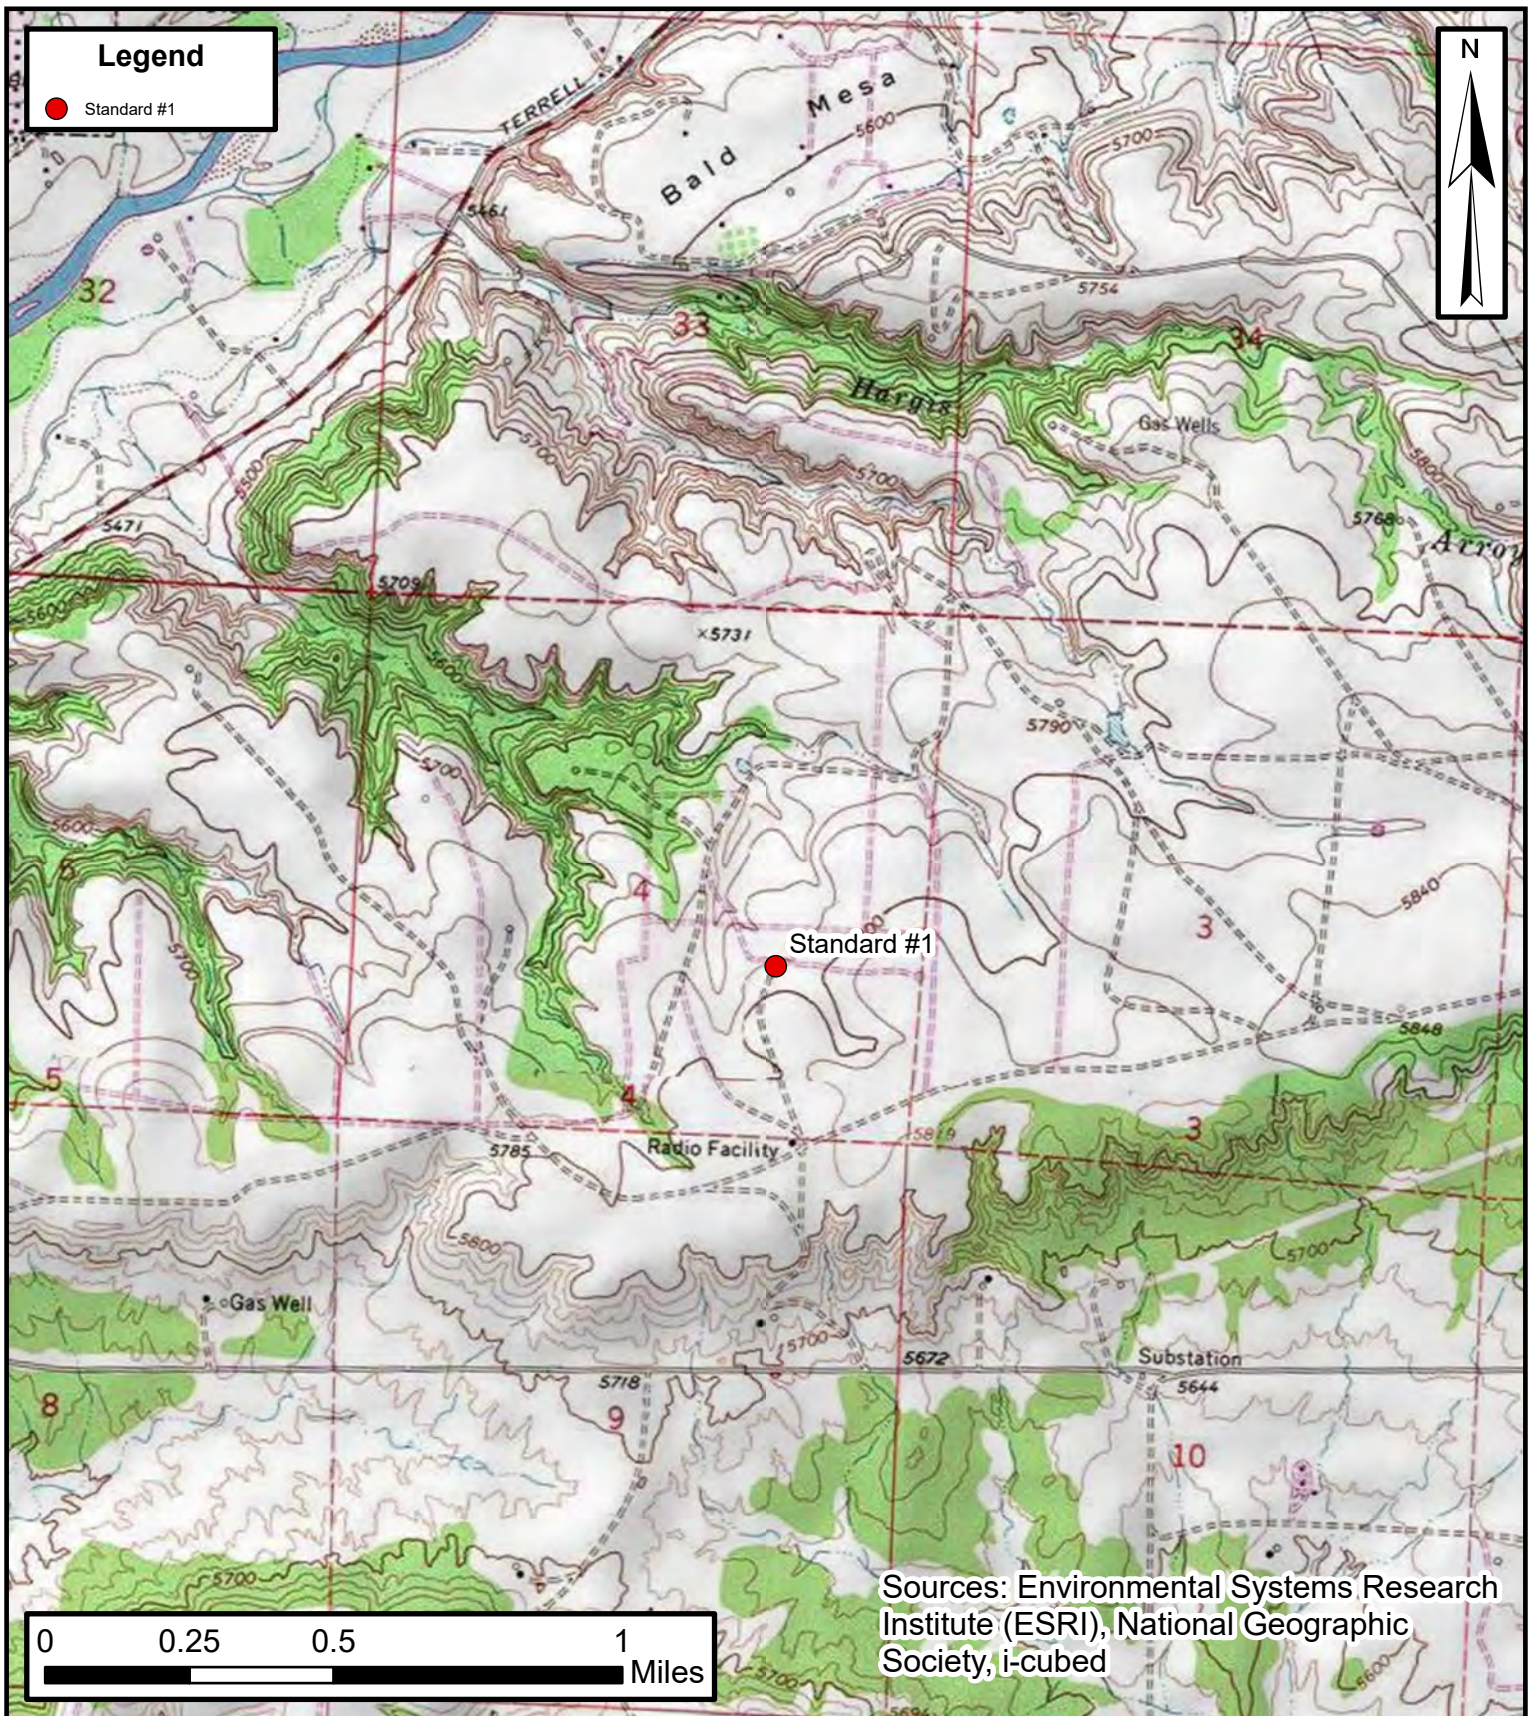

Site Location Map


Standard #1

Hilcorp Energy Company

36.75285, -108.099744
San Juan County, New Mexico

FIGURE

1

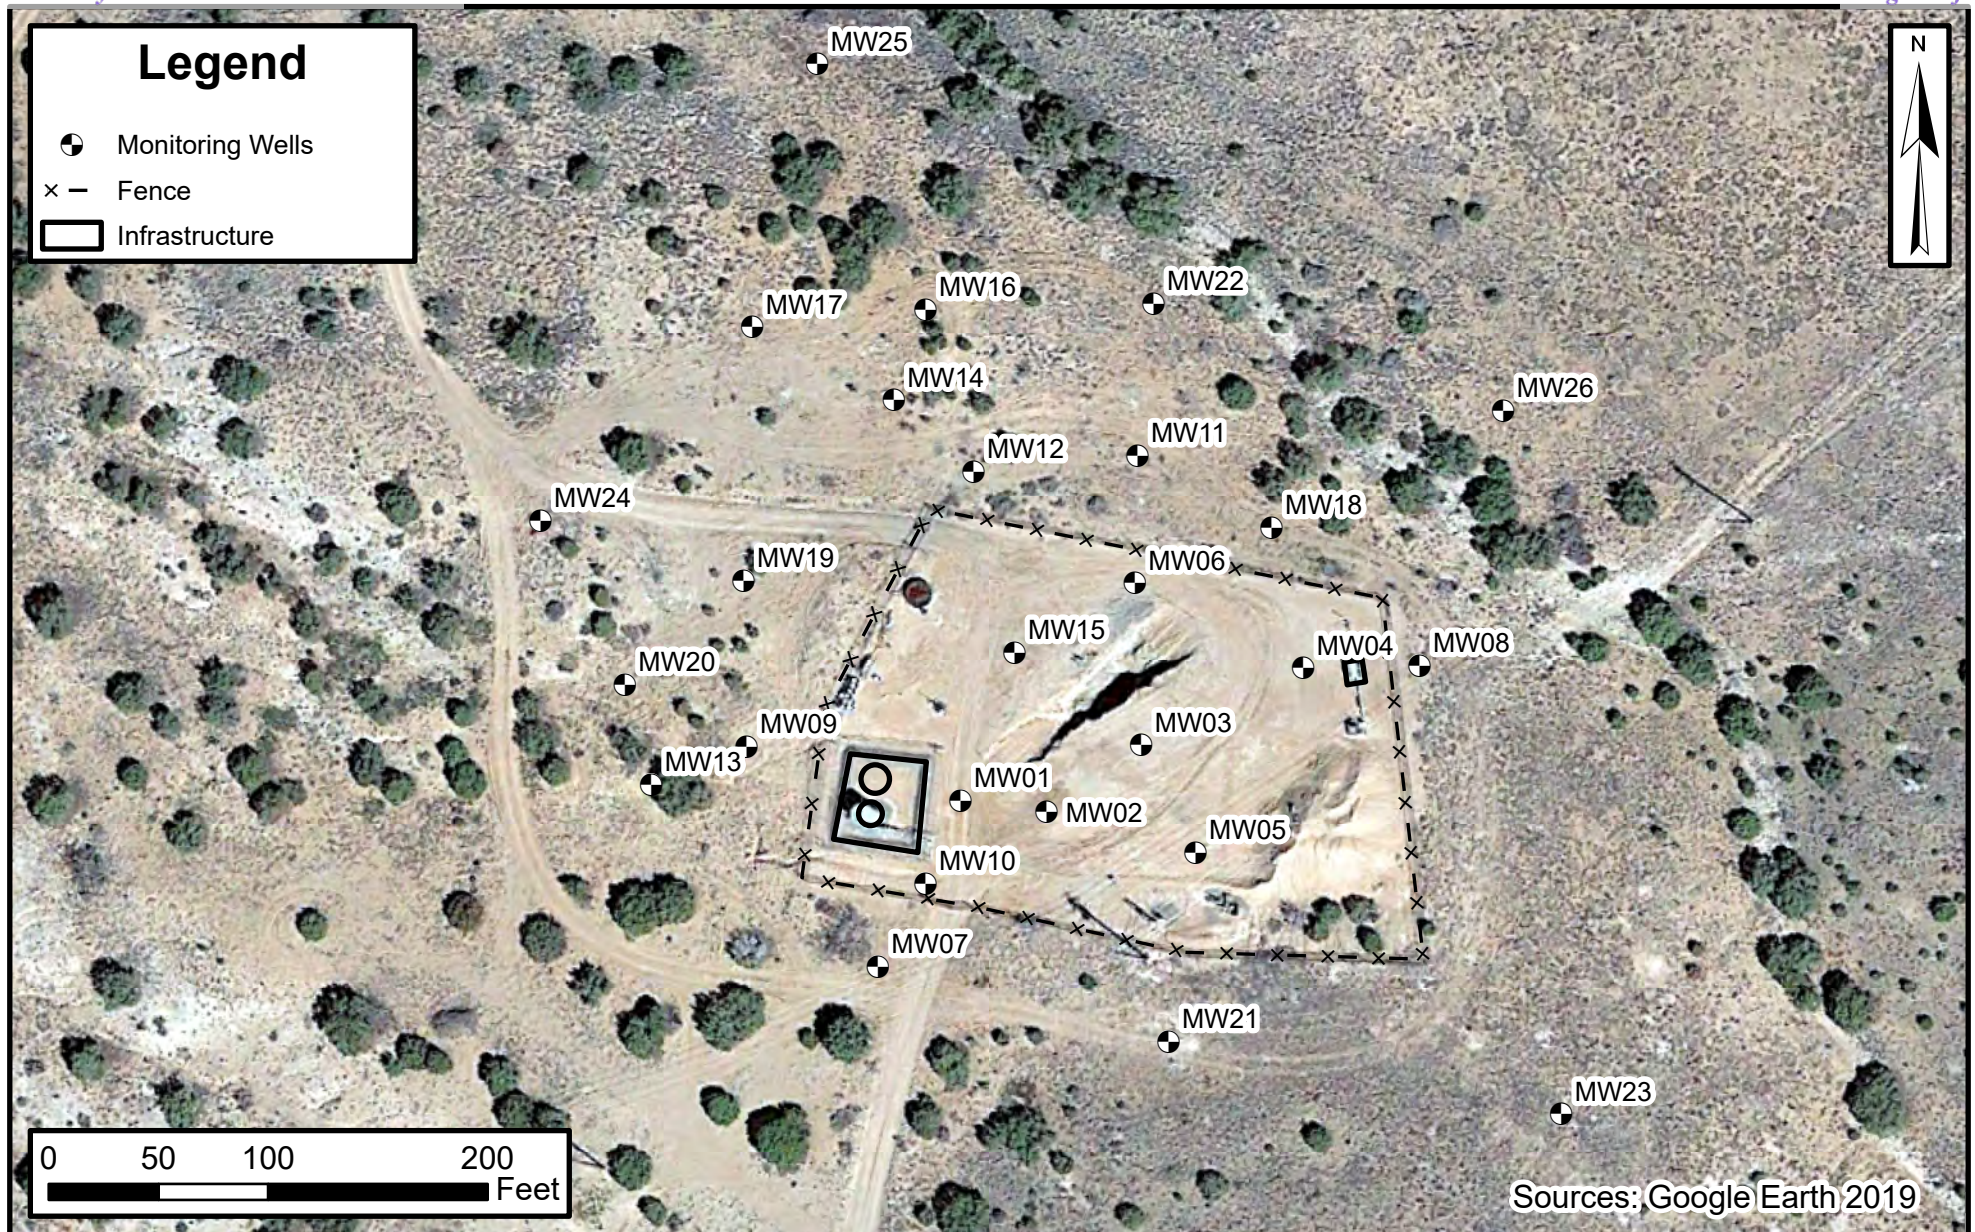



Site Features

Standard #1
Hilcorp Energy Company

36.75285, -108.099744
San Juan County, New Mexico

FIGURE
2

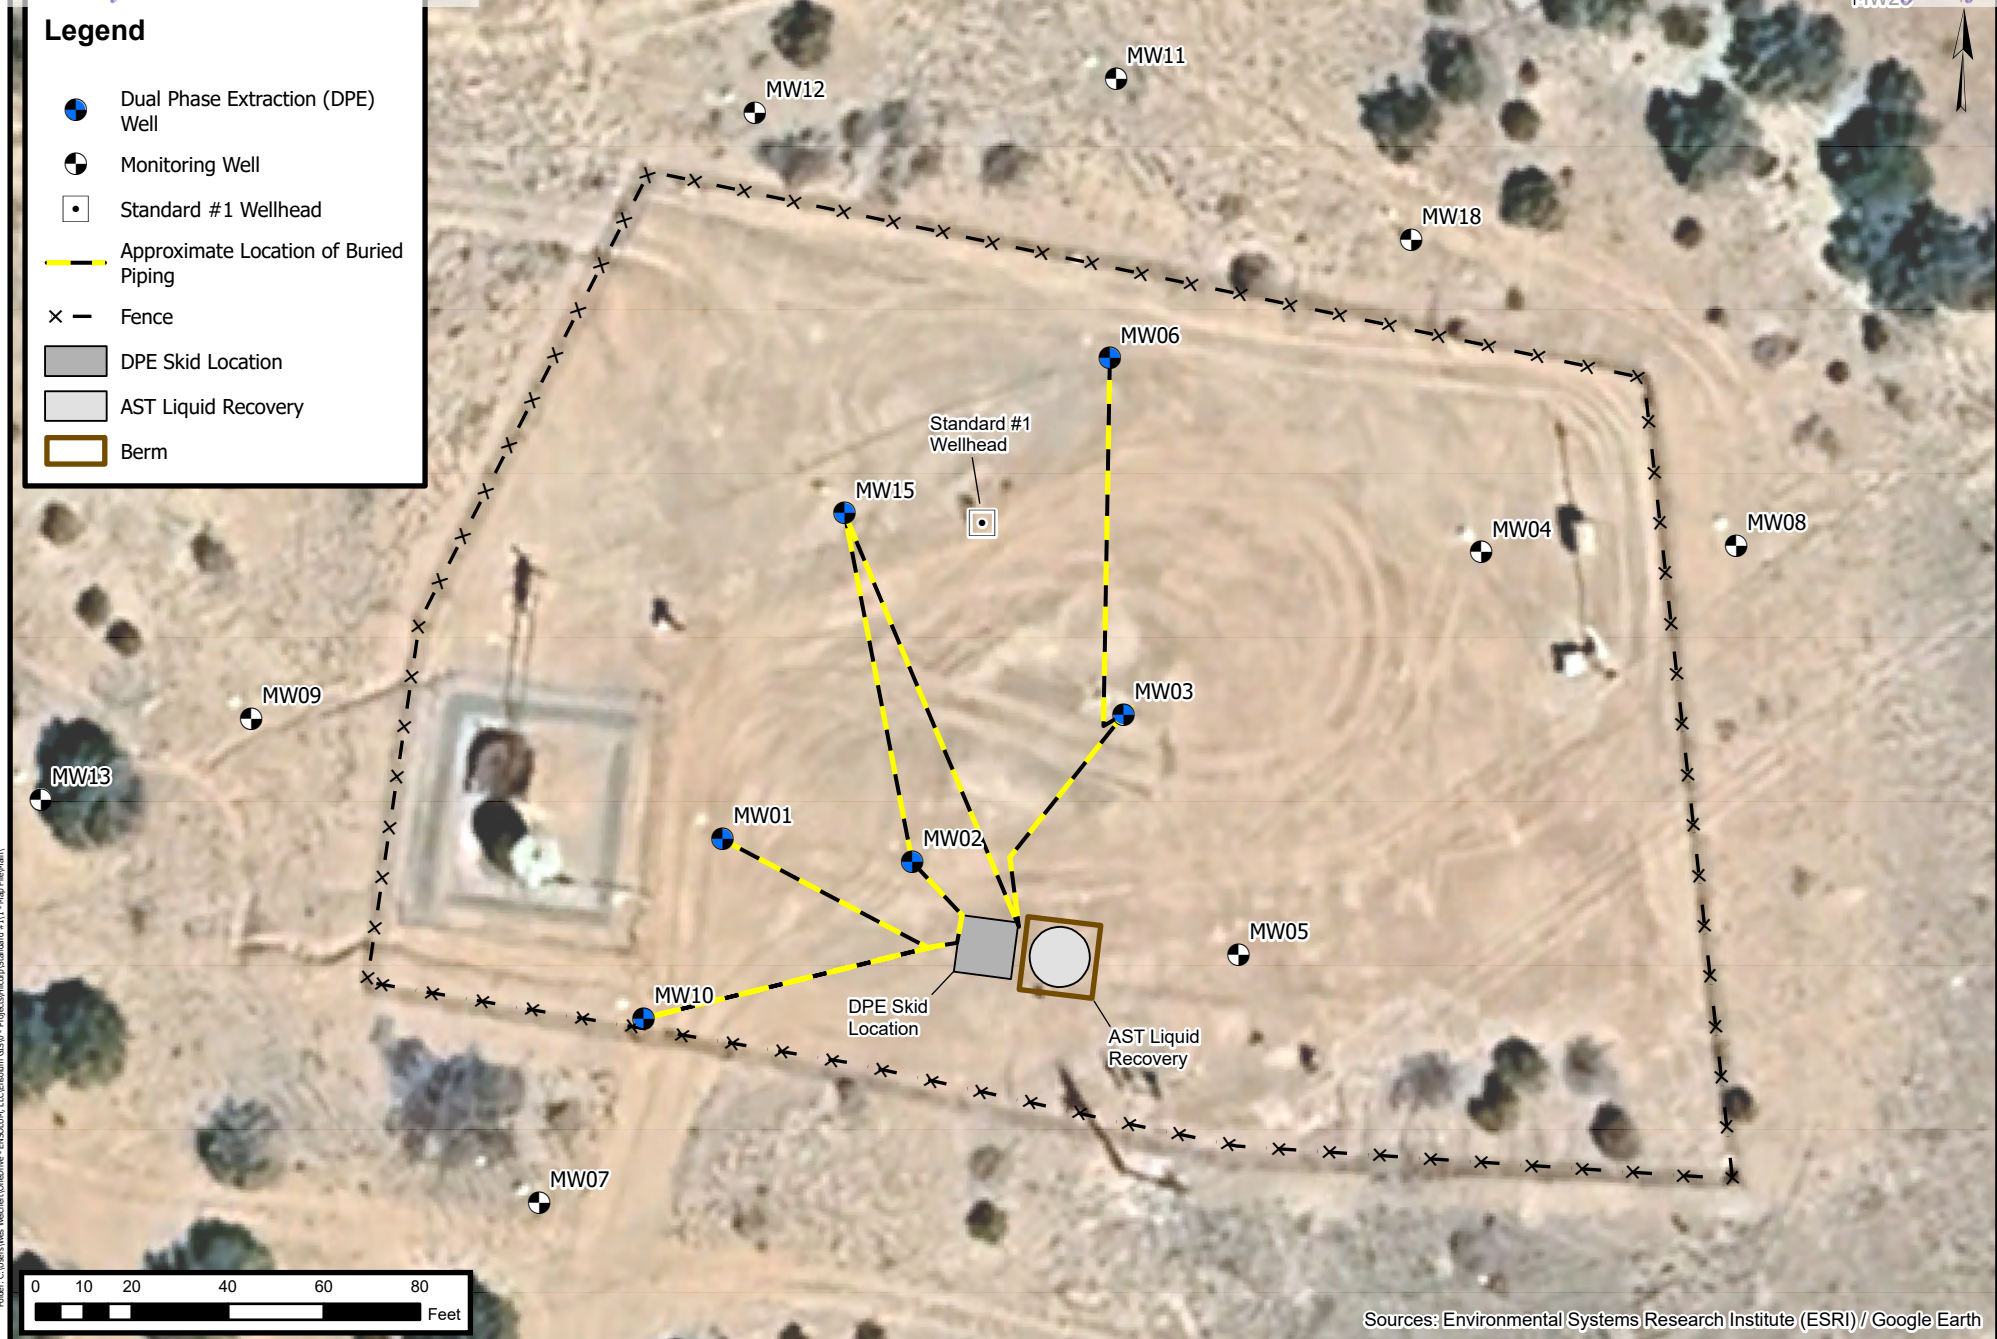

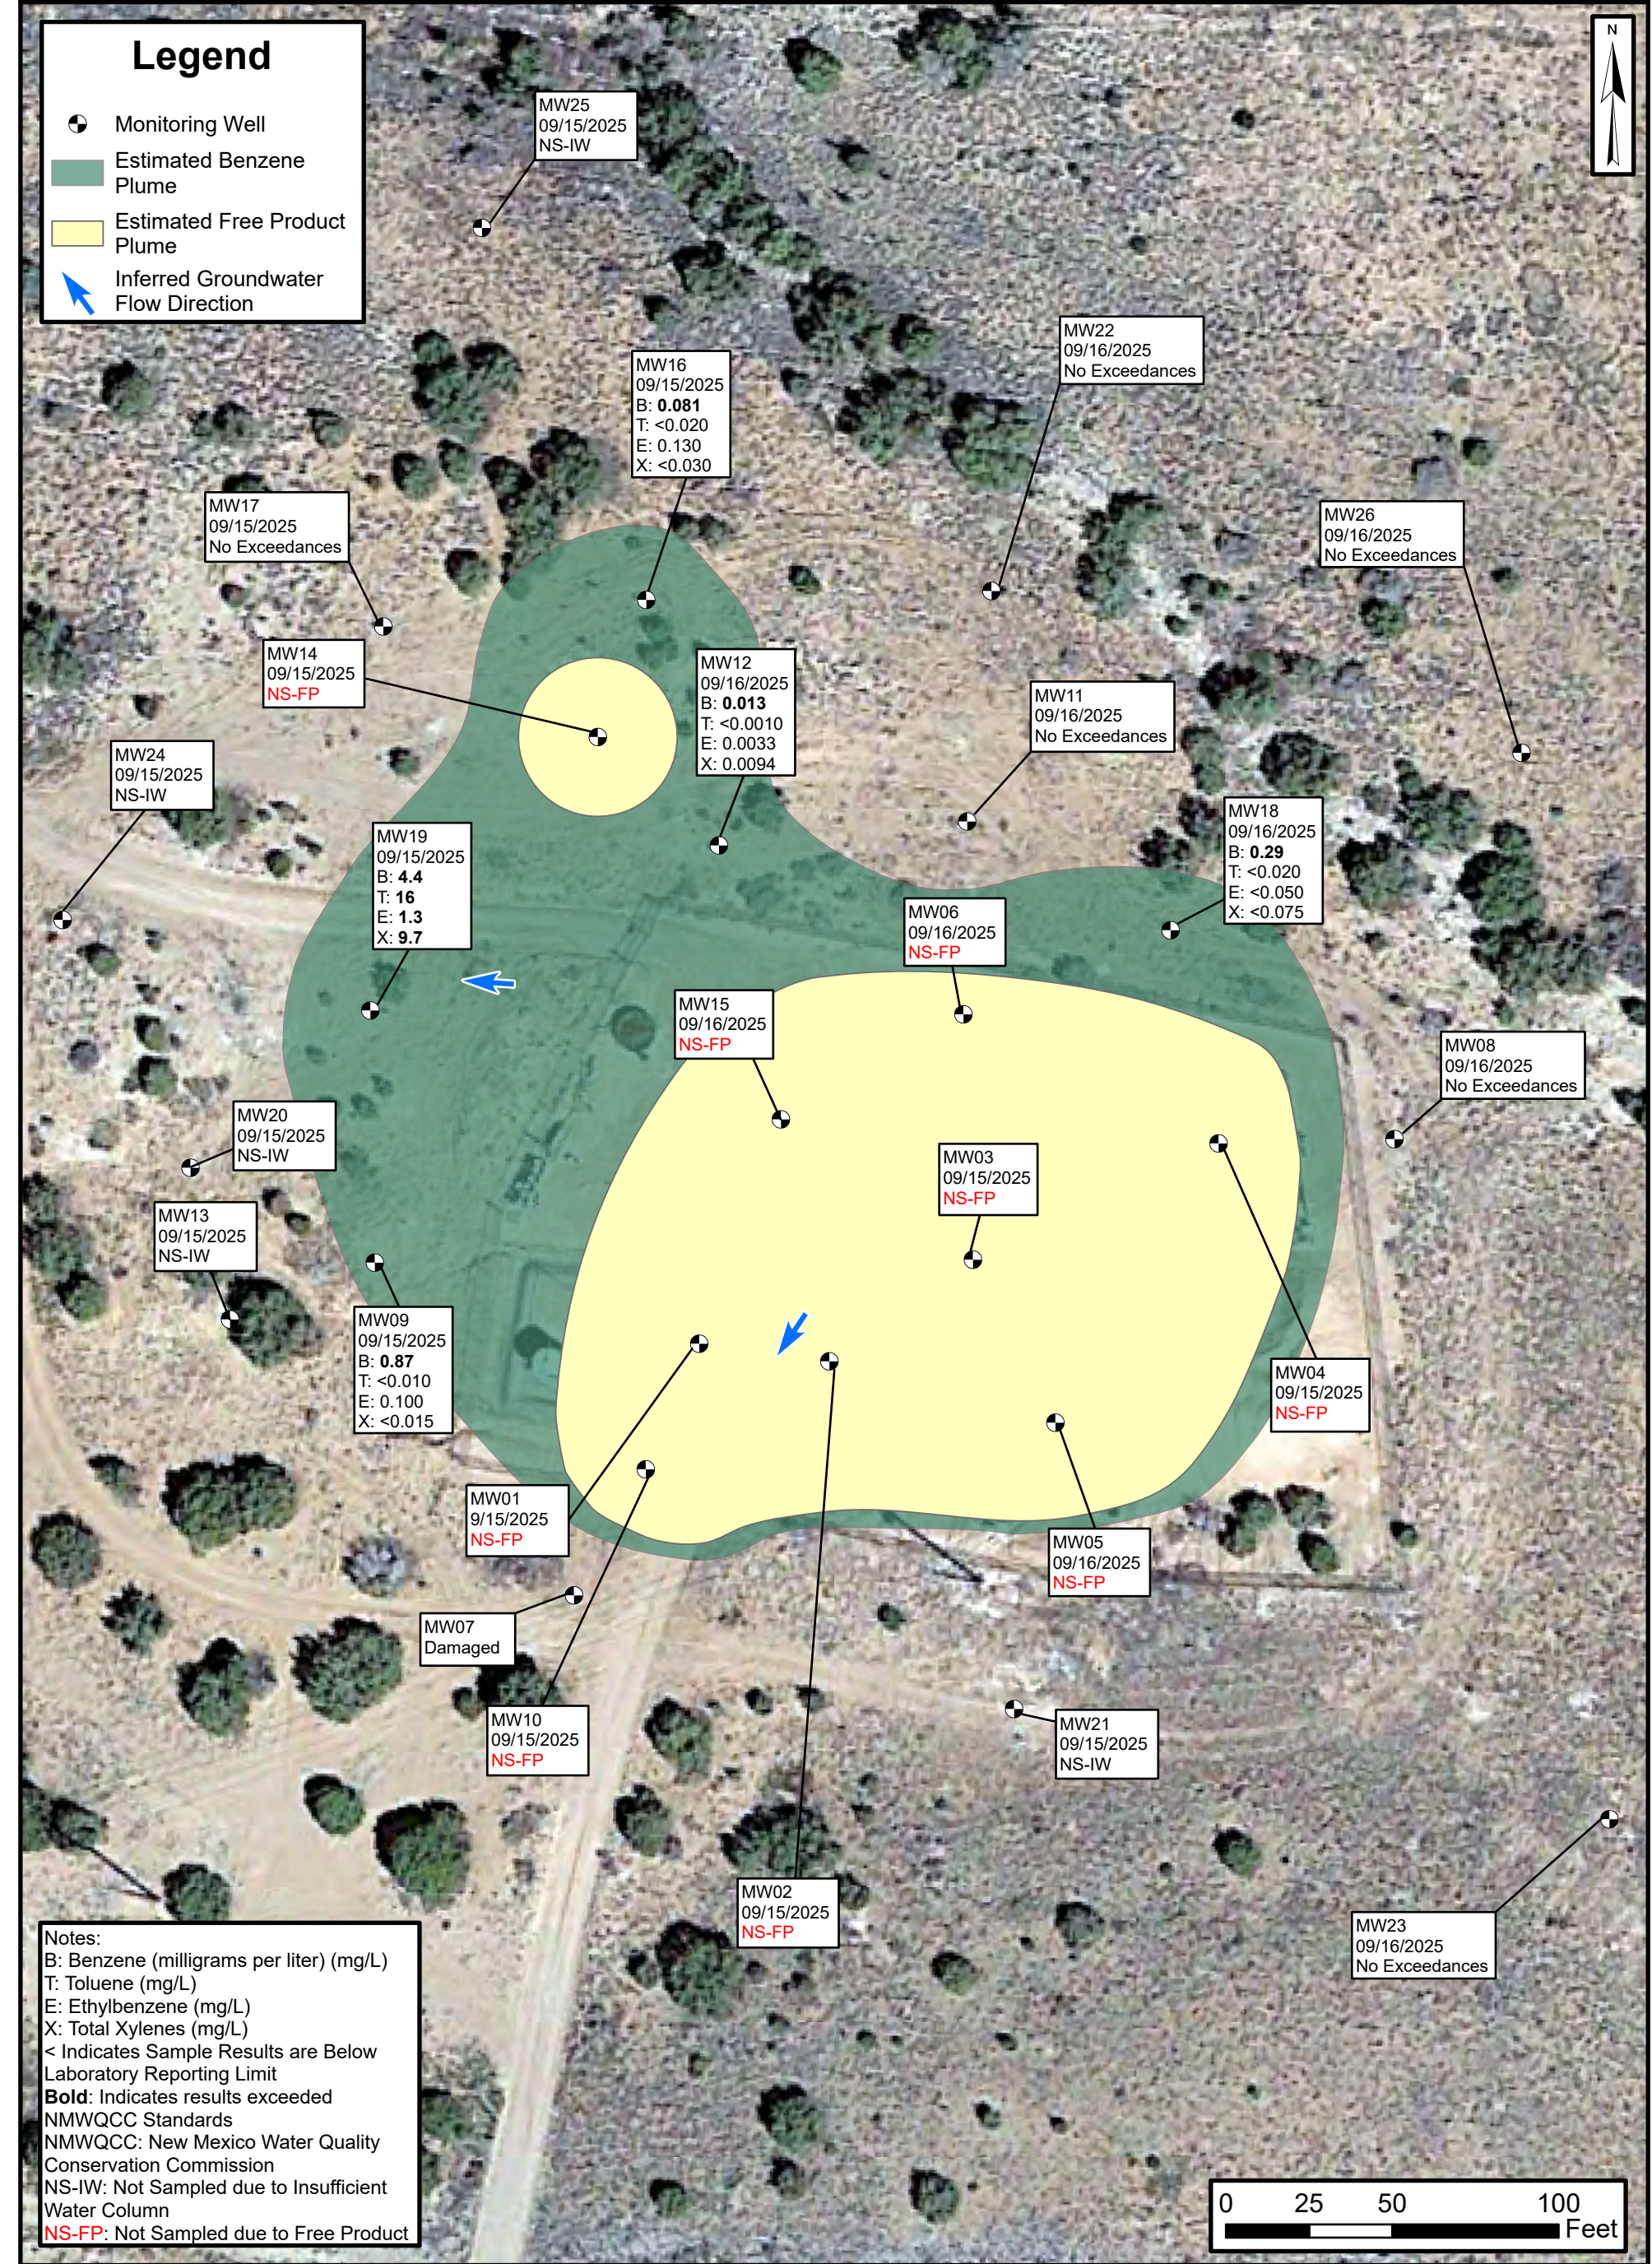


Groundwater Analytical Results - Q3 2025



Standard #1
Hilcorp Energy Company
36.75285, -108.099744
San Juan County, New Mexico

FIGURE
4

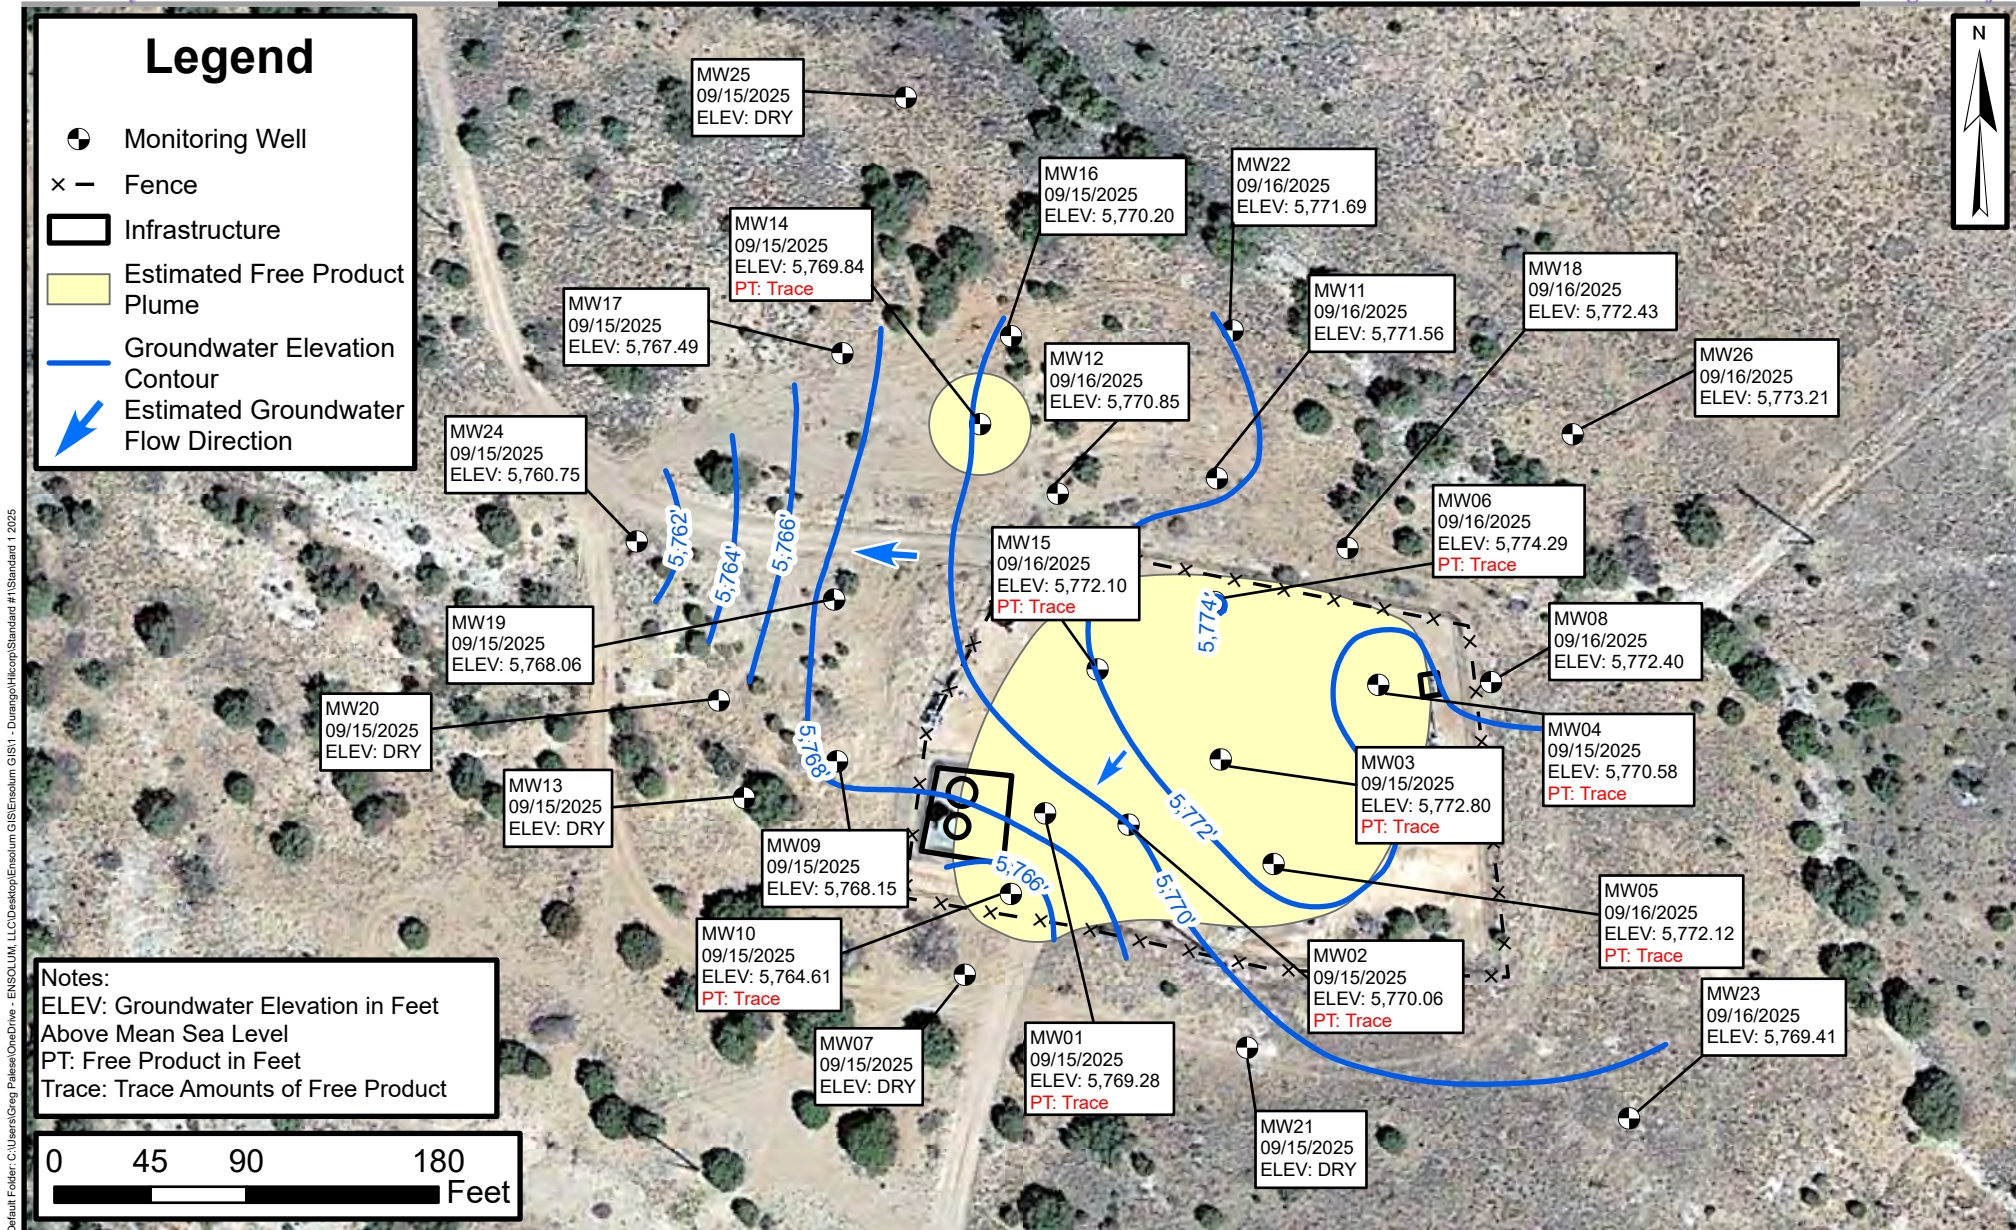

Groundwater Elevation Map - Q3 2025



Standard #1
 Hilcorp Energy Company
 36.75285, -108.099744
 San Juan County, New Mexico

FIGURE
5



Tables & Graphs



TABLE 1 DUAL PHASE EXTRACTION SYSTEM RUNTIME CALCULATIONS Standard #1 Hilcorp Energy Company San Juan County, New Mexico				
Date/Time of Reading	System Hour Runtime	Runtime Between Events	Run Time (%)	Cumulative Run Time (%)
1/2/2024	4	4	START UP	
6/27/2025	11,682	183	76%	90%
7/8/2025	11,822	140	53%	89%
7/29/2025	12,321	499	99%	89%
8/11/2025	12,629	308	99%	90%
8/26/2025	12,988	359	100%	90%
9/9/2025	13,324	336	100%	90%
9/29/2025	13,660	336	70%	89%
3rd Qtr 2025 Run Time Hours				1,977
3rd Qtr 2025 Run Time %				88%

Notes:

%: percent

Dashed line indicates quarter change

--: not applicable/not collected



TABLE 2
DUAL PHASE EXTRACTION SYSTEM FIELD MEASUREMENTS

Standard #1
Hilcorp Energy Company
San Juan County, New Mexico

SVE Well ID	Date	PID (ppm)	Differential Pressure (IWC)	Flow Rate (acfm)	Flow Rate (scfm) ⁽¹⁾	Vacuum (IHG)	Vacuum (psi)	Oxygen (%)	Carbon Dioxide (%)
Influent, All Wells	1/2/2024	198	4.50	742	534	2.5	1.23	20.9	0.06
	1/3/2024	69	4.50	742	534	2.5	1.23	20.9	0.02
	1/4/2024	467	2.50	553	398	2.5	1.23	16.6	4.99
	1/5/2024	416	2.50	553	216	15.0	7.37	19.8	1.34
	1/11/2024	993	1.75	463	187	14.5	7.12	--	--
	1/18/2024	234	2.00	495	220	13.0	6.39	--	--
	1/24/2024	521	2.50	553	260	12.0	5.89	--	--
	2/1/2024	397	3.25	630	379	7.0	3.44	--	--
	2/8/2024	350	3.00	606	348	8.0	3.93	--	--
	2/15/2024	401	3.00	606	340	8.5	4.17	--	--
	2/21/2024	400	3.00	606	340	8.5	4.17	20.0	0.38
	3/1/2024	662	2.25	525	267	10.5	5.16	--	--
	3/7/2024	525	2.25	525	271	10.3	5.03	20.9	0.30
	3/14/2024	763	2.50	553	282	10.5	5.16	20.9	0.28
	3/21/2024	568	2.50	553	282	10.5	5.16	--	--
	4/1/2024	517	2.50	553	282	10.5	5.16	--	--
	4/5/2024	547	2.50	553	289	10.0	4.91	20.0	0.16
	4/19/2024	364	2.25	525	292	8.7	4.27	20.6	0.14
	5/7/2024	337	2.25	525	247	12.0	5.89	20.7	0.15
	5/21/2024	284	2.25	525	240	12.5	6.14	20.9	0.11
	6/6/2024	247	2.25	525	233	13.0	6.39	20.7	0.13
	6/27/2024	369	2.25	525	226	13.5	6.63	20.7	0.13
	7/17/2024	148	3.25	630	305	11.5	5.65	20.8	0.12
	7/29/2024	190	3.00	606	249	14.3	7.00	20.9	0.09
	8/12/2024	119	2.75	580	231	14.8	7.24	20.9	0.10
	8/23/2024	122	1.75	463	181	15.0	7.37	20.9	0.13
	9/5/2024	156	1.75	463	169	16.0	7.86	20.9	0.11
	9/23/2024	121	1.50	428	151	16.5	8.10	20.9	0.13
	10/10/2024	101	1.50	428	148	16.8	8.23	20.5	0.13
	10/24/2024	114	1.00	350	121	16.8	8.23	20.9	0.14
	11/11/2024	74	1.50	428	168	15.0	7.37	20.9	0.14
	11/20/2024	79	1.50	428	162	15.5	7.61	20.9	0.08
	12/10/2024	72	2.75	580	296	10.5	5.16	20.9	0.12
	12/19/2024	73	2.50	553	282	10.5	5.16	--	--
	1/13/2025	108	2.50	553	286	10.2	5.01	20.9	0.12
	1/23/2025	92	2.50	553	283	10.4	5.11	20.9	0.06
	2/7/2025	32	1.00	350	109	18.0	8.84	--	--
	2/24/2025	59	1.00	350	107	18.3	8.96	--	--
	3/10/2025	49	2.00	495	216	13.3	6.51	--	--
	3/29/2025	35	0.75	303	85	19.3	9.45	20.7	0.20
	4/16/2025	37	1.00	350	96	19.5	9.58	20.9	0.20
	4/24/2025	--	--	--	--	--	--	--	--
	5/29/2025	23	1.20	383	120	18.0	8.84	20.9	0.09
	6/17/2025	19	1.00	350	103	18.8	9.21	20.8	0.11
	6/27/2025	--	--	--	--	--	--	--	--
	7/8/2025	7	1.00	350	96	19.5	9.58	20.7	0.20
	7/29/2025	--	--	--	--	--	--	--	--
	8/11/2025	7	0.25	175	62	16.5	8.10	20.9	0.09
	8/26/2025	8	0.00	0	0	16.8	8.23	20.9	0.05
	9/9/2025	5	0.00	0	0	16.5	8.10	20.9	0.06
	9/29/2025	5	0.50	247	90	16.0	7.86	20.9	0.00
MW01	1/2/2024	102	--	--	44.0	1.0	0.49	20.9	0.08
	1/3/2024	87	--	--	14.0	1.0	0.49	20.9	0.04
	1/4/2024	--	--	--	93.0	13.5	6.63	--	--
	1/5/2024	403	--	--	53.0	13.0	6.39	20.7	0.58
	1/11/2024	135	0.95	85.2	42.3	11.0	5.40	--	--
	1/18/2024	655	0.08	24.7	11.6	12.0	5.89	--	--
	1/24/2024	1394	0.55	64.8	32.2	11.0	5.40	20.2	0.52
	2/1/2024	468	0.54	64.2	41.2	5.5	2.70	--	--
	2/8/2024	436	--	--	--	7.0	3.44	19.8	0.78
	2/15/2024	413	0.20	39.1	23.5	7.0	3.44	19.8	0.44
	2/21/2024	543	0.20	39.1	23.5	7.0	3.44	20.0	0.40
	3/1/2024	353	0.28	46.3	25.4	9.0	4.42	20.5	0.44
	3/7/2024	431	0.51	62.4	34.3	9.0	4.42	20.9	0.36
	3/14/2024	409	0.19	38.1	20.9	9.0	4.42	20.9	0.38
	3/21/2024	398	0.49	61.2	33.6	9.0	4.42	20.9	0.36
	4/1/2024	523	0.61	68.3	38.4	8.5	4.17	--	--
	4/5/2024	496	0.42	56.7	31.8	8.5	4.17	19.8	0.28
	4/19/2024	450	0.31	48.7	27.7	8.3	4.05	19.4	0.32



TABLE 2
DUAL PHASE EXTRACTION SYSTEM FIELD MEASUREMENTS

Standard #1
Hilcorp Energy Company
San Juan County, New Mexico

SVE Well ID	Date	PID (ppm)	Differential Pressure (IWC)	Flow Rate (acfm)	Flow Rate (scfm) ⁽¹⁾	Vacuum (IHG)	Vacuum (psi)	Oxygen (%)	Carbon Dioxide (%)
MW01	5/7/2024	611	0.64	69.9	43.2	6.4	3.14	19.5	0.34
	5/21/2024	645	0.77	76.7	42.6	8.8	4.30	19.5	0.31
	6/6/2024	387	1.83	118.3	68.8	7.8	3.81	19.8	0.30
	6/27/2024	604	--	--	--	8.0	3.93	19.5	0.28
	7/17/2024	276	0.37	53.2	30.9	7.8	3.81	19.7	0.25
	7/29/2024	286	2.07	125.8	72.3	8.0	3.93	20.2	0.23
	8/12/2024	274	1.83	118.3	68.0	8.0	3.93	20.2	0.23
	8/23/2024	141	1.27	98.5	56.7	8.0	3.93	20.5	0.16
	9/6/2024	206	2.93	149.7	85.1	8.3	4.05	20.3	0.18
	9/23/2024	159	1.31	100.1	57.5	8.0	3.93	20.6	0.19
	10/10/2024	187	0.51	62.4	40.4	5.3	2.58	19.7	0.23
	10/24/2024	150	0.72	74.2	46.1	6.3	3.07	20.5	0.15
	11/11/2024	201	0.62	68.8	32.4	12.0	5.89	20.9	0.25
	11/20/2024	163	0.67	71.6	33.6	12.0	5.89	20.9	0.14
	12/10/2024	197	0.66	71.0	33.4	12.0	5.89	20.9	0.19
	12/19/2024	38	Gauge Broken	--	--	7.5	3.68	--	--
	1/13/2025	29	Gauge Broken	--	--	7.0	3.44	20.2	0.48
	1/23/2025	44	Gauge Broken	--	--	5.5	2.70	20.9	0.00
	2/7/2025	--	Gauge Broken	--	--	13.5	6.63	--	--
	2/24/2025	--	Gauge Broken	--	--	14.0	6.88	--	--
	3/10/2025	--	Gauge Broken	--	--	9.0	4.42	--	--
	3/29/2025	Line Clogged							
	4/16/2025	Line Clogged							
	4/24/2025	--	--	--	--	--	--	--	--
	5/29/2025	55	Gauge Broken	--	--	12.5	6.14	20.5	0.22
	6/17/2025	115	Gauge Broken	--	--	11.5	5.65	20.6	0.24
	6/27/2025	--	--	--	--	--	--	--	--
	7/8/2025	5	0.43	57.3	33.3	7.8	3.81	20.9	0.12
	7/29/2025	--	--	--	--	--	--	--	--
	8/11/2025	5	2.74	144.7	93.7	5.3	2.58	20.5	0.08
	8/26/2025	12	1.24	97.4	72.6	1.5	0.74	20.9	0.02
	9/9/2025	6	1.08	90.9	67.1	1.8	0.86	20.9	0.05
	9/29/2025	4	1.27	99	46.8	11.8	5.80	20.9	0.00
MW02	1/2/2024	102	--	--	20.0	1.0	0.49	20.9	0.02
	1/3/2024	240	--	--	25.0	1.0	0.49	20.9	0.06
	1/4/2024	--	--	--	86.0	13.5	6.63	--	--
	1/5/2024	243	--	--	84.0	12.5	6.14	20.6	0.82
	1/11/2024	392	0.80	78.2	38.8	11.0	5.40	--	--
	1/18/2024	335	1.05	89.6	42.1	12.0	5.89	--	--
	1/24/2024	710	0.75	75.7	38.6	10.5	5.16	20.7	0.52
	2/1/2024	179	0.15	33.9	21.2	6.0	2.95	--	--
	2/8/2024	380	--	--	--	7.3	3.56	20.7	0.54
	2/15/2024	232	0.21	40.1	23.6	7.5	3.68	20.3	0.32
	2/21/2024	175	0.15	33.9	20.4	7.0	3.44	20.6	0.18
	3/1/2024	315	0.56	65.4	35.9	9.0	4.42	20.9	0.36
	3/7/2024	396	0.64	69.9	38.4	9.0	4.42	20.9	0.24
	3/14/2024	412	0.64	69.9	38.4	9.0	4.42	20.9	0.20
	3/21/2024	408	0.61	68.3	37.5	9.0	4.42	20.9	0.18
	4/1/2024	257	0.13	31.5	17.3	9.0	4.42	--	--
	4/5/2024	294	0.55	64.8	35.6	9.0	4.42	20.1	0.16
	4/19/2024	249	0.37	53.2	29.9	8.5	4.17	20.2	0.17
	5/7/2024	193	0.25	43.7	24.6	8.5	4.17	20.3	0.14
	5/21/2024	193	0.54	64.2	36.1	8.5	4.17	20.4	0.16
	6/6/2024	173	0.44	58.0	31.1	9.5	4.67	20.3	0.19
	6/27/2024	321	0.40	55.3	28.9	10.0	4.91	20.1	0.17
	7/17/2024	118	0.13	31.5	16.3	10.3	5.03	20.9	0.15
	7/29/2024	88	0.46	59.3	30.6	10.3	5.03	20.9	0.10
	8/12/2024	110	0.16	35.0	18.0	10.3	5.03	20.9	0.13
	8/23/2024	47	0.08	24.7	12.3	11.0	5.40	20.9	0.06
	9/6/2024	128	Gauge Broken	--	--	11.3	5.53	20.8	0.07
	9/23/2024	78	0.11	29.0	14.8	10.5	5.16	20.7	0.20
	10/10/2024	79	Gauge Broken	--	--	10.8	5.28	20.6	0.16
	10/24/2024	82	Gauge Broken	--	--	15.3	7.49	20.6	0.12
	11/11/2024	66	Gauge Broken	--	--	13.0	6.39	20.9	0.18
	11/20/2024	83	0.38	53.9	23.9	13.0	6.39	20.9	0.10
	12/10/2024	84	0.12	30.3	13.4	13.0	6.39	20.9	0.16
	12/19/2024	74	Gauge Broken	--	--	8.0	3.93	--	--
	1/13/2025	63	Gauge Broken	--	--	8.5	4.17	20.9	0.12
	1/23/2025	61	0.43	57.3	32.2	8.5	4.17	20.9	0.10



TABLE 2
DUAL PHASE EXTRACTION SYSTEM FIELD MEASUREMENTS

Standard #1
Hilcorp Energy Company
San Juan County, New Mexico

SVE Well ID	Date	PID (ppm)	Differential Pressure (IWC)	Flow Rate (acfm)	Flow Rate (scfm) ⁽¹⁾	Vacuum (IHG)	Vacuum (psi)	Oxygen (%)	Carbon Dioxide (%)
MW02	2/7/2025	--	Gauge Broken	--	--	13.5	6.63	--	--
	2/24/2025	--	Gauge Broken	--	--	15.8	7.74	--	--
	3/10/2025	--	0.41	56.0	32.2	8.0	3.93	--	--
	3/29/2025	29	Gauge Broken	--	--	17.5	8.60	20.2	0.20
	4/16/2025	35	Gauge Broken	--	--	17.5	8.60	20.9	0.00
	4/24/2025	--	--	--	--	--	--	--	--
	5/29/2025	19	Gauge Broken	--	--	16.0	7.86	20.2	0.23
	6/17/2025	21	Gauge Broken	--	--	15.3	7.49	20.4	0.22
	6/27/2025	--	--	--	--	--	--	--	--
	7/8/2025	16	Gauge Broken	--	--	11.8	5.77	20.9	0.10
	7/29/2025	--	--	--	--	--	--	--	--
	8/11/2025	--	0.04	17.5	9.1	10.0	4.91	--	--
	8/26/2025	--	0.10	27.6	19.0	3.8	1.84	--	--
	9/9/2025	--	0.05	19.5	13.3	4.0	1.96	--	--
	9/29/2025	3	0.03	15.1	8.7	8.1	3.96	16.8	>1.0
MW03	1/2/2024	139	--	--	45.0	1.0	0.49	20.9	0.14
	1/3/2024	240	--	--	25.0	1.0	0.49	20.9	0.06
	1/4/2024	--	--	--	37.0	13.0	6.39	--	--
	1/5/2024	332	--	--	18.0	12.0	5.89	18.9	1.56
	1/11/2024	187	1.30	99.7	44.3	13.0	6.39	--	--
	1/18/2024	452	1.11	92.1	36.1	15.0	7.37	--	--
	1/24/2024	1775	0.62	68.8	30.6	13.0	6.39	19.2	1.26
	2/1/2024	644	0.24	42.8	24.1	8.5	4.17	--	--
	2/8/2024	325	--	--	--	9.5	4.67	19.0	1.30
	2/15/2024	235	0.23	41.9	21.9	10.0	4.91	20.3	0.28
	2/21/2024	498	--	--	--	--	--	19.1	0.72
	3/1/2024	404	0.13	31.5	14.8	12.0	5.89	19.7	1.04
	3/7/2024	721	0.41	56.0	27.1	11.5	5.65	20.2	0.66
	3/14/2024	687	0.35	51.7	25.0	11.5	5.65	20.4	0.44
	3/21/2024	627	0.36	52.5	25.4	11.5	5.65	20.3	0.45
	4/1/2024	433	0.45	58.6	28.3	11.5	5.65	--	--
	4/5/2024	511	0.71	73.7	36.6	11.0	5.40	19.3	0.39
	4/19/2024	433	0.23	41.9	20.8	11.0	5.40	19.4	0.38
	5/7/2024	671	0.65	70.5	39.6	8.5	4.17	19.9	0.34
	5/21/2024	444	0.28	46.3	25.1	9.3	4.54	19.6	0.35
	6/6/2024	438	0.43	57.3	31.1	9.3	4.54	19.4	0.36
	6/27/2024	420	0.18	37.1	19.4	10.0	4.91	19.5	0.38
	7/17/2024	439	0.54	64.2	34.8	9.3	4.54	19.6	0.32
	7/29/2024	398	0.85	80.6	43.7	9.3	4.54	20.2	0.26
	8/12/2024	413	0.66	71.0	38.5	9.3	4.54	20.1	0.28
	8/23/2024	364	2.33	133.5	75.0	8.5	4.17	19.7	0.40
	9/6/2024	457	0.12	30.3	16.8	8.8	4.30	20.2	0.30
	9/23/2024	381	0.83	79.7	43.7	9.0	4.42	19.8	0.39
	10/10/2024	392	0.22	41.0	21.4	10.0	4.91	20.1	0.30
	10/24/2024	363	0.14	32.7	15.6	11.8	5.77	20.0	0.30
	11/11/2024	117	0.17	36.0	15.3	13.8	6.75	20.9	0.26
	11/20/2024	157	0.04	17.5	7.4	13.8	6.75	20.9	0.18
	12/10/2024	123	0.11	29.0	12.5	13.5	6.63	20.9	0.14
	12/19/2024	25	0.07	23.1	13.6	7.5	3.68	--	--
	1/13/2025	21	0.07	23.1	13.3	8.0	3.93	20.9	0.00
	1/23/2025	34	0.10	27.6	15.5	8.5	4.17	20.9	0.00
	2/7/2025	--	0.10	27.6	11.2	14.5	7.12	--	--
	2/24/2025	--	0.08	24.7	9.4	15.5	7.61	--	--
	3/10/2025	--	0.13	31.5	17.3	9.0	4.42	--	--
	3/29/2025	126	0.08	24.7	8.1	17.5	8.60	20.5	0.20
	4/16/2025	107	0.05	19.5	11.2	8.0	3.93	20.9	0.00
	4/24/2025	--	--	--	--	--	--	--	--
	5/29/2025	26	0.06	21.4	9.5	13.0	6.39	20.9	0.10
	6/17/2025	34	0.03	15.1	7.4	11.3	5.53	20.9	0.08
	6/27/2025	--	--	--	--	--	--	--	--
	7/8/2025	33	0.05	19.5	11.1	8.3	4.05	20.9	0.06
	7/29/2025	--	--	--	--	--	--	--	--
	8/11/2025	--	0.00	0.0	0.0	0.0	0.00	--	--
	8/26/2025	--	0.00	0.0	0.0	1.0	0.49	--	--
	9/9/2025	--	0.00	0.0	0.0	0.5	0.25	--	--
	9/29/2025	4	Gauge Broken	--	--	12.0	5.89	20.9	0.01



TABLE 2
DUAL PHASE EXTRACTION SYSTEM FIELD MEASUREMENTS

Standard #1
Hilcorp Energy Company
San Juan County, New Mexico

SVE Well ID	Date	PID (ppm)	Differential Pressure (IWC)	Flow Rate (acfm)	Flow Rate (scfm) ⁽¹⁾	Vacuum (IHG)	Vacuum (psi)	Oxygen (%)	Carbon Dioxide (%)
MW06	1/2/2024	153	--	--	48.0	1.0	0.49	20.9	0.14
	1/3/2024	161	--	--	23.0	1.0	0.49	20.9	0.04
	1/4/2024	--	--	--	48.0	12.0	5.89	--	--
	1/5/2024	295	--	--	26.0	11.5	5.65	19.1	1.41
	1/11/2024	323	1.18	95.0	47.1	11.0	5.40	--	--
	1/18/2024	35	1.12	92.5	42.3	12.5	6.14	--	--
	1/24/2024	439	0.40	55.3	28.2	10.5	5.16	20.9	0.56
	2/1/2024	245	0.17	36.0	23.1	5.5	2.70	--	--
	2/8/2024	220	--	--	--	7.0	3.44	20.9	0.42
	2/15/2024	120	0.15	33.9	20.4	7.0	3.44	20.9	0.12
	2/21/2024	319	0.22	41.0	24.4	7.2	3.54	20.6	0.20
	3/1/2024	121	0.04	17.5	9.6	9.0	4.42	20.9	0.24
	3/7/2024	314	0.65	70.5	38.7	9.0	4.42	20.9	0.16
	3/14/2024	402	0.30	47.9	26.3	9.0	4.42	20.9	0.20
	3/21/2024	372	0.27	45.4	25.5	8.5	4.17	20.9	0.15
	4/1/2024	134	0.04	17.5	9.6	9.0	4.42	--	--
	4/5/2024	202	0.82	79.2	44.5	8.5	4.17	20.2	0.10
	4/19/2024	154	0.34	51.0	28.7	8.5	4.17	20.2	0.12
	5/7/2024	145	0.18	37.1	20.4	9.0	4.42	20.8	0.12
	5/21/2024	139	0.46	59.3	32.9	8.8	4.30	20.3	0.11
	6/6/2024	152	0.84	80.1	45.6	8.3	4.05	20.3	0.12
	6/27/2024	129	--	--	--	8.0	3.93	20.3	0.12
	7/17/2024	51	0.01	8.7	5.0	8.0	3.93	20.4	0.10
	7/29/2024	54	0.63	69.4	39.9	8.0	3.93	20.7	0.10
	8/8/2024	56	0.43	57.3	33.0	8.0	3.93	20.6	0.10
	8/23/2024	34	0.12	30.3	17.6	7.8	3.81	20.7	0.09
	9/6/2024	49	0.03	15.1	8.8	7.8	3.81	20.6	0.10
	9/23/2024	36	0.31	48.7	28.0	8.0	3.93	20.8	0.10
	10/10/2024	36	0.04	17.5	9.9	8.3	4.05	20.7	0.14
	10/24/2024	36	0.06	21.4	11.9	8.8	4.30	20.1	0.27
	11/11/2024	66	0.04	17.5	7.5	13.5	6.63	20.9	0.20
	11/20/2024	62	0.04	17.5	7.5	13.5	6.63	20.9	0.16
	12/10/2024	70	0.19	38.1	16.4	13.5	6.63	20.9	0.16
	12/19/2024	25	0.25	43.7	24.0	9.0	4.42	--	--
	1/13/2025	17	1.39	103.1	55.2	9.5	4.67	20.9	0.03
	1/23/2025	20	0.67	71.6	37.4	10.0	4.91	20.9	0.02
	2/7/2025	--	0.41	56.0	19.7	16.5	8.10	--	--
	2/24/2025	--	0.53	63.6	22.4	16.5	8.10	--	--
	3/10/2025	--	0.42	56.7	27.8	11.3	5.53	--	--
	3/29/2025	14	0.78	77.2	23.7	18.3	8.96	19.2	0.70
	4/16/2025	15	0.27	45.4	14.2	18.0	8.84	20.8	0.20
	4/24/2025	--	--	--	--	--	--	--	--
	5/29/2025	7	0.46	59.3	22.4	15.5	7.61	20.5	0.03
	6/17/2025	6	0.18	37.1	14.3	15.3	7.49	20.6	0.05
	6/27/2025	--	--	--	--	--	--	--	--
	7/8/2025	2	0.07	23.1	11.5	11.0	5.40	20.7	0.05
	7/29/2025	--	--	--	--	--	--	--	--
	8/11/2025	--	0.00	0.0	0.0	2.0	0.98	--	--
	8/26/2025	--	0.00	0.0	0.0	4.3	2.09	--	--
	9/9/2025	--	0.00	0.0	0.0	4.0	1.96	--	--
	9/29/2025	4	0.61	68	33.5	11.2	5.51	20.9	0.10
MW10	1/2/2024	104	--	--	44.0	1.0	0.49	20.9	0.08
	1/3/2024	92	--	--	16.0	1.0	0.49	20.9	0.02
	1/4/2024	--	--	--	85.0	14.0	6.88	--	--
	1/5/2024	147	--	--	69.0	13.5	6.63	20.9	0.36
	1/11/2024	59	0.88	82	43.9	9.5	4.67	--	--
	1/18/2024	256	0.77	77	35.1	12.5	6.14	--	--
	1/24/2024	7	0.62	69	34.2	11.0	5.40	20.9	0.00
	2/1/2024	435	0.21	40	26.2	5.0	2.46	--	--
	2/8/2024	381	--	--	--	7.0	3.44	20.9	0.32
	2/15/2024	205	0.05	20	11.8	7.0	3.44	20.6	0.18
	2/21/2024	204	0.03	15	9.1	7.0	3.44	20.7	0.16
	3/1/2024	91	0.12	30	16.6	9.0	4.42	20.9	0.12
	3/7/2024	60	0.34	51	28.0	9.0	4.42	20.9	0.18
	3/14/2024	75	0.57	66	36.2	9.0	4.42	20.9	0.16
	3/21/2024	77	0.48	61	33.2	9.0	4.42	20.9	0.13
	4/1/2024	280	0.00	0	0.0	9.0	4.42	--	--
	4/5/2024	321	0.69	73	39.9	9.0	4.42	20.4	0.13
	4/19/2024	297	0.17	36	20.3	8.5	4.17	20.5	0.14



TABLE 2
DUAL PHASE EXTRACTION SYSTEM FIELD MEASUREMENTS

Standard #1
Hilcorp Energy Company
San Juan County, New Mexico

SVE Well ID	Date	PID (ppm)	Differential Pressure (IWC)	Flow Rate (acfm)	Flow Rate (scfm) ⁽¹⁾	Vacuum (IHG)	Vacuum (psi)	Oxygen (%)	Carbon Dioxide (%)
MW10	5/7/2024	242	0.12	30	17.0	8.5	4.17	20.6	0.13
	5/21/2024	234	0.06	21	12.0	8.5	4.17	20.7	0.13
	6/6/2024	196	0.04	17	9.5	9.3	4.54	20.8	0.16
	6/27/2024	302	0.22	41	21.4	10.0	4.91	20.8	0.15
	7/17/2024	66	--	--	--	10.3	5.03	20.9	0.11
	7/29/2024	61	--	--	--	10.3	5.03	20.9	0.10
	8/12/2024	61	0.56	65	33.8	10.3	5.03	20.9	0.11
	8/23/2024	51	0.89	82	40.4	11.3	5.53	20.9	0.08
	9/6/2024	80	Gauge Broken	--	--	11.0	5.40	20.9	0.08
	9/23/2024	50	0.87	82	41.6	10.5	5.16	20.8	0.14
	10/10/2024	49	Gauge Broken	--	--	8.5	4.17	20.7	0.13
	10/24/2024	28	Gauge Broken	--	--	5.3	2.58	20.6	0.13
	11/11/2024	19	Gauge Broken	--	--	12.0	5.89	20.9	0.12
	11/20/2024	38	2.77	146	66.5	12.5	6.14	20.9	0.08
	12/10/2024	24	0.15	34	15.5	12.5	6.14	20.9	0.09
	12/19/2024	44	0.21	40	24.1	7.0	3.44	--	--
	1/13/2025	40	0.32	49	28.8	7.8	3.81	20.9	0.07
	1/23/2025	60	0.22	41	23.6	8.0	3.93	20.9	0.07
	2/7/2025	--	0.65	70	38.7	9.0	4.42	--	--
	2/24/2025	--	Gauge Broken	--	--	10.0	4.91	--	--
	3/10/2025	--	Gauge Broken	--	--	9.5	4.67	--	--
	3/29/2025	18	0.02	12	5.4	13.3	6.51	20.2	0.20
	4/16/2025	23	0.01	9	3.4	15.0	7.37	20.9	0.00
	4/24/2025	--	--	--	--	--	--	--	--
	5/29/2025	20	0.01	9	3.0	16.8	8.23	20.9	0.09
	6/17/2025	15	0.03	15	5.1	17.0	8.35	20.9	0.08
	6/27/2025	--	--	--	--	--	--	--	--
	7/8/2025	9	0.02	12	5.7	12.5	6.14	20.9	0.01
	7/29/2025	--	--	--	--	--	--	--	--
	8/11/2025	6	0.01	9	4.4	10.8	5.28	20.7	0.11
	8/26/2025	54	0.03	15	10.7	3.0	1.47	20.9	0.14
	9/9/2025	41	0.02	12	8.6	3.5	1.72	20.9	0.10
	9/29/2025	3	2.32	133	63.3	11.8	5.80	20.2	0.16
MW15	1/2/2024	126	--	--	46.0	1.0	0.49	20.9	0.12
	1/3/2024	125	--	--	20.0	1.0	0.49	20.9	0.02
	1/4/2024	--	--	--	45.0	11.5	5.65	--	--
	1/5/2024	138	--	--	43.0	11.5	5.65	20.9	0.10
	1/11/2024				Frozen				
	1/18/2024	124	3.78	170.0	79.9	12.0	5.89	--	--
	1/24/2024	425	0.18	37.1	20.8	8.5	4.17	20.9	0.18
	2/1/2024	34	0.12	30.3	19.0	6.0	2.95	--	--
	2/8/2024	90	--	--	--	5.0	2.43	20.9	0.06
	2/15/2024	25	0.05	19.5	11.8	7.0	3.44	20.9	0.08
	2/21/2024	57	--	--	--	--	--	20.9	0.08
	3/1/2024	129	0.07	23.1	12.7	9.0	4.42	20.9	0.00
	3/7/2024	114	0.16	35.0	19.2	9.0	4.42	20.9	0.00
	3/14/2024	130	0.13	31.5	17.3	9.0	4.42	20.9	0.00
	3/21/2024	122	0.13	31.5	17.3	9.0	4.42	20.9	0.00
	4/1/2024	25	0.30	47.9	26.3	9.0	4.42	--	--
	4/5/2024	34	0.23	41.9	23.6	8.5	4.17	20.4	0.00
	4/19/2024	73	0.03	15.1	8.5	8.5	4.17	20.6	0.00
	5/7/2024	50	0.24	42.8	24.1	8.5	4.17	20.8	0.00
	5/21/2024	23	0.24	42.8	24.1	8.5	4.17	20.5	0.00
	6/6/2024	269	0.00	0.0	0.0	9.0	4.42	20.3	0.17
	6/27/2024	169	0.52	63.0	33.8	9.5	4.67	20.4	0.02
	7/17/2024	10	0.02	12.4	6.4	10.3	5.03	20.9	0.11
	7/29/2024	16	0.09	26.2	13.7	10.0	4.91	20.9	0.00
	8/12/2024	19	0.03	15.1	7.8	10.3	5.03	20.9	0.00
	8/23/2024	13	0.02	12.4	6.5	10.0	4.91	20.9	0.00
	9/6/2024	27	Gauge Broken	--	--	10.8	5.28	20.9	0.00
	9/23/2024	32	0.02	12.4	6.4	10.3	5.03	20.7	0.10
	10/10/2024	39	0.01	8.7	4.5	10.3	5.03	20.7	0.13
	10/24/2024	18	Gauge Broken	--	--	12.5	6.14	20.9	0.00
	11/11/2024	78	0.02	12.4	5.7	12.5	6.14	20.9	0.15
	11/20/2024	92	Gauge Broken	--	--	13.5	6.63	20.9	0.12
	12/10/2024	84	0.01	8.7	3.9	13.0	6.39	20.9	0.12
	12/19/2024	33	0.28	46.3	26.6	8.0	3.93	--	--
	1/13/2025	20	0.65	70.5	40.1	8.3	4.05	20.9	0.00
	1/23/2025	26	0.46	59.3	33.3	8.5	4.17	20.9	0.00



TABLE 2
DUAL PHASE EXTRACTION SYSTEM FIELD MEASUREMENTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

SVE Well ID	Date	PID (ppm)	Differential Pressure (IWC)	Flow Rate (acfm)	Flow Rate (scfm) ⁽¹⁾	Vacuum (IHG)	Vacuum (psi)	Oxygen (%)	Carbon Dioxide (%)
MW15	2/7/2025	--	Gauge Broken	--	--	15.0	7.37	--	--
	2/24/2025	--	Gauge Broken	--	--	15.0	7.37	--	--
	3/10/2025	--	Gauge Broken	--	--	6.8	3.32	--	--
	3/29/2025	28	Gauge Broken	--	--	16.5	8.10	20.5	0.30
	4/16/2025	60	Gauge Broken	--	--	8.3	4.05	20.9	0.10
	4/24/2025	--	--	--	--	--	--	--	--
	5/29/2025	61	Gauge Broken	--	--	12.3	6.02	18.7	>5.0
	6/17/2025	51	Gauge Broken	--	--	11.5	5.65	18.9	0.97
	6/27/2025	--	--	--	--	--	--	--	--
	7/8/2025	23	Gauge Broken	--	--	10.0	4.91	20.8	0.55
	7/29/2025	--	--	--	--	--	--	--	--
	8/11/2025	--	2.42	136.0	99.6	2.0	0.98	--	--
	8/26/2025	--	0.57	66.0	49.2	1.5	0.74	--	--
	9/9/2025	--	1.31	100.1	73.3	2.0	0.98	--	--
	9/29/2025	190	--	--	--	12.1	5.94	19.3	>1.0

Notes:

(1) Individual Well Flow Rates in scfm estimated based on rotometer readings from 1/2/24 to 1/5/24

IHG: inches of mercury

PID: photoionization detector

ppm: parts per million

acfm: actual cubic feet per minute

scfm: standard cubic feet per minute

%: percent

--: not measured



TABLE 3
DUAL PHASE EXTRACTION SYSTEM EMISSIONS ANALYTICAL RESULTS

Standard #1
Hilcorp Energy Company
San Juan County, New Mexico

Date	PID (ppm)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Total Xylenes (µg/L)	TVPH/GRO (µg/L)	Oxygen (%)	Carbon Dioxide (%)
1/2/2024	198	0.58	2.8	0.42	8.9	170	21.64	0.09
1/3/2024	69	0.21	1.2	0.24	5.0	69	21.71	0.06
1/4/2024	467	29	40	<5.0	18	3,400	17.40	4.80
1/5/2024	416	18	26	<5.0	8.7	2,300	20.83	1.26
1/12/2024 ⁽¹⁾	993	22	42	<5.0	56	6,500	20.53	1.49
1/18/2024	234	21	28	<5.0	10	2,700	21.30	0.42
1/24/2024	523	22	40	<5.0	30	4,400	21.19	0.57
2/8/2024	350	19	31	<5.0	34	2,200	21.33	0.51
2/21/2024	400	13	18	<2.0	18	2,900	19.74	0.40
3/7/2024	525	14	28	<5.0	36	2,100	21.91	0.30
3/21/2024	568	15	27	1.1	34	2,900	21.57	0.29
5/7/2024	337	5.2	9.2	<2.0	10	1,400	22.02	0.31
7/30/2024 ⁽²⁾	190	3.9	7.3	<2.0	6.6	980	21.14	0.27
9/5/2024	156	3.2	8.1	<2.0	6.6	680	22.07	0.21
11/20/2024	79	8.2	44.0	3.1	43	1,300	21.34	0.12
2/7/2025	32	1.6	4.8	0.34	5.3	140	21.68	0.13
5/29/2025	23	1.3	1.7	<0.20	2.2	68	21.49	0.14
8/11/2025	7	<2.0	<2.0	<2.0	<3.0	170	22.12	0.15

Notes:

GRO: gasoline range organics

µg/L: microgram per liter

PID: photoionization detector

ppm: parts per million

(1) PID reading is from 1/11/2024

(2) PID Reading is from 7/29/2024

TVPH: total volatile petroleum hydrocarbons

%: percent

--: not sampled



TABLE 4
DUAL PHASE EXTRACTION SYSTEM MASS REMOVAL AND EMISSIONS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Laboratory Analysis

Date	PID (ppm)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Total Xylenes (µg/L)	TVPH (µg/L)
1/2/2024	198	0.58	2.8	0.42	8.9	170
1/3/2024	69	0.21	1.2	0.24	5.0	69
1/4/2024	467	29	40	<5.0	18	3,400
1/5/2024	416	18	26	<5.0	8.7	2,300
1/12/2024 ⁽¹⁾	993	22	42	<5.0	56	6,500
1/18/2024	234	21	28	<5.0	10	2,700
1/24/2024	523	22	40	<5.0	30	4,400
2/8/2024	350	19	31	<5.0	34	2,200
2/21/2024	400	13	18	<2.0	18	2,900
3/7/2024	525	14	28	<5.0	36	2,100
3/21/2024	568	15	27	1.1	34	2,900
5/7/2024	337	5.2	9.2	<2.0	10	1,400
7/30/2024 ⁽²⁾	190	3.9	7.3	<2.0	6.6	980
9/5/2024	156	3.2	8.1	<2.0	6.6	680
11/20/2024	79	8.2	44.0	3.1	43	1,300
2/7/2025	32	1.6	4.8	0.34	5.3	140
5/29/2025	23	1.3	1.7	<0.20	2.2	68
8/11/2025	7	<2.0	<2.0	<2.0	<3.0	170
Average	309	11	20	3	19	1,910

Vapor Extraction Summary

Date	Flow Rate (scfm)	Total System Flow (cf)	Delta Flow (cf)	Benzene (lb/hr)	Toluene (lb/hr)	Ethylbenzene (lb/hr)	Total Xylenes (lb/hr)	TVPH (lb/hr)
1/2/2024	534	0	0	0.0012	0.0056	0.0008	0.0178	0.34
1/3/2024	534	762,552	762,552	0.0008	0.0040	0.0007	0.0139	0.24
1/4/2024	398	1,347,612	585,060	0.0217	0.0307	0.0039	0.0171	2.58
1/5/2024	216	1,648,284	300,672	0.0190	0.0267	0.0040	0.0108	2.30
1/12/2024 ⁽¹⁾	187	3,569,148	1,920,864	0.0140	0.0238	0.0035	0.0226	3.08
1/18/2024	220	5,271,948	1,702,800	0.0177	0.0288	0.0041	0.0272	3.78
1/24/2024	260	7,487,148	2,215,200	0.0209	0.0331	0.0049	0.0194	3.45
2/8/2024	340	14,749,548	7,262,400	0.0261	0.0451	0.0064	0.0407	4.20
2/21/2024	340	21,055,188	6,305,640	0.0203	0.0312	0.0045	0.0331	3.24
3/7/2024	271	26,939,682	5,884,494	0.0137	0.0233	0.0035	0.0274	2.53
3/21/2024	282	32,540,202	5,600,520	0.01529	0.0290	0.00322	0.0369	2.64
5/7/2024	247	48,738,462	16,198,260	0.00933	0.0167	0.00143	0.0203	1.99
7/30/2024 ⁽²⁾	249	78,153,828	29,415,366	0.00424	0.0077	0.00186	0.0077	1.11
9/5/2024	151	86,402,958	8,249,130	0.00200	0.0043	0.00113	0.0037	0.47
11/20/2024	162	101,591,430	15,188,472	0.00345	0.0158	0.00155	0.0150	0.60
2/7/2025	109	113,301,954	11,710,524	0.00200	0.0099	0.00070	0.0098	0.29
5/29/2025	120	126,586,674	13,284,720	0.00065	0.0015	0.00012	0.0017	0.05
8/11/2025	62	132,471,342	5,884,668	0.00038	0.0004	0.00026	0.0006	0.03
Average				0.0107	0.019	0.0026	0.018	1.83

Mass Recovery

Date	Total SVE System Hours	Delta Hours	Benzene (pounds)	Toluene (pounds)	Ethylbenzene (pounds)	Total Xylenes (pounds)	TVPH (pounds)	TVPH (tons)
1/2/2024	4	0.0	0.0	0.0	0.0	0.0	0.0	0.0
1/3/2024	28	24	0.0	0.1	0.0	0.3	5.7	0.0
1/4/2024	53	25	0.5	0.8	0.1	0	63	0.03
1/5/2024	76	23	0.4	0.6	0.1	0.3	53	0.03
1/12/2024 ⁽¹⁾	247	171	2.4	4.1	0.6	4	527	0.26
1/18/2024	376	129	2.3	3.7	0.5	4	488	0.24
1/24/2024	518	142	3.0	4.7	0.7	2.8	490	0.25
2/8/2024	874	356	9.3	16	2.3	14	1,494	0.75
2/21/2024	1,183	309	6.29	9.6	1.4	10	1,002	0.50
3/7/2024	1,545	362	4.95	8.4	1.3	10	917	0.46
3/21/2024	1,876	331	5.06	9.6	1.06	12.2	873	0.44
5/7/2024	2,969	1,093	10.20	18.3	1.57	22.2	2,171	1.09
7/30/2024 ⁽²⁾	4,938	1,969	8.34	15.1	3.67	15.2	2,182	1.09
9/5/2024	5,848	911	1.83	4.0	1.03	3.4	427	0.21
11/20/2024	7,411	1,563	5.40	24.7	2.41	23.5	937	0.47
2/7/2025	9,202	1,791	3.58	17.8	1.26	17.6	526	0.26
5/29/2025	11,047	1,845	1.20	2.7	0.22	3.1	86	0.04
8/11/2025	12,629	1,582	0.61	0.7	0.40	1.0	44	0.02
Total Mass Recovery to Date			65	141	19	144	12,286	6.14

Notes:

cf: cubic feet

cfm: cubic feet per minute

µg/L: micrograms per liter

lb/hr: pounds per hour

---: not sampled

PID: photoionization detector

ppm: parts per million

TVPH: total volatile petroleum hydrocarbons

Laboratory detection limit used to estimate mass removal

(1) PID reading, flow rate, and hour meter are from 1/11/2024

(2) PID reading, flow rate, and hour meter are from 7/29/2024



TABLE 5 LIQUID RECOVERY Standard #1 Hilcorp Energy Company San Juan County, New Mexico									
Date/Time	Hour Meter Reading	Flow Meter Reading (gal)	Gallons Recovered this Period	Cumulative Volume Recovered (gal)	Time Period (hr:min:sec)	Time Period (min)	Recovery Rate		Notes
							(gpm)	(gal/day)	
1/11/24 13:15	219	2,648	0	0	--	--	--	--	
1/18/24 14:05	376	8,518	5,870	5,870	168:50:00	10,130	0.58	834	
1/24/24 12:30	518	12,337	3,819	9,689	142:25:00	8,545	0.45	644	
2/1/24 11:00	707	14,170	1,834	11,522	190:30:00	11,430	0.16	231	
2/8/24 10:39	874	17,328	3,158	14,680	167:39:00	10,059	0.31	452	
2/15/24 10:40	1,040	21,029	3,701	18,381	168:01:00	10,081	0.37	529	
2/21/24 10:05	1,183	23,866	2,837	21,218	143:25:00	8,605	0.33	475	
3/1/24 13:20	1,399	28,034	4,168	25,385	219:15:00	13,155	0.32	456	
3/7/24 14:50	1,545	32,076	4,042	29,428	145:30:00	8,730	0.46	667	
3/14/24 13:05	1,710	36,362	4,286	33,713	166:15:00	9,975	0.43	619	
3/21/24 10:02	1,876	40,443	4,082	37,795	164:57:00	9,897	0.41	594	
4/1/24 13:00	--	--	--	--	--	--	--	--	
4/5/24 10:00	2,201	48,058	7,614	45,409	359:58:00	21,598	0.35	508	
4/19/24 10:44	2,537	55,292	7,234	52,643	336:44:00	20,204	0.36	516	
5/7/24 10:07	2,969	63,559	8,268	60,911	431:23:00	25,883	0.32	460	
5/21/24 16:22	3,310	69,749	6,190	67,101	342:15:00	20,535	0.30	434	
6/6/24 11:11	3,661	75,626	5,877	72,977	378:49:00	22,729	0.26	372	
6/27/24 13:30	4,167	84,339	8,714	81,691	506:19:00	30,379	0.29	413	
7/17/24 11:33	4,645	92,352	8,013	89,704	478:03:00	28,683	0.28	402	
7/29/24 16:29	4,938	97,043	4,691	94,395	292:56:00	17,576	0.27	384	
8/12/24 14:38	5,272	101,851	4,808	99,203	334:09:00	20,049	0.24	345	
8/23/24 13:05	5,535	105,583	3,732	102,935	262:27:00	15,747	0.24	341	
9/5/24 14:56	5,848	109,915	4,332	107,267	313:51:00	18,831	0.23	331	
9/23/24 12:05	6,278	115,338	5,423	112,689	429:09:00	25,749	0.21	303	
10/10/24 15:05	6,640	118,996	3,659	116,348	411:00:00	24,660	0.15	214	
10/24/24 11:23	6,972	122,790	3,794	120,142	332:18:00	19,938	0.19	274	
11/11/24 11:45	7,193	124,182	1,392	121,533	432:22:00	25,942	0.05	77	
11/20/24 14:04	7,411	125,918	1,737	123,270	218:19:00	13,099	0.13	191	
12/10/24 12:57	7,784	128,057	2,139	125,409	478:53:00	28,733	0.07	107	
12/19/24 13:33	7,999	128,700	643	126,052	216:36:00	12,996	0.05	71	
1/13/25 13:08	8,599	129,849	1,149	127,201	599:35:00	35,975	0.03	46	
1/23/25 12:25	8,838	130,349	500	127,701	239:17:00	14,357	0.03	50	
2/7/25 15:52	9,202	132,316	1,967	129,667	363:27:00	21,807	0.09	130	
2/24/25 12:29	9,606	135,059	2,744	132,411	404:37:00	24,277	0.11	163	
3/10/25 11:35	9,940	136,075	1,016	133,427	335:06:00	20,106	0.05	73	
3/29/25 14:35	10,255	136,824	749	134,175	459:00:00	27,540	0.03	39	
4/16/25 14:16	10,686	138,721	1,898	136,073	431:41:00	25,901	0.07	105	
4/24/25 13:19	10,877	139,311	590	136,662	191:03:00	11,463	0.05	74	
5/29/25 13:22	11,047	140,751	1,440	138,102	840:03:00	50,403	0.03	41	
6/17/25 12:53	11,500	144,109	3,358	141,460	455:31:00	27,331	0.12	177	
6/27/25 11:03	11,682	144,802	694	142,154	238:10:00	14,290	0.05	70	
7/8/25 10:25	11,822	145,573	771	142,925	263:22:00	15,802	0.05	70	
8/11/25 11:59	12,629	147,355	1,782	144,706	817:34:00	49,054	0.04	52	
8/26/25 11:57	12,988	147,524	169	144,876	359:58:00	21,598	0.01	11	
9/9/25 0:00	13,324	147,524	0	144,876	324:03:00	19,443	0.00	0	
9/29/25 0:00	13,660	147,681	157	145,032	480:00:00	28,800	0.01	8	

Notes:
bbl: barrel
ft: feet
gal: gallon
gal/day: gallon per day
gpm: gallon per minute
hr: hour
in: inch
min: minute
sec: second
Dashed line indicated quarter change
--: not applicable

Total Quantity of Liquid Removed:	145,032 Gal
	3,453 bbl



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW01	5,789.08	10/22/2018	20.80	20.97	0.17	5,768.25
		3/29/2019	20.69	21.35	0.66	5,768.26
		6/28/2019	20.70	21.44	0.74	5,768.23
		9/17/2019	20.64	20.83	0.19	5,768.40
		12/17/2019	20.50	20.89	0.39	5,768.50
		3/12/2020	20.49	20.76	0.27	5,768.54
		6/25/2020	20.39	20.65	0.26	5,768.64
		9/23/2020	20.19	20.46	0.27	5,768.84
		3/21/2021	20.11	20.20	0.09	5,768.95
		6/14/2021	Trace	20.18	Trace	5,768.90
		9/20/2021	--	19.62	--	5,769.46
		12/2/2021	Trace	19.50	Trace	5,769.58
		3/1/2022	Trace	19.62	Trace	5,769.46
		6/7/2022	Trace	19.39	Trace	5,769.69
		9/29/2022	19.08	19.10	0.02	5,770.00
		12/8/2022	19.05	19.12	0.07	5,770.02
		3/2/2023	18.91	18.93	0.02	5,770.17
		6/16/2023	18.80	18.90	0.10	5,770.26
		9/15/2023	--	18.55	--	5,770.53
		12/14/2023	--	--	--	--
		3/27/2024	--	20.18	--	5,768.90
		6/3/2024	Trace	20.19	Trace	5,768.89
		9/23/2024	Trace	20.33	Trace	5,768.75
		12/9/2024	Trace	20.23	Trace	5,768.85
		3/20/2025	Trace	19.78	Trace	5,769.30
		6/16/2025	Trace	19.80	Trace	5,769.28
		9/15/2025	Trace	19.80	Trace	5,769.28
MW02	5,789.36	10/22/2018	--	21.12	--	5,768.24
		3/29/2019	20.85	21.11	0.26	5,768.46
		6/28/2019	20.95	21.30	0.35	5,768.34
		9/17/2019	20.80	20.85	0.05	5,768.55
		12/17/2019	--	20.74	--	5,768.62
		3/12/2020	--	20.65	--	5,768.71
		6/25/2020	--	20.58	--	5,768.78
		9/23/2020	--	20.43	--	5,768.93
		3/31/2021	--	20.29	--	5,769.07
		6/14/2021	Trace	20.21	Trace	5,769.15
		9/20/2021	--	19.77	--	5,769.59
		12/3/2021	--	19.68	--	5,769.68
		3/1/2022	--	19.83	--	5,769.53
		6/7/2022	Trace	19.56	Trace	5,769.80
		9/29/2022	--	19.26	--	5,770.10
		12/8/2022	--	19.22	--	5,770.14
		3/2/2023	Trace	19.06	Trace	5,770.30
		6/16/2023	Trace	18.90	Trace	5,770.46
		9/15/2023	--	18.79	--	5,770.57
		12/14/2023	--	--	--	--
		3/27/2024	--	19.69	--	5,769.67
		6/3/2024	Trace	19.57	Trace	5,769.79
		9/23/2024	Trace	19.68	Trace	5,769.68
		12/9/2024	Trace	18.89	Trace	5,770.47
		3/20/2025	Trace	19.25	Trace	5,770.11
		6/16/2025	Trace	19.30	Trace	5,770.06
		9/15/2025	Trace	19.30	Trace	5,770.06



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW03	5,792.06	10/22/2018	--	DRY	--	DRY
		3/29/2019	--	30.90	--	5,761.16
		6/28/2019	--	32.14	--	5,759.92
		9/17/2019	--	27.32	--	5,764.74
		12/17/2019	--	23.75	--	5,768.31
		3/12/2020	--	23.40	--	5,768.66
		6/25/2020	--	23.25	--	5,768.81
		9/23/2020	--	23.08	--	5,768.98
		3/31/2021	--	22.81	--	5,769.25
		6/14/2021	--	22.61	--	5,769.45
		9/24/2021	22.24	22.25	0.01	5,769.82
		12/3/2021	--	22.17	--	5,769.89
		3/1/2022	--	22.30	--	5,769.76
		6/7/2022	--	22.04	--	5,770.02
		9/29/2022	--	21.71	--	5,770.35
		12/8/2022	--	21.69	--	5,770.37
		3/2/2023	--	21.46	--	5,770.60
		6/16/2023	--	21.29	--	5,770.77
		9/15/2023	--	21.20	--	5,770.86
		12/14/2023	--	--	--	--
		3/27/2024	--	20.46	--	5,771.60
		6/3/2024	--	23.22	--	5,768.84
		9/23/2024	Trace	20.79	Trace	5,771.27
		12/9/2024	Trace	18.66	Trace	5,773.40
		3/21/2025	Trace	19.08	Trace	5,772.98
		6/16/2025	Trace	19.13	Trace	5,772.93
		9/15/2025	Trace	19.26	Trace	5,772.80
MW04	5,792.35	10/22/2018	--	31.80	--	5,760.55
		3/29/2019	--	DRY	--	DRY
		6/28/2019	--	DRY	--	DRY
		9/17/2019	--	31.88	--	5,760.47
		12/17/2019	--	31.87	--	5,760.48
		3/12/2020	--	DRY	--	DRY
		6/25/2020	--	31.89	--	5,760.46
		9/23/2020	--	30.99	--	5,761.36
		3/31/2021	--	28.31	--	5,764.04
		6/14/2021	--	26.98	--	5,765.37
		9/24/2021	--	24.85	--	5,767.50
		12/3/2021	--	22.12	--	5,770.23
		3/1/2022	--	22.52	--	5,769.83
		6/7/2022	--	21.38	--	5,770.97
		9/29/2022	--	21.13	--	5,771.22
		12/8/2022	Trace	21.00	Trace	5,771.35
		3/2/2023	--	20.72	--	5,771.63
		6/16/2023	Trace	20.45	Trace	5,771.90
		9/15/2023	--	20.49	--	5,771.86
		12/14/2023	--	20.47	--	5,771.88
		3/27/2024	Trace	20.60	Trace	5,771.75
		6/3/2024	--	20.48	--	5,771.87
		9/23/2024	Trace	20.77	Trace	5,771.58
		12/9/2024	Trace	20.22	Trace	5,772.13
		3/21/2025	Trace	20.08	Trace	5,772.27
		6/16/2025	Trace	20.15	Trace	5,772.20
		9/15/2025	Trace	21.77	Trace	5,770.58



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW05	5,792.60	10/22/2018	--	28.39	--	5,764.21
		3/29/2019	--	24.65	--	5,767.95
		6/28/2019	--	24.53	--	5,768.07
		9/17/2019	--	21.41	--	5,771.19
		12/17/2019	--	21.25	--	5,771.35
		3/12/2020	--	21.10	--	5,771.50
		6/25/2020	--	21.13	--	5,771.47
		9/23/2020	--	20.93	--	5,771.67
		3/31/2021	--	20.76	--	5,771.84
		6/14/2021	--	20.61	--	5,771.99
		9/24/2021	--	20.37	--	5,772.23
		12/3/2021	--	20.41	--	5,772.19
		3/1/2022	--	20.58	--	5,772.02
		6/7/2022	Trace	20.24	Trace	5,772.36
		9/29/2022	Trace	20.02	Trace	5,772.58
		12/8/2022	Trace	19.97	Trace	5,772.63
		3/2/2023	Trace	19.82	Trace	5,772.78
		6/16/2023	Trace	19.63	Trace	5,772.97
		9/15/2023	--	19.61	--	5,772.99
		12/14/2023	--	19.61	--	5,772.99
		3/27/2024	Trace	20.12	Trace	5,772.48
		6/3/2024	Trace	20.03	Trace	5,772.57
		9/23/2024	Trace	20.05	Trace	5,772.55
		12/9/2024	Trace	19.67	Trace	5,772.93
		3/21/2025	Trace	19.50	Trace	5,773.10
		6/16/2025	Trace	19.59	Trace	5,773.01
		9/16/2025	Trace	20.48	Trace	5,772.12
MW06	5,792.31	10/22/2018	24.08	24.48	0.40	5,768.15
		3/29/2019	23.55	24.00	0.45	5,768.67
		6/28/2019	23.72	23.95	0.23	5,768.54
		9/17/2019	20.67	20.75	0.08	5,771.62
		12/17/2019	20.61	20.62	0.01	5,771.70
		3/12/2020	--	20.43	--	5,771.88
		6/25/2020	--	20.36	--	5,771.95
		9/23/2020	--	20.16	--	5,772.15
		3/31/2021	--	19.89	--	5,772.42
		6/14/2021	Trace	19.63	Trace	5,772.68
		9/24/2021	--	19.27	--	5,773.04
		12/3/2021	--	19.27	--	5,773.04
		3/1/2022	--	19.43	--	5,772.88
		6/7/2022	--	19.11	--	5,773.20
		9/29/2022	Trace	18.80	Trace	5,773.51
		12/8/2022	Trace	18.76	Trace	5,773.55
		3/2/2023	Trace	18.52	Trace	5,773.79
		6/16/2023	Trace	18.29	Trace	5,774.02
		9/15/2023	--	18.25	--	5,774.06
		12/14/2023	--	--	--	--
		3/27/2024	--	18.57	--	5,773.74
		6/3/2024	Trace	19.10	Trace	5,773.21
		9/23/2024	Trace	18.55	Trace	5,773.76
		12/9/2024	Trace	17.36	Trace	5,774.95
		3/21/2025	Trace	18.08	Trace	5,774.23
		6/16/2025	Trace	18.17	Trace	5,774.14
		9/16/2025	Trace	18.02	Trace	5,774.29



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW07	5,791.15	10/22/2018	--	DRY	--	DRY
		3/29/2019	--	DRY	--	DRY
		6/28/2019	--	DRY	--	DRY
		9/17/2019	--	DRY	--	DRY
		12/17/2019	--	DRY	--	DRY
		3/12/2020	--	DRY	--	DRY
		6/25/2020	--	DRY	--	DRY
		9/23/2020	--	DRY	--	DRY
		3/31/2021	--	DRY	--	DRY
		6/14/2021	--	DRY	--	DRY
		9/24/2021	--	DRY	--	DRY
		12/2/2021	--	DRY	--	DRY
		3/1/2022	--	DRY	--	DRY
		6/7/2022	--	DRY	--	DRY
		9/29/2022	--	21.80	--	5,769.35
		12/8/2022	--	22.56	--	5,768.59
		3/2/2023	--	22.32	--	5,768.83
		6/16/2023	--	21.42	--	5,769.73
		9/15/2023	--	DRY	--	DRY
		12/14/2023	--	--	--	--
		3/27/2024	--	--	--	--
		6/3/2024	--	DRY	--	DRY
		9/23/2024	--	DRY	--	DRY
		12/9/2024	--	DRY	--	DRY
		3/21/2025	--	DRY	--	DRY
		6/16/2025	--	DRY	--	DRY
		9/15/2025	--	DRY	--	DRY
MW08	5,792.42	10/22/2018	--	DRY	--	DRY
		3/29/2019	--	DRY	--	DRY
		6/28/2019	--	24.07	--	5,768.35
		9/17/2019	--	23.81	--	5,768.61
		12/17/2019	--	23.42	--	5,769.00
		3/12/2020	--	23.37	--	5,769.05
		6/25/2020	--	23.28	--	5,769.14
		9/23/2021	--	22.88	--	5,769.54
		3/31/2021	--	22.14	--	5,770.28
		6/14/2021	--	21.67	--	5,770.75
		9/24/2021	--	21.52	--	5,770.90
		12/2/2021	--	21.76	--	5,770.66
		3/1/2022	--	21.81	--	5,770.61
		6/7/2022	--	21.17	--	5,771.25
		9/29/2022	--	21.02	--	5,771.40
		12/8/2022	--	20.85	--	5,771.57
		3/2/2023	--	20.52	--	5,771.90
		6/16/2023	--	20.22	--	5,772.20
		9/14/2023	--	20.32	--	5,772.10
		12/14/2023	--	20.26	--	5,772.16
		3/27/2024	--	20.18	--	5,772.24
		6/3/2024	--	20.05	--	5,772.37
		9/23/2024	--	19.90	--	5,772.52
		12/10/2024	--	19.88	--	5,772.54
		3/21/2024	Trace	23.52	Trace	5,768.90
		6/16/2025	--	19.75	--	5,772.67
		9/16/2025	--	20.02	--	5,772.40



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW09	5,786.16	10/22/2018	--	DRY	--	DRY
		3/29/2019	--	DRY	--	DRY
		6/28/2019	--	DRY	--	DRY
		9/17/2019	--	DRY	--	DRY
		12/17/2019	--	DRY	--	DRY
		3/12/2020	--	DRY	--	DRY
		6/25/2020	--	DRY	--	DRY
		9/23/2020	--	DRY	--	DRY
		3/31/2021	--	DRY	--	DRY
		6/14/2021	--	DRY	--	DRY
		9/24/2021	--	DRY	--	DRY
		12/2/2021	--	DRY	--	DRY
		3/1/2022	--	DRY	--	DRY
		6/7/2022	--	DRY	--	DRY
		9/29/2022	--	DRY	--	DRY
		12/8/2022	--	DRY	--	DRY
		3/2/2023	--	DRY	--	DRY
		6/16/2023	--	22.61	--	5,763.55
		9/15/2023	--	17.37	--	5,768.79
		12/15/2023	--	17.38	--	5,768.78
		3/28/2024	--	24.74	--	5,761.42
		6/3/2024	--	26.65	--	5,759.51
		9/23/2024	--	26.64	--	5,759.52
		12/10/2024	--	26.96	--	5,759.20
		3/20/2025	--	17.55	--	5,768.61
		6/16/2025	--	17.65	--	5,768.51
		9/15/2025	--	18.01	--	5,768.15
MW10	5,789.30	10/22/2018	--	32.26	--	5,757.04
		3/29/2019	21.73	22.04	0.31	5,767.51
		6/28/2019	21.55	21.94	0.39	5,767.67
		9/17/2019	21.23	21.55	0.32	5,768.01
		12/17/2019	20.88	21.71	0.83	5,768.25
		3/12/2020	20.81	21.68	0.87	5,768.32
		6/25/2020	20.75	21.43	0.68	5,768.41
		9/23/2020	20.51	21.03	0.52	5,768.69
		3/31/2021	20.42	20.63	0.21	5,768.84
		6/14/2021	Trace	20.71	Trace	5,768.59
		9/24/2021	--	19.92	--	5,769.38
		12/3/2021	--	19.80	--	5,769.50
		3/1/2022	--	19.95	--	5,769.35
		6/7/2022	Trace	19.70	Trace	5,769.60
		9/29/2022	Trace	19.43	Trace	5,769.87
		12/8/2022	Trace	19.40	Trace	5,769.90
		3/2/2023	Trace	19.27	Trace	5,770.03
		6/16/2023	Trace	19.11	Trace	5,770.19
		9/15/2023	--	19.00	--	5,770.30
		12/15/2023	--	--	--	--
		3/28/2024	--	24.62	--	5,764.68
		6/3/2024	--	DRY	--	DRY
		9/23/2024	Trace	26.48	Trace	5762.82
		12/9/2024	Trace	23.58	Trace	5765.72
		3/20/2025	Trace	24.86	Trace	5764.44
		6/16/2025	Trace	24.75	Trace	5764.55
		9/15/2025	Trace	24.69	Trace	5764.61



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW11	5,787.99	10/22/2018	--	19.89	--	5,768.10
		3/29/2019	--	19.63	--	5,768.36
		6/28/2019	--	19.37	--	5,768.62
		9/17/2019	--	19.31	--	5,768.68
		12/17/2019	--	19.17	--	5,768.82
		3/12/2020	--	18.91	--	5,769.08
		6/25/2020	--	18.85	--	5,769.14
		9/23/2020	--	18.71	--	5,769.28
		3/31/2021	--	18.40	--	5,769.59
		6/14/2021	--	18.06	--	5,769.93
		9/24/2021	--	17.72	--	5,770.27
		12/2/2021	--	17.79	--	5,770.20
		3/1/2022	--	17.90	--	5,770.09
		6/7/2022	--	17.55	--	5,770.44
		9/29/2022	--	17.27	--	5,770.72
		12/8/2022	--	17.19	--	5,770.80
		3/2/2023	--	16.97	--	5,771.02
		6/16/2023	--	16.74	--	5,771.25
		9/14/2023	--	16.75	--	5,771.24
		12/14/2023	--	16.68	--	5,771.31
		3/28/2024	--	17.08	--	5,770.91
		6/3/2024	--	17.05	--	5,770.94
		9/23/2024	--	16.70	--	5,771.29
		12/9/2024	--	16.45	--	5,771.54
		3/21/2025	--	16.35	--	5,771.64
		6/16/2025	--	16.36	--	5,771.63
		9/16/2025	--	16.43	--	5,771.56
MW12	5,789.57	10/22/2018	--	21.77	--	5,767.80
		3/29/2019	--	21.88	--	5,767.69
		6/28/2019	--	21.67	--	5,767.90
		9/17/2019	--	21.49	--	5,768.08
		12/17/2019	--	21.54	--	5,768.03
		3/12/2020	--	21.31	--	5,768.26
		6/25/2020	--	21.21	--	5,768.36
		9/23/2020	--	21.02	--	5,768.55
		3/31/2021	--	20.93	--	5,768.64
		6/14/2021	--	20.61	--	5,768.96
		9/24/2021	--	20.17	--	5,769.40
		12/2/2021	--	20.17	--	5,769.40
		3/1/2022	--	20.30	--	5,769.27
		6/7/2022	--	20.02	--	5,769.55
		9/29/2022	--	19.68	--	5,769.89
		12/8/2022	--	19.57	--	5,770.00
		3/2/2023	--	19.32	--	5,770.25
		6/16/2023	--	19.11	--	5,770.46
		9/14/2023	--	19.04	--	5,770.53
		12/14/2023	--	19.01	--	5,770.56
		3/28/2024	--	19.49	--	5,770.08
		6/3/2024	--	19.49	--	5,770.08
		9/23/2024	--	19.22	--	5,770.35
		12/9/2024	--	18.88	--	5,770.69
		3/21/2025	--	19.28	--	5,770.29
		6/16/2025	--	18.75	--	5,770.82
		9/16/2025	--	18.72	--	5,770.85



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW13	5,785.16	10/22/2018	--	DRY	--	DRY
		3/29/2019	--	DRY	--	DRY
		6/28/2019	--	DRY	--	DRY
		9/17/2019	--	DRY	--	DRY
		12/17/2019	--	DRY	--	DRY
		3/12/2020	--	DRY	--	DRY
		6/25/2020	--	DRY	--	DRY
		9/23/2020	--	DRY	--	DRY
		3/31/2021	--	DRY	--	DRY
		6/14/2021	--	DRY	--	DRY
		9/24/2021	--	DRY	--	DRY
		12/2/2021	--	DRY	--	DRY
		3/1/2022	--	DRY	--	DRY
		6/7/2022	--	DRY	--	DRY
		9/29/2022	--	DRY	--	DRY
		12/8/2022	--	DRY	--	DRY
		3/2/2023	--	DRY	--	DRY
		6/16/2023	--	DRY	--	DRY
		9/14/2023	--	DRY	--	DRY
		12/14/2023	--	DRY	--	DRY
		3/28/2024	--	DRY	--	DRY
		6/3/2024	--	DRY	--	DRY
		9/25/2024	--	DRY	--	DRY
		12/9/2024	--	DRY	--	DRY
		3/20/2025	--	DRY	--	DRY
		6/16/2025	--	DRY	--	DRY
		9/15/2025	--	DRY	--	DRY
MW14	5,785.46	10/22/2018	--	22.87	--	5,762.59
		3/29/2019	20.26	20.47	0.21	5,765.16
		6/28/2019	19.15	19.16	0.01	5,766.31
		9/17/2019	18.65	18.69	0.04	5,766.80
		12/17/2019	18.61	18.74	0.13	5,766.82
		3/12/2020	--	18.81	--	5,766.65
		6/25/2020	--	18.18	--	5,767.28
		9/23/2020	--	17.92	--	5,767.54
		3/31/2021	--	17.92	--	5,767.54
		6/14/2021	Trace	17.78	Trace	5,767.68
		9/24/2021	--	17.52	--	5,767.94
		12/3/2021	--	17.79	--	5,767.67
		3/1/2022	--	17.18	--	5,768.28
		6/7/2022	--	16.84	--	5,768.62
		9/29/2022	--	16.37	--	5,769.09
		12/8/2022	--	16.17	--	5,769.29
		3/2/2023	Trace	15.91	Trace	5,769.55
		6/16/2023	Trace	15.63	Trace	5,769.83
		9/14/2023	--	15.65	--	5,769.81
		12/14/2023	--	15.63	--	5,769.83
		3/28/2024	Trace	15.84	Trace	5,769.62
		6/3/2024	Trace	15.88	Trace	5,769.58
		9/25/2024	Trace	15.55	Trace	5,769.91
		12/9/2024	Trace	15.47	Trace	5,769.99
		3/21/2025	Trace	15.45	Trace	5,770.01
		6/16/2025	Trace	15.32	Trace	5,770.14
		9/15/2025	Trace	15.62	Trace	5,769.84



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW15	5,792.19	3/29/2019	--	DRY	--	DRY
		6/28/2019	--	35.95	--	5,756.24
		9/17/2019	--	33.22	--	5,758.97
		12/17/2019	--	31.61	--	5,760.58
		3/12/2020	--	31.42	--	5,760.77
		6/25/2020	--	30.41	--	5,761.78
		9/23/2020	--	27.42	--	5,764.77
		3/31/2021	--	27.8	--	5,764.39
		6/14/2021	--	29.18	--	5,763.01
		9/24/2021	--	26.69	--	5,765.50
		12/3/2021	--	26.82	--	5,765.37
		3/1/2022	--	26.57	--	5,765.62
		6/7/2022	--	26.49	--	5,765.70
		9/29/2022	--	25.95	--	5,766.24
		12/8/2022	--	26.21	--	5,765.98
		3/2/2023	--	25.95	--	5,766.24
		6/16/2023	--	25.08	--	5,767.11
		9/14/2023	--	25.97	--	5,766.22
		12/14/2023	--	--	--	--
		3/28/2024	--	21.03	--	5,771.16
		6/3/2024	--	15.03	--	5,777.16
		9/25/2024	--	20.37	--	5,771.82
		12/9/2024	Trace	19.86	Trace	5,772.33
		3/21/2025	Trace	20.88	Trace	5,771.31
		6/16/2025	Trace	20.21	Trace	5,771.98
		9/16/2025	Trace	20.09	Trace	5,772.10
MW16	5,786.54	3/29/2019	--	28.59	--	5,757.95
		6/28/2019	--	21.00	--	5,765.54
		9/17/2019	--	20.91	--	5,765.63
		12/17/2019	--	21.11	--	5,765.43
		3/12/2020	--	20.89	--	5,765.65
		6/25/2020	--	20.51	--	5,766.03
		9/23/2020	--	20.37	--	5,766.17
		3/31/2021	19.99	20.04	0.05	5,766.54
		6/14/2021	Trace	19.51	Trace	5,767.03
		9/24/2021	--	18.81	--	5,767.73
		12/2/2021	Trace	18.46	Trace	5,768.08
		3/1/2022	--	18.39	--	5,768.15
		6/7/2022	--	18.00	--	5,768.54
		9/29/2022	17.53	17.54	0.01	5,769.01
		12/8/2022	--	17.32	--	5,769.22
		3/2/2023	--	17.03	--	5,769.51
		6/16/2023	--	16.81	--	5,769.73
		9/14/2023	--	16.82	--	5,769.72
		12/15/2023	--	16.75	--	5,769.79
		3/28/2024	--	16.91	--	5,769.63
		6/3/2024	--	17.04	--	5,769.50
		9/25/2024	--	17.17	--	5,769.37
		12/9/2024	--	17.22	--	5,769.32
		3/20/2025	--	16.40	--	5,770.14
		6/16/2025	--	16.42	--	5,770.12
		9/15/2025	--	16.32	--	5,770.22



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW17	5,785.25	3/29/2019	--	DRY	--	DRY
		6/28/2019	--	DRY	--	DRY
		9/17/2019	--	30.24	--	5,755.01
		12/17/2019	--	DRY	--	DRY
		3/12/2020	--	DRY	--	DRY
		6/25/2020	--	DRY	--	DRY
		9/23/2020	--	DRY	--	DRY
		3/31/2021	--	DRY	--	DRY
		6/14/2021	--	DRY	--	DRY
		9/24/2021	--	DRY	--	DRY
		12/2/2021	--	30.24	--	5,755.01
		3/1/2022	--	DRY	--	DRY
		6/7/2022	--	30.21	--	5,755.04
		9/29/2022	--	30.22	--	5,755.03
		12/8/2022	--	28.68	--	5,756.57
		3/2/2023	--	25.58	--	5,759.67
		6/16/2023	--	22.13	--	5,763.12
		9/14/2023	--	20.78	--	5,764.47
		12/15/2023	--	21.68	--	5,763.57
		3/28/2024	--	22.38	--	5,762.87
		6/3/2024	--	23.02	--	5,762.23
		9/25/2024	--	21.89	--	5,763.36
		12/9/2024	--	20.94	--	5,764.31
		3/20/2025	--	18.10	--	5,767.15
		6/16/2025	--	17.98	--	5,767.27
		9/15/2025	--	17.76	--	5,767.49
MW18	5,789.34	3/29/2019	--	DRY	--	DRY
		6/28/2019	--	20.39	--	5,768.95
		9/17/2019	--	19.06	--	5,770.28
		12/17/2019	--	19.98	--	5,769.36
		3/12/2020	--	19.98	--	5,769.36
		6/25/2020	--	19.79	--	5,769.55
		9/23/2020	--	19.55	--	5,769.79
		3/31/2021	--	19.43	--	5,769.91
		6/14/2021	--	18.98	--	5,770.36
		9/24/2021	--	18.52	--	5,770.82
		12/2/2021	--	18.64	--	5,770.70
		3/1/2022	--	18.90	--	5,770.44
		6/7/2022	--	18.25	--	5,771.09
		9/29/2022	--	18.01	--	5,771.33
		12/8/2022	--	17.91	--	5,771.43
		3/2/2023	--	17.64	--	5,771.70
		6/16/2023	--	17.38	--	5,771.96
		9/14/2023	--	17.43	--	5,771.91
		12/14/2023	--	17.37	--	5,771.97
		3/27/2024	--	17.61	--	5,771.73
		6/3/2024	--	17.57	--	5,771.77
		9/23/2024	--	17.24	--	5,772.10
		12/9/2024	--	17.30	--	5,772.04
		3/21/2025	--	16.95	--	5,772.39
		6/16/2025	--	16.85	--	5,772.49
		9/16/2025	--	16.91	--	5,772.43



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW19	5,786.48	3/29/2019	--	19.60	--	5,766.88
		6/28/2019	--	19.55	--	5,766.93
		9/17/2019	--	19.35	--	5,767.13
		12/17/2019	--	19.37	--	5,767.11
		3/12/2020	--	19.45	--	5,767.03
		6/25/2020	--	19.30	--	5,767.18
		9/23/2020	--	19.08	--	5,767.40
		3/31/2021	--	19.21	--	5,767.27
		6/14/2021	--	19.10	--	5,767.38
		9/24/2021	--	18.70	--	5,767.78
		12/2/2021	--	DRY	--	DRY
		3/1/2022	--	18.49	--	5,767.99
		6/7/2022	--	18.35	--	5,768.13
		9/29/2022	--	17.15	--	5,769.33
		12/8/2022	--	18.19	--	5,768.29
		3/2/2023	--	17.93	--	5,768.55
		6/16/2023	--	17.72	--	5,768.76
		9/14/2023	--	17.58	--	5,768.90
		12/15/2023	--	17.63	--	5,768.85
		3/28/2024	--	18.27	--	5,768.21
		6/3/2024	--	18.38	--	5,768.10
		9/25/2024	--	18.20	--	5,768.28
		12/10/2024	--	17.94	--	5,768.54
		3/21/2025	--	17.72	--	5,768.76
		6/16/2025	--	18.01	--	5,768.47
		9/15/2025	--	18.42	--	5,768.06
MW20	5,783.34	3/29/2019	--	29.61	--	5,753.73
		6/28/2019	--	30.00	--	5,753.34
		9/17/2019	--	30.21	--	5,753.13
		12/17/2019	--	30.15	--	5,753.19
		3/12/2020	--	30.30	--	5,753.04
		6/25/2020	--	DRY	--	DRY
		9/23/2020	--	DRY	--	DRY
		3/31/2021	--	DRY	--	DRY
		6/14/2021	--	DRY	--	DRY
		9/24/2021	--	DRY	--	DRY
		12/2/2021	--	30.24	--	5,753.10
		3/1/2022	--	DRY	--	DRY
		6/7/2022	--	DRY	--	DRY
		9/29/2022	--	DRY	--	DRY
		12/8/2022	--	30.25	--	5,753.09
		3/2/2023	--	DRY	--	DRY
		6/16/2023	--	30.25	--	5,753.09
		9/14/2023	--	DRY	--	DRY
		12/15/2023	--	DRY	--	DRY
		3/27/2024	--	DRY	--	DRY
		6/3/2024	--	DRY	--	DRY
		9/25/2024	--	DRY	--	DRY
		12/9/2024	--	30.29	--	5,753.05
		3/20/2025	--	DRY	--	DRY
		6/16/2025	--	DRY	--	DRY
		9/15/2025	--	DRY	--	DRY



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW21	5,800.30	3/29/2019	--	DRY	--	DRY
		6/28/2019	--	DRY	--	DRY
		9/17/2019	--	DRY	--	DRY
		12/17/2019	--	DRY	--	DRY
		3/12/2020	--	DRY	--	DRY
		6/25/2020	--	DRY	--	DRY
		9/23/2020	--	DRY	--	DRY
		3/31/2021	--	DRY	--	DRY
		6/14/2021	--	DRY	--	DRY
		9/24/2021	--	DRY	--	DRY
		12/2/2021	--	DRY	--	DRY
		3/1/2022	--	DRY	--	DRY
		6/7/2022	--	DRY	--	DRY
		9/29/2022	--	DRY	--	DRY
		12/8/2022	--	DRY	--	DRY
		3/2/2023	--	DRY	--	DRY
		6/16/2023	--	DRY	--	DRY
		9/14/2023	--	DRY	--	DRY
		12/15/2023	--	DRY	--	DRY
		3/27/2024	--	DRY	--	DRY
		6/3/2024	--	DRY	--	DRY
		9/25/2024	--	DRY	--	DRY
		12/9/2024	--	DRY	--	DRY
		3/20/2025	--	DRY	--	DRY
		6/16/2025	--	DRY	--	DRY
		9/15/2025	--	DRY	--	DRY
MW22	5,786.25	3/29/2019	--	22.56	--	5,763.69
		6/28/2019	--	17.62	--	5,768.63
		9/17/2019	--	17.54	--	5,768.71
		12/17/2019	--	17.35	--	5,768.90
		3/12/2020	--	17.10	--	5,769.15
		6/25/2020	--	17.04	--	5,769.21
		9/23/2020	--	16.85	--	5,769.40
		3/31/2021	--	16.43	--	5,769.82
		6/14/2021	--	16.10	--	5,770.15
		9/24/2021	--	15.74	--	5,770.51
		12/2/2021	--	15.84	--	5,770.41
		3/1/2022	--	15.95	--	5,770.30
		6/7/2022	--	15.53	--	5,770.72
		9/29/2022	--	15.25	--	5,771.00
		12/8/2022	--	15.16	--	5,771.09
		3/2/2023	--	14.90	--	5,771.35
		6/16/2023	--	14.68	--	5,771.57
		9/14/2023	--	14.97	--	5,771.28
		12/14/2023	--	14.64	--	5,771.61
		3/28/2024	--	14.77	--	5,771.48
		6/3/2024	--	14.76	--	5,771.49
		9/23/2024	--	14.51	--	5,771.74
		12/9/2024	--	14.34	--	5,771.91
		3/21/2025	--	14.48	--	5,771.77
		6/16/2025	--	14.14	--	5,772.11
		9/16/2025	--	14.56	--	5,771.69



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW23	5,804.80	6/28/2019	--	45.99	--	5,758.81
		9/17/2019	--	40.23	--	5,764.57
		12/17/2019	--	39.16	--	5,765.64
		3/12/2020	--	38.71	--	5,766.09
		6/25/2020	--	38.92	--	5,765.88
		9/23/2020	--	38.83	--	5,765.97
		3/31/2021	--	37.97	--	5,766.83
		6/14/2021	--	37.90	--	5,766.90
		9/24/2021	--	37.44	--	5,767.36
		12/3/2021	--	37.32	--	5,767.48
		3/1/2022	--	37.38	--	5,767.42
		6/7/2022	--	36.99	--	5,767.81
		9/29/2022	--	36.61	--	5,768.19
		12/8/2022	--	36.49	--	5,768.31
		3/2/2023	--	36.11	--	5,768.69
		6/16/2023	--	35.70	--	5,769.10
		9/15/2023	--	35.58	--	5,769.22
		12/14/2023	--	35.48	--	5,769.32
		3/27/2024	--	35.25	--	5,769.55
		6/3/2024	--	35.26	--	5,769.54
		9/25/2024	--	35.18	--	5,769.62
		12/10/2024	--	34.05	--	5,770.75
		3/21/2025	--	35.08	--	5,769.72
		6/16/2025	--	35.50	--	5,769.30
		9/16/2025	--	35.39	--	5,769.41
MW24	5,782.50	6/28/2019	--	DRY	--	DRY
		9/17/2019	--	DRY	--	DRY
		12/17/2019	--	DRY	--	DRY
		3/12/2020	--	DRY	--	DRY
		6/25/2020	--	DRY	--	DRY
		9/23/2020	--	DRY	--	DRY
		3/31/2021	--	DRY	--	DRY
		6/14/2021	--	DRY	--	DRY
		9/24/2021	--	DRY	--	DRY
		12/2/2021	--	33.08	--	5,749.42
		3/1/2022	--	DRY	--	DRY
		6/7/2022	--	DRY	--	DRY
		9/29/2022	--	33.09	--	0.00
		12/8/2022	--	DRY	--	DRY
		3/2/2023	--	33.07	--	5,749.43
		6/16/2023	--	DRY	--	DRY
		9/15/2023	--	DRY	--	DRY
		12/14/2023	--	DRY	--	DRY
		3/27/2024	--	DRY	--	DRY
		6/3/2024	--	DRY	--	DRY
		9/25/2024	--	DRY	--	DRY
		12/9/2024	--	DRY	--	DRY
		3/20/2025	--	DRY	--	DRY
		6/16/2025	--	19.62	--	5,762.88
		9/15/2025	--	21.75	--	5,760.75



TABLE 6 GROUNDWATER ELEVATION Standard #1 Hilcorp Energy Company San Juan County, New Mexico						
Monitoring Well	Top of Casing Elevation (feet)	Date	Depth to Product (feet BTOC)	Depth to Groundwater (feet BTOC)	Product Thickness (feet)	Groundwater Elevation (feet AMSL)
MW25	5,775.65	6/28/2019	--	32.98	--	5,742.67
		9/17/2019	--	32.91	--	5,742.74
		12/17/2019	--	32.92	--	5,742.73
		3/12/2020	--	32.92	--	5,742.73
		6/25/2020	--	32.93	--	5,742.72
		9/23/2020	--	DRY	--	DRY
		3/31/2021	--	DRY	--	DRY
		6/14/2021	--	DRY	--	DRY
		9/24/2021	--	DRY	--	DRY
		12/1/2021	--	33.06	--	5,742.59
		3/1/2022	--	DRY	--	DRY
		6/7/2022	--	33.04	--	5,742.61
		9/29/2022	--	33.05	--	5,742.60
		12/8/2022	--	DRY	--	DRY
		3/2/2023	--	DRY	--	DRY
		6/16/2023	--	DRY	--	DRY
		9/15/2023	--	DRY	--	DRY
		12/14/2023	--	DRY	--	DRY
		3/27/2024	--	DRY	--	DRY
		3/27/2024	--	33.04	--	5,742.61
MW26	5,789.96	9/25/2024	--	DRY	--	DRY
		12/9/2024	--	33.15	--	5,742.50
		3/20/2025	--	DRY	--	DRY
		6/16/2025	--	DRY	--	DRY
		9/15/2025	--	DRY	--	DRY
		6/28/2019	--	19.71	--	5,770.25
		9/17/2019	--	19.64	--	5,770.32
		12/17/2019	--	19.41	--	5,770.55
		3/12/2020	--	19.29	--	5,770.67
		6/25/2020	--	19.29	--	5,770.67
		9/23/2020	--	19.28	--	5,770.68
		3/31/2021	--	18.64	--	5,771.32
		6/14/2021	--	18.30	--	5,771.66
		9/24/2021	--	18.32	--	5,771.64
		12/3/2021	--	18.55	--	5,771.41
		3/1/2022	--	18.50	--	5,771.46
		6/7/2022	--	17.86	--	5,772.10
		9/29/2022	--	17.81	--	5,772.15
		12/8/2022	--	17.65	--	5,772.31
		3/2/2023	--	17.30	--	5,772.66
		6/16/2023	--	17.04	--	5,772.92
		9/14/2023	--	17.20	--	5,772.76
		12/14/2023	--	17.12	--	5,772.84
		3/27/2024	--	16.98	--	5,772.98
		6/3/2024	--	16.88	--	5,773.08
		9/25/2024	--	16.78	--	5,773.18
		12/10/2024	--	16.84	--	5,773.12
		3/21/2025	--	21.82	--	5,768.14
		6/16/2025	--	16.60	--	5,773.36
		9/16/2025	--	16.75	--	5,773.21

Notes:

AMSL: above mean sea level

BTOC: below top of casing

Trace: trace amounts of free product in well

--: not measured

A product density factor of 0.8 was used to account for the presence of free product



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW01	10/22/2018	No sample collected due to presence of PSH			
	3/29/2019	No sample collected due to presence of PSH			
	6/28/2019	No sample collected due to presence of PSH			
	9/17/2019	No sample collected due to presence of PSH			
	12/17/2019	No sample collected due to presence of PSH			
	3/12/2020	No sample collected due to presence of PSH			
	6/25/2020	No sample collected due to presence of PSH			
	9/23/2020	No sample collected due to presence of PSH			
	3/21/2021	No sample collected due to presence of PSH			
	6/14/2021	No sample collected due to presence of PSH			
	9/20/2021	27	39	1.3	15
	12/2/2021	No sample collected due to presence of PSH			
	3/1/2022	No sample collected due to presence of PSH			
	6/7/2022	No sample collected due to presence of PSH			
	9/29/2022	No sample collected due to presence of PSH			
	12/8/2022	No sample collected due to presence of PSH			
	3/2/2023	No sample collected due to presence of PSH			
	6/16/2023	No sample collected due to presence of PSH			
	9/15/2023	NS	NS	NS	NS
	12/14/2023	NS	NS	NS	NS
	3/27/2024	24	34	1.5	17
	6/4/2024	No sample collected due to presence of PSH			
	9/23/2024	No sample collected due to presence of PSH			
	12/10/2024	No sample collected due to presence of PSH			
	3/20/2025	No sample collected due to presence of PSH			
	6/16/2025	No sample collected due to presence of PSH			
	9/15/2025	No sample collected due to presence of PSH			
MW02	10/22/2018	14	7.1	1.2	12
	3/29/2019	No sample collected due to presence of PSH			
	6/28/2019	No sample collected due to presence of PSH			
	9/17/2019	No sample collected due to presence of PSH			
	12/17/2019	No sample collected due to presence of PSH			
	3/12/2020	17	8.2	1.8	15
	6/25/2020	19	18	2.3	21
	9/23/2020	17	16	2.8	25
	3/31/2021	16	12	2.0	20
	6/14/2021	No sample collected due to presence of PSH			
	9/20/2021	15	7.3	1.6	20
	12/3/2021	16	6.9	1.8	21
	3/1/2022	14	4.4	1.3	15
	6/7/2022	No sample collected due to presence of PSH			
	9/29/2022	16	2.6	1.6	16
	12/8/2022	16	2.5	1.9	18
	3/2/2023	No sample collected due to presence of PSH			
	6/16/2023	No sample collected due to presence of PSH			
	9/15/2023	NS	NS	NS	NS
	12/14/2023	NS	NS	NS	NS
	3/27/2024	14	3.6	0.33	6.8
	6/4/2024	No sample collected due to presence of PSH			
	9/23/2024	No sample collected due to presence of PSH			
	12/10/2024	No sample collected due to presence of PSH			
	3/20/2025	No sample collected due to presence of PSH			
	6/16/2025	No sample collected due to presence of PSH			
	9/15/2025	No sample collected due to presence of PSH			



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW03	10/22/2018	Insufficient Water Volumes to Collect Sample			
	3/29/2019	21	0.110	0.27	11
	6/28/2019	Insufficient Water Volumes to Collect Sample			
	9/17/2019	12	0.25	0.22	6.9
	12/17/2019	Insufficient Water Volumes to Collect Sample			
	3/12/2020	15	<0.20	0.47	6.3
	6/25/2020	14	0.11	0.51	1.5
	9/23/2020	14	0.57	0.46	3.5
	3/31/2021	13	1.3	0.48	1.7
	6/14/2021	12	1.8	0.37	4.9
	9/23/2021	13	4.2	0.34	8.2
	12/3/2021	16	2.3	0.54	5.5
	3/1/2022	16	2.2	0.59	6.0
	6/7/2022	16	2.6	0.70	6.6
	9/29/2022	17	1.0	0.66	6.4
	12/8/2022	17	1.0	0.73	6.8
	3/2/2023	17	1.1	0.65	5.6
	6/16/2023	16	1.8	0.68	6.2
	9/15/2023	18	1.0	0.65	5.8
	12/14/2023	NS	NS	NS	NS
	3/27/2024	9.2	5.5	<0.20	4.3
	6/4/2024	10	5.8	<0.50	4.4
	9/23/2024	No sample collected due to presence of PSH			
	12/10/2024	No sample collected due to presence of PSH			
	3/21/2025	No sample collected due to presence of PSH			
	6/16/2025	No sample collected due to presence of PSH			
	9/15/2025	No sample collected due to presence of PSH			
MW04	10/22/2018	Insufficient Water Volumes to Collect Sample			
	3/29/2019	Insufficient Water Volumes to Collect Sample			
	6/28/2019	Insufficient Water Volumes to Collect Sample			
	9/17/2019	Insufficient Water Volumes to Collect Sample			
	12/17/2019	Insufficient Water Volumes to Collect Sample			
	6/25/2020	Insufficient Water Volumes to Collect Sample			
	9/23/2020	Insufficient Water Volumes to Collect Sample			
	3/31/2021	1.1	<0.002	0.095	0.018
	6/14/2021	1.7	0.0035	0.11	0.020
	9/20/2021	0.83	0.045	0.051	0.14
	12/3/2021	1.3	<0.010	0.099	<0.020
	3/1/2022	0.91	<0.020	0.066	<0.040
	6/7/2022	0.24	<0.0010	<0.0010	<0.0020
	9/29/2022	1.5	<0.020	0.033	<0.030
	12/8/2022	No sample collected due to presence of PSH			
	3/2/2023	0.32	<0.008	<0.008	<0.016
	6/16/2023	No sample collected due to presence of PSH			
	9/15/2023	No sample collected due to presence of PSH			
	12/14/2023	No sample collected due to presence of PSH			
	3/27/2024	No sample collected due to presence of PSH			
	6/4/2024	0.31	<0.010	<0.010	<0.015
	9/23/2024	No sample collected due to presence of PSH			
	12/10/2024	No sample collected due to presence of PSH			
	3/21/2025	No sample collected due to presence of PSH			
	6/16/2025	No sample collected due to presence of PSH			
	9/15/2025	No sample collected due to presence of PSH			



TABLE 7
GROUNDWATER ANALYTICAL RESULTS

Standard #1

Hilcorp Energy Company
San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW05	10/22/2018	Insufficient Water Volumes to Collect Sample			
	3/29/2019	10	0.88	0.45	2.9
	6/28/2019	5.9	0.16	0.20	1.4
	9/17/2019	5.0	0.77	0.11	3.1
	12/17/2019	5.4	0.14	0.15	2.6
	3/12/2020	4.4	0.13	0.18	1.0
	6/25/2020	5.0	0.17	0.087	0.70
	9/23/2020	3.9	1.1	0.26	4.2
	3/31/2021	2.5	6.0	0.73	15
	6/14/2021	4.4	1.8	0.55	18
	9/20/2021	3.5	4.0	0.80	20
	12/3/2021	3.6	3.5	0.72	19
	3/1/2022	2.9	0.81	0.62	13
	6/7/2022	No sample collected due to presence of PSH			
	9/29/2022	No sample collected due to presence of PSH			
	12/8/2022	No sample collected due to presence of PSH			
	3/2/2023	No sample collected due to presence of PSH			
	6/16/2023	No sample collected due to presence of PSH			
	9/15/2023	No sample collected due to presence of PSH			
	12/14/2023	No sample collected due to presence of PSH			
	3/27/2024	No sample collected due to presence of PSH			
	6/3/2024	No sample collected due to presence of PSH			
	9/23/2024	No sample collected due to presence of PSH			
	12/10/2024	No sample collected due to presence of PSH			
	3/21/2025	No sample collected due to presence of PSH			
	6/16/2025	No sample collected due to presence of PSH			
	9/16/2025	No sample collected due to presence of PSH			
MW06	10/22/2018	No sample collected due to presence of PSH			
	3/29/2019	No sample collected due to presence of PSH			
	6/28/2019	No sample collected due to presence of PSH			
	9/17/2019	No sample collected due to presence of PSH			
	12/17/2019	No sample collected due to presence of PSH			
	3/12/2020	19	25	1.3	14
	6/25/2020	20	31	1.5	17
	9/23/2020	16	24	1.5	18
	3/31/2021	16	21	1.7	21
	9/24/2021	No sample collected due to presence of PSH			
	9/20/2021	14	19	1.3	16
	12/3/2021	13	19	1.3	17
	3/1/2022	13	20	1.3	18
	6/7/2022	11	15	1.1	16
	9/29/2022	No sample collected due to presence of PSH			
	12/8/2022	No sample collected due to presence of PSH			
	3/2/2023	No sample collected due to presence of PSH			
	6/16/2023	No sample collected due to presence of PSH			
	9/15/2023	No sample collected due to presence of PSH			
	12/14/2023	NS	NS	NS	NS
	3/27/2024	2.9	3.1	0.59	8.7
	6/3/2024	No sample collected due to presence of PSH			
	9/23/2024	No sample collected due to presence of PSH			
	12/10/2024	No sample collected due to presence of PSH			
	3/21/2025	No sample collected due to presence of PSH			
	6/16/2025	No sample collected due to presence of PSH			
	9/16/2025	No sample collected due to presence of PSH			



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW07	10/22/2018	Well Damaged, No Sample Collected			
	3/29/2019	Well Damaged, No Sample Collected			
	6/28/2019	Well Damaged, No Sample Collected			
	9/17/2019	Well Damaged, No Sample Collected			
	12/17/2019	Well Damaged, No Sample Collected			
	3/12/2020	Well Damaged, No Sample Collected			
	6/25/2020	Well Damaged, No Sample Collected			
	9/23/2020	Well Damaged, No Sample Collected			
	3/31/2021	Well Damaged, No Sample Collected			
	6/14/2021	Well Damaged, No Sample Collected			
	9/20/2021	Well Damaged, No Sample Collected			
	12/3/2021	Well Damaged, No Sample Collected			
	3/1/2022	Well Damaged, No Sample Collected			
	6/7/2022	Well Damaged, No Sample Collected			
	9/29/2022	Well Damaged, No Sample Collected			
	12/8/2022	Well Damaged, No Sample Collected			
	3/2/2023	Well Damaged, No Sample Collected			
	6/16/2023	Well Damaged, No Sample Collected			
	9/15/2023	Well Damaged, No Sample Collected			
	12/14/2023	Well Damaged, No Sample Collected			
	3/27/2024	Well Damaged, No Sample Collected			
	6/3/2024	Well Damaged, No Sample Collected			
	9/23/2024	Well Damaged, No Sample Collected			
	12/10/2024	Well Damaged, No Sample Collected			
	3/21/2025	Well Damaged, No Sample Collected			
	6/16/2025	Well Damaged, No Sample Collected			
	9/15/2025	Well Damaged, No Sample Collected			
MW08	10/22/2018	Insufficient Water Volumes to Collect Sample			
	3/29/2019	Insufficient Water Volumes to Collect Sample			
	6/28/2019	<0.0010	<0.0010	<0.0010	<0.0020
	9/17/2019	<0.0010	<0.0010	<0.0010	<0.0020
	3/12/2020	<0.0010	<0.0010	<0.0010	0.0017
	6/25/2020	<0.0010	<0.0010	<0.0010	<0.0015
	9/23/2020	<0.0010	<0.0010	<0.0010	<0.0015
	3/31/2021	<0.0010	<0.0010	<0.0010	<0.0015
	6/14/2021	<0.0010	<0.0010	<0.0010	<0.0015
	9/23/2021	<0.0010	<0.0010	<0.0010	<0.0020
	12/2/2021	<0.0010	<0.0010	<0.0010	<0.0020
	3/1/2022	<0.0010	<0.0010	<0.0010	<0.0020
	6/7/2022	<0.0010	<0.0010	<0.0010	<0.0020
	9/29/2022	<0.0010	<0.0010	<0.0010	<0.0015
	12/8/2022	<0.0010	<0.0010	<0.0010	<0.0015
	3/2/2023	<0.0010	<0.0010	<0.0010	<0.0020
	6/16/2023	<0.0010	<0.0010	<0.0010	<0.0020
	9/14/2023	<0.0010	<0.0010	<0.0010	<0.0020
	12/14/2023	<0.0010	<0.0010	<0.0010	<0.0020
	3/27/2024	<0.0010	<0.0010	<0.0010	<0.0015
	6/3/2024	<0.0010	<0.0010	<0.0010	<0.0015
	9/23/2024	<0.0010	<0.0010	<0.0010	<0.0015
	12/10/2024	<0.0010	<0.0010	<0.0010	<0.0015
	3/21/2025	No sample collected due to presence of PSH			
	6/17/2025	<0.0010	<0.0010	<0.0010	<0.0015
	9/16/2025	<0.0010	<0.0010	<0.0010	<0.0015



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW09	10/22/2018	Insufficient Water Volumes to Collect Sample			
	3/29/2019	Insufficient Water Volumes to Collect Sample			
	6/28/2019	Insufficient Water Volumes to Collect Sample			
	9/17/2019	Insufficient Water Volumes to Collect Sample			
	12/17/2019	Insufficient Water Volumes to Collect Sample			
	3/12/2020	Insufficient Water Volumes to Collect Sample			
	6/25/2020	Insufficient Water Volumes to Collect Sample			
	9/23/2020	Insufficient Water Volumes to Collect Sample			
	3/31/2021	Insufficient Water Volumes to Collect Sample			
	6/14/2021	Insufficient Water Volumes to Collect Sample			
	9/20/2021	Insufficient Water Volumes to Collect Sample			
	12/3/2021	Insufficient Water Volumes to Collect Sample			
	3/1/2022	Insufficient Water Volumes to Collect Sample			
	6/7/2022	Insufficient Water Volumes to Collect Sample			
	9/29/2022	Insufficient Water Volumes to Collect Sample			
	12/8/2022	Insufficient Water Volumes to Collect Sample			
	3/2/2023	Insufficient Water Volumes to Collect Sample			
	6/16/2023	0.021	0.027	0.0019	0.015
	9/15/2023	1.1	0.0036	0.078	1.4
	12/15/2023	1.1	<0.010	0.096	0.29
	3/28/2024	1.0	<0.010	0.087	<0.015
MW10	6/3/2024	Insufficient Water Volumes to Collect Sample			
	9/23/2024	Insufficient Water Volumes to Collect Sample			
	12/10/2024	Insufficient Water Volumes to Collect Sample			
	3/20/2025	1.1	<0.010	0.071	<0.015
	6/16/2025	0.94	<0.010	0.057	<0.015
	9/15/2025	0.87	<0.010	0.100	<0.015
	10/22/2018	22	21	1.6	13
	3/29/2019	No sample collected due to presence of PSH			
	6/28/2019	No sample collected due to presence of PSH			
	9/17/2019	No sample collected due to presence of PSH			
	12/17/2019	No sample collected due to presence of PSH			
	3/12/2020	No sample collected due to presence of PSH			
	6/25/2020	No sample collected due to presence of PSH			
	9/23/2020	No sample collected due to presence of PSH			
	3/31/2021	No sample collected due to presence of PSH			
	6/14/2021	No sample collected due to presence of PSH			
	9/23/2021	19	4.8	1.4	15
	12/3/2021	21	5.8	1.4	14
	3/1/2022	20	5.6	1.4	13
	6/7/2022	No sample collected due to presence of PSH			
	9/29/2022	No sample collected due to presence of PSH			
	12/8/2022	No sample collected due to presence of PSH			
	3/2/2023	No sample collected due to presence of PSH			
	6/16/2023	No sample collected due to presence of PSH			
	9/15/2023	No sample collected due to presence of PSH			
	12/14/2023	NS	NS	NS	NS
	3/27/2024	13	<0.5	1.4	7.8
	6/3/2024	Insufficient Water Volumes to Collect Sample			
	9/23/2024	No sample collected due to presence of PSH			
	12/10/2024	No sample collected due to presence of PSH			
	3/20/2025	No sample collected due to presence of PSH			
	6/16/2025	No sample collected due to presence of PSH			
	9/15/2025	No sample collected due to presence of PSH			



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW11	10/22/2018	<0.0010	<0.0010	<0.0010	<0.0015
	3/29/2019	0.0036	<0.0010	<0.0010	<0.0015
	6/28/2019	<0.0010	<0.0010	<0.0010	<0.0015
	9/17/2019	<0.0010	<0.0010	<0.0010	<0.002
	12/17/2019	NS	NS	NS	NS
	3/12/2020	0.001	0.0011	<0.0010	0.0051
	6/25/2020	<0.0010	<0.0010	<0.0010	<0.0015
	9/23/2020	<0.0010	<0.0010	<0.0010	<0.0015
	3/31/2021	<0.0010	<0.0010	<0.0010	<0.0015
	6/14/2021	<0.0010	<0.0010	<0.0010	<0.0015
	9/23/2021	<0.0010	<0.0010	<0.0010	<0.002
	12/2/2021	<0.0010	<0.0010	<0.0010	<0.002
	3/1/2022	<0.0010	<0.0010	<0.0010	<0.002
	6/7/2022	<0.0010	<0.0010	<0.0010	<0.002
	9/29/2022	<0.0010	<0.0010	<0.0010	<0.0015
	12/8/2022	<0.0010	<0.0010	<0.0010	<0.0015
	3/2/2023	<0.0010	<0.0010	<0.0010	<0.0020
	6/16/2023	<0.0010	<0.0010	<0.0010	<0.0020
	9/14/2023	<0.0010	<0.0010	<0.0010	<0.0020
	12/14/2023	<0.0010	<0.0010	<0.0010	<0.0020
	3/28/2024	<0.0010	<0.0010	<0.0010	<0.0015
	6/3/2024	<0.0010	<0.0010	<0.0010	<0.0015
	9/23/2024	<0.0010	<0.0010	<0.0010	<0.0015
	12/9/2024	<0.0010	<0.0010	<0.0010	<0.0015
	3/21/2025	<0.0010	0.0033	<0.0010	0.0022
	6/16/2025	<0.0010	<0.0010	<0.0010	<0.0015
	9/16/2025	<0.0010	<0.0010	<0.0010	<0.0015
MW12	10/22/2018	2.4	3.8	1.1	5.0
	3/29/2019	0.87	0.018	1.2	1.5
	6/28/2019	0.81	0.055	1.0	0.50
	9/17/2019	0.92	0.12	1.1	0.41
	12/17/2019	0.94	0.034	0.46	0.24
	3/12/2020	1.6	0.360	0.48	0.55
	6/25/2020	0.71	0.220	<0.02	0.34
	9/23/2020	0.89	0.087	0.22	0.12
	3/31/2021	0.69	0.051	0.14	0.054
	6/14/2021	0.37	0.0052	0.072	0.012
	12/2/2021	NS	NS	NS	NS
	12/2/2021	0.37	<0.0050	0.110	<0.010
	3/1/2022	0.24	<0.0020	0.031	<0.0040
	6/7/2022	0.11	<0.0010	0.016	0.0030
	9/29/2022	0.046	<0.0050	0.014	<0.0075
	12/8/2022	0.041	<0.020	<0.020	<0.030
	3/2/2023	0.043	0.0010	0.0036	0.0032
	6/16/2023	0.052	<0.0010	0.0057	0.0029
	9/14/2023	0.048	<0.0010	0.0056	<0.0020
	12/14/2023	0.0053	<0.0010	0.0011	<0.0020
	3/28/2024	0.036	<0.0010	<0.0010	<0.0015
	6/3/2024	0.0093	<0.0020	<0.0020	<0.0030
	9/23/2024	0.015	<0.0010	<0.0010	<0.0015
	12/9/2024	0.0066	<0.0010	0.0043	0.0095
	3/21/2025	0.022	0.0017	0.0042	0.0160
	6/17/2025	0.0065	<0.0010	0.0042	0.0250
	9/16/2025	0.013	<0.0010	0.0033	0.0094



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW14	10/22/2018	13	26	1.1	10
	3/29/2019	No sample collected due to presence of PSH			
	6/28/2019	No sample collected due to presence of PSH			
	9/17/2019	No sample collected due to presence of PSH			
	12/17/2019	NS	NS	NS	NS
	3/12/2020	13	13	1.3	14
	6/25/2020	11	17	1.0	15
	9/23/2020	8.2	14	0.80	16
	3/31/2021	9.4	17	1.5	18
	6/14/2021	No sample collected due to presence of PSH			
	9/24/2021	7.1	9.2	0.80	14
	12/3/2021	6.5	7.6	1.2	15
	3/1/2022	5.3	5.7	1.2	14
	6/7/2022	No sample collected due to presence of PSH			
	9/29/2022	4.3	1.3	1.1	6.3
	12/8/2022	3.8	1.8	1.6	9.5
	3/2/2023	No sample collected due to presence of PSH			
	6/16/2023	No sample collected due to presence of PSH			
	9/15/2023	No sample collected due to presence of PSH			
	12/14/2023	No sample collected due to presence of PSH			
	3/28/2024	No sample collected due to presence of PSH			
	6/3/2024	No sample collected due to presence of PSH			
	9/23/2024	No sample collected due to presence of PSH			
	12/9/2024	No sample collected due to presence of PSH			
	3/21/2025	No sample collected due to presence of PSH			
	6/16/2025	No sample collected due to presence of PSH			
	9/15/2025	No sample collected due to presence of PSH			
MW15	3/29/2019	Insufficient Water Volumes to Collect Sample			
	6/28/2019	24	28	1.1	10
	9/17/2019	24	28	0.87	9.4
	12/17/2019	23	29	0.64	10
	3/12/2020	23	4.5	0.66	9.4
	6/25/2020	28	1.0	0.47	8.6
	9/23/2020	21	1.2	0.61	8.6
	3/31/2021	25	0.6	0.69	8.5
	6/14/2021	26	0.42	0.60	8.9
	9/23/2021	22	0.82	0.57	6.6
	12/3/2021	24	1.0	0.56	4.1
	3/1/2022	23	3.4	0.65	4.4
	6/7/2022	22	3.9	0.50	2.9
	9/29/2022	24	7.5	0.64	4.6
	12/8/2022	25	4.9	0.54	4.8
	3/2/2023	21	6.0	0.61	4.6
	6/16/2023	21	7.6	0.47	3.5
	9/14/2023	29	10	0.59	4.3
	12/14/2023	NS	NS	NS	NS
	3/27/2024	14	1.0	<0.500	1.8
	6/4/2024	9.8	1.9	0.140	1.5
	9/25/2024	20	6.5	<0.500	2.7
	12/9/2024	No sample collected due to presence of PSH			
	3/21/2025	No sample collected due to presence of PSH			
	6/16/2025	No sample collected due to presence of PSH			
	9/16/2025	No sample collected due to presence of PSH			



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW16	3/29/2019	7.7	14	0.94	8.6
	6/28/2019	3.4	0.62	0.080	2.1
	9/17/2019	3.3	1.6	0.037	4.4
	12/17/2019	2.3	0.23	0.039	1.8
	3/12/2020	2.3	0.83	<0.050	3.8
	6/25/2020	2.1	0.34	0.051	3.3
	9/23/2020	1.4	0.23	0.075	3.6
	3/31/2021	No sample collected due to presence of PSH			
	6/14/2021	No sample collected due to presence of PSH			
	9/23/2021	0.32	0.62	0.71	17
	12/3/2021	No sample collected due to presence of PSH			
	3/1/2022	0.56	<0.020	0.43	6.4
	6/7/2022	0.29	<0.010	0.54	6.5
	9/29/2022	No sample collected due to presence of PSH			
	12/8/2022	0.15	<0.050	0.38	2.1
	3/2/2023	0.11	<0.020	0.32	1.8
	6/16/2023	0.10	<0.050	0.34	1.1
	9/14/2023	0.13	<0.050	0.41	1.2
	12/15/2023	0.089	<0.020	0.38	0.49
	3/28/2024	0.077	<0.020	0.34	0.31
	6/3/2024	0.068	<0.010	0.27	0.27
	9/25/2024	0.13	<0.020	0.28	0.085
	12/9/2024	0.062	<0.020	0.21	0.077
	3/20/2025	0.093	<0.020	0.140	0.110
	6/17/2025	0.043	<0.020	0.078	<0.030
	9/15/2025	0.081	<0.020	0.130	<0.030
MW17	3/29/2019	Insufficient Water Volumes to Collect Sample			
	6/28/2019	Insufficient Water Volumes to Collect Sample			
	9/17/2019	Insufficient Water Volumes to Collect Sample			
	12/17/2019	Insufficient Water Volumes to Collect Sample			
	3/12/2020	Insufficient Water Volumes to Collect Sample			
	6/25/2020	Insufficient Water Volumes to Collect Sample			
	9/23/2020	Insufficient Water Volumes to Collect Sample			
	3/31/2021	Insufficient Water Volumes to Collect Sample			
	6/14/2021	Insufficient Water Volumes to Collect Sample			
	9/23/2021	Insufficient Water Volumes to Collect Sample			
	12/3/2021	Insufficient Water Volumes to Collect Sample			
	3/1/2022	Insufficient Water Volumes to Collect Sample			
	6/7/2022	Insufficient Water Volumes to Collect Sample			
	9/29/2022	Insufficient Water Volumes to Collect Sample			
	12/8/2022	Insufficient Water Volumes to Collect Sample			
	3/2/2023	<0.002	<0.002	<0.002	<0.004
	6/16/2023	<0.0010	<0.0010	<0.0010	<0.0020
	9/14/2023	<0.0010	<0.0010	<0.0010	<0.0020
	12/15/2023	<0.0010	<0.0010	<0.0010	<0.0020
	3/27/2024	<0.0010	<0.0010	<0.0010	<0.0015
	6/3/2024	<0.0010	<0.0010	<0.0010	<0.0015
	9/25/2024	<0.0010	<0.0010	<0.0010	<0.0015
	12/9/2024	<0.0010	<0.0010	<0.0010	<0.0015
	3/20/2025	<0.0010	<0.0010	<0.0010	<0.0015
	6/16/2025	<0.0020	<0.0020	<0.0020	<0.0030
	9/15/2025	<0.0010	<0.0010	<0.0010	<0.0015



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW18	3/29/2019	No sample collected due to presence of PSH			
	6/28/2019	15	18	0.77	9.4
	9/17/2019	16	23	0.87	9.8
	12/17/2019	17	19	0.78	10
	3/12/2020	1.2	0.36	0.059	0.72
	6/25/2020	13	<0.2	0.56	6.0
	9/23/2020	8.4	<0.05	0.32	4.2
	3/31/2021	11	0.011	0.31	1.7
	6/14/2021	8.5	<.01	0.28	0.62
	9/24/2021	5.3	<0.050	0.37	<0.100
	12/2/2021	9.9	<0.0020	0.61	<0.0040
	3/1/2022	8.0	<0.008	0.45	<0.016
	6/7/2022	6.6	<0.010	0.38	<0.020
	9/29/2022	6.4	<0.020	0.35	<0.030
	12/8/2022	6.7	<0.050	0.36	<0.075
	3/2/2023	4.2	<0.020	0.19	<0.040
	6/16/2023	1.5	<0.020	0.052	<0.040
	9/14/2023	5.9	<0.050	0.28	<0.100
	12/14/2023	5.5	<0.020	0.33	<0.040
	3/27/2024	0.067	<0.020	0.15	<0.030
	6/3/2024	1.4	<0.010	0.27	<0.015
	9/25/2024	0.084	<0.020	<0.020	<0.030
	12/9/2024	0.041	<0.020	<0.020	0.0042
	3/21/2025	0.44	<0.0050	<0.0050	<0.0075
	6/17/2025	0.56	<0.020	<0.020	<0.030
	9/16/2025	0.29	<0.0050	<0.0050	<0.0075
MW19	3/29/2019	14	10	0.93	6.2
	6/28/2019	13	0.230	0.90	4.9
	9/17/2019	17	0.44	1.1	5.8
	12/17/2019	11	0.88	0.76	3.4
	3/12/2020	10	1.60	0.76	2.4
	6/25/2020	16	5.40	0.95	3.4
	9/23/2020	12	4.10	0.73	2.8
	3/31/2021	16	8.5	1.1	4.7
	6/14/2021	15	10	1.0	5.1
	9/23/2021	14	9.9	1.1	4.8
	12/2/2021	15	10	1.1	5.2
	3/1/2022	13	9.6	1.1	5.2
	6/7/2022	12	10	1.1	5.4
	9/29/2022	13	12	1.1	6.2
	12/8/2022	12	14	1.3	7.8
	3/2/2023	10	12	1.0	6.1
	6/16/2023	10	14	1.2	7.2
	9/14/2023	9.7	15	1.2	8.2
	12/14/2023	7.7	14	1.3	8.1
	3/28/2024	6.7	17	1.1	9.2
	6/3/2024	5.8 P2	17 P2	0.4 P2	8.8 P2
	9/25/2024	6.5	13	1.1	8.7
	12/10/2024	5.2	18	1.3	9.5
	3/21/2025	6.0	18	1.2	9.9
	6/16/2025	5.1	16	0.99	9.1
	9/15/2025	4.4	16	1.3	9.7



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW22	3/29/2019	0.001	0.002	<0.001	0.002
	6/28/2019	<0.001	<0.001	<0.001	<0.002
	9/17/2019	<0.001	<0.001	<0.001	<0.002
	12/17/2019	NS	NS	NS	NS
	3/12/2020	0.0011	0.0012	<0.001	0.0067
	6/25/2020	<0.001	<0.001	<0.001	0.0032
	9/23/2020	<0.001	<0.001	<0.001	<0.0015
	3/31/2021	<0.001	<0.001	<0.001	<0.0015
	6/14/2021	<0.001	<0.001	<0.001	<0.0015
	9/23/2021	<0.001	<0.001	<0.001	<0.002
	12/2/2021	<0.001	<0.001	<0.001	<0.002
	3/1/2022	<0.001	<0.001	<0.001	<0.002
	6/7/2022	<0.001	<0.001	<0.001	<0.002
	9/29/2022	<0.001	<0.001	<0.001	<0.0015
	12/8/2022	<0.002	<0.002	<0.002	<0.003
	3/2/2023	<0.002	<0.002	<0.002	<0.004
	6/16/2023	<0.0020	<0.0020	<0.0020	<0.0040
	9/14/2023	<0.0010	<0.0010	<0.0010	<0.0020
	12/14/2023	<0.0010	<0.0010	<0.0010	<0.0020
	3/28/2024	<0.0010	<0.0010	<0.0010	<0.0015
	6/3/2024	<0.0010	<0.0010	<0.0010	<0.0015
	9/23/2024	<0.0010	<0.0010	<0.0010	<0.0015
	12/9/2024	<0.0010	<0.0010	<0.0010	<0.0015
	3/21/2025	<0.0010	<0.0010	<0.0010	<0.0015
	6/16/2025	<0.0010	<0.0010	<0.0010	<0.0015
	9/16/2025	<0.0010	<0.0010	<0.0010	<0.0015
MW23	6/18/2019	<0.001	<0.001	<0.001	<0.002
	9/17/2019	<0.001	<0.001	<0.001	<0.002
	12/17/2019	NS	NS	NS	NS
	3/12/2020	<0.001	<0.001	<0.001	<0.0015
	6/25/2020	<0.001	<0.001	<0.001	<0.0015
	9/23/2020	<0.001	<0.001	<0.001	<0.0015
	3/31/2021	<0.001	<0.001	<0.001	<0.0015
	6/14/2021	<0.001	<0.001	<0.001	<0.0015
	9/23/2021	Insufficient Water Volumes to Collect Sample			
	12/3/2021	<0.001	<0.001	<0.001	<0.002
	3/1/2022	<0.001	<0.001	<0.001	<0.002
	6/7/2022	<0.001	<0.001	<0.001	<0.002
	9/29/2022	<0.001	<0.001	<0.001	<0.0015
	12/8/2022	<0.002	<0.002	<0.002	<0.003
	3/2/2023	<0.002	<0.002	<0.002	<0.004
	6/16/2023	<0.0020	<0.0020	<0.0020	<0.0040
	9/15/2023	<0.001	<0.001	<0.001	<0.002
	12/14/2023	<0.001	<0.001	<0.001	<0.002
	3/27/2024	<0.001	<0.001	<0.001	<0.0015
	6/3/2024	<0.001	<0.001	<0.001	<0.0015
	9/25/2024	<0.0010	<0.0010	<0.0010	<0.0015
	12/10/2024	<0.0010	<0.0010	<0.0010	<0.0015
	3/21/2025	<0.0010	<0.0010	<0.0010	<0.0015
	6/16/2025	<0.0010	<0.0010	<0.0010	<0.0015
	9/16/2025	<0.0010	<0.0010	<0.0010	<0.0015



TABLE 7
GROUNDWATER ANALYTICAL RESULTS
 Standard #1
 Hilcorp Energy Company
 San Juan County, New Mexico

Monitoring Well	Date	Benzene (mg/L)	Toluene (mg/L)	Ethylbenzene (mg/L)	Total Xylenes (mg/L)
NMWQCC Standard		0.005	1.0	0.7	0.62
MW26	6/18/2019	0.0052	<0.001	<0.001	<0.002
	9/17/2019	<0.001	<0.001	<0.001	<0.002
	12/17/2019	<0.001	<0.001	<0.001	<0.002
	3/12/2020	<0.001	<0.001	<0.001	<0.0015
	6/25/2020	<0.001	<0.001	<0.001	<0.0015
	9/23/2020	<0.001	<0.001	<0.001	<0.0015
	3/31/2021	<0.001	<0.001	<0.001	<0.0015
	6/14/2021	<0.001	<0.001	<0.001	<0.0015
	9/24/2021	<0.001	<0.001	<0.001	<0.002
	12/3/2021	<0.001	<0.001	<0.001	<0.002
	3/1/2022	<0.001	<0.001	<0.001	<0.002
	6/7/2022	<0.001	<0.001	<0.001	<0.002
	9/29/2022	<0.001	<0.001	<0.001	<0.0015
	12/8/2022	<0.001	<0.001	<0.001	<0.0015
	3/2/2023	<0.001	<0.001	<0.001	<0.002
	6/16/2023	<0.0010	<0.0010	<0.0010	<0.0020
	9/14/2023	<0.0010	<0.0010	<0.0010	<0.0020
	12/14/2023	<0.0010	<0.0010	<0.0010	<0.0020
	3/27/2024	<0.0010	<0.0010	<0.0010	<0.0015
	6/3/2024	<0.0010	<0.0010	<0.0010	<0.0015
	9/25/2024	<0.0010	<0.0010	<0.0010	<0.0015
	12/10/2024	<0.0010	<0.0010	<0.0010	<0.0015
	3/20/2025	Insufficient Water Volumes to Collect Sample			
	6/17/2025	<0.0010	<0.0010	<0.0010	<0.0015
	9/16/2025	<0.0010	<0.0010	<0.0010	<0.0015

Notes:

Wells MW13, MW20, MW21, MW24, and MW25 have been dry since installation and are not included in this table

mg/L: milligrams per liter

NMWQCC: New Mexico Water Quality Control Commission


NS: not sampled


P2: sample received with pH > 2

PSH: phase separated hydrocarbon

<: indicates result less than the stated laboratory reporting limit (RL)

Concentrations in bold and shaded exceed the New Mexico Water Quality Control Commission Standards, 20.6.2 of the New Mexico Administrative Code

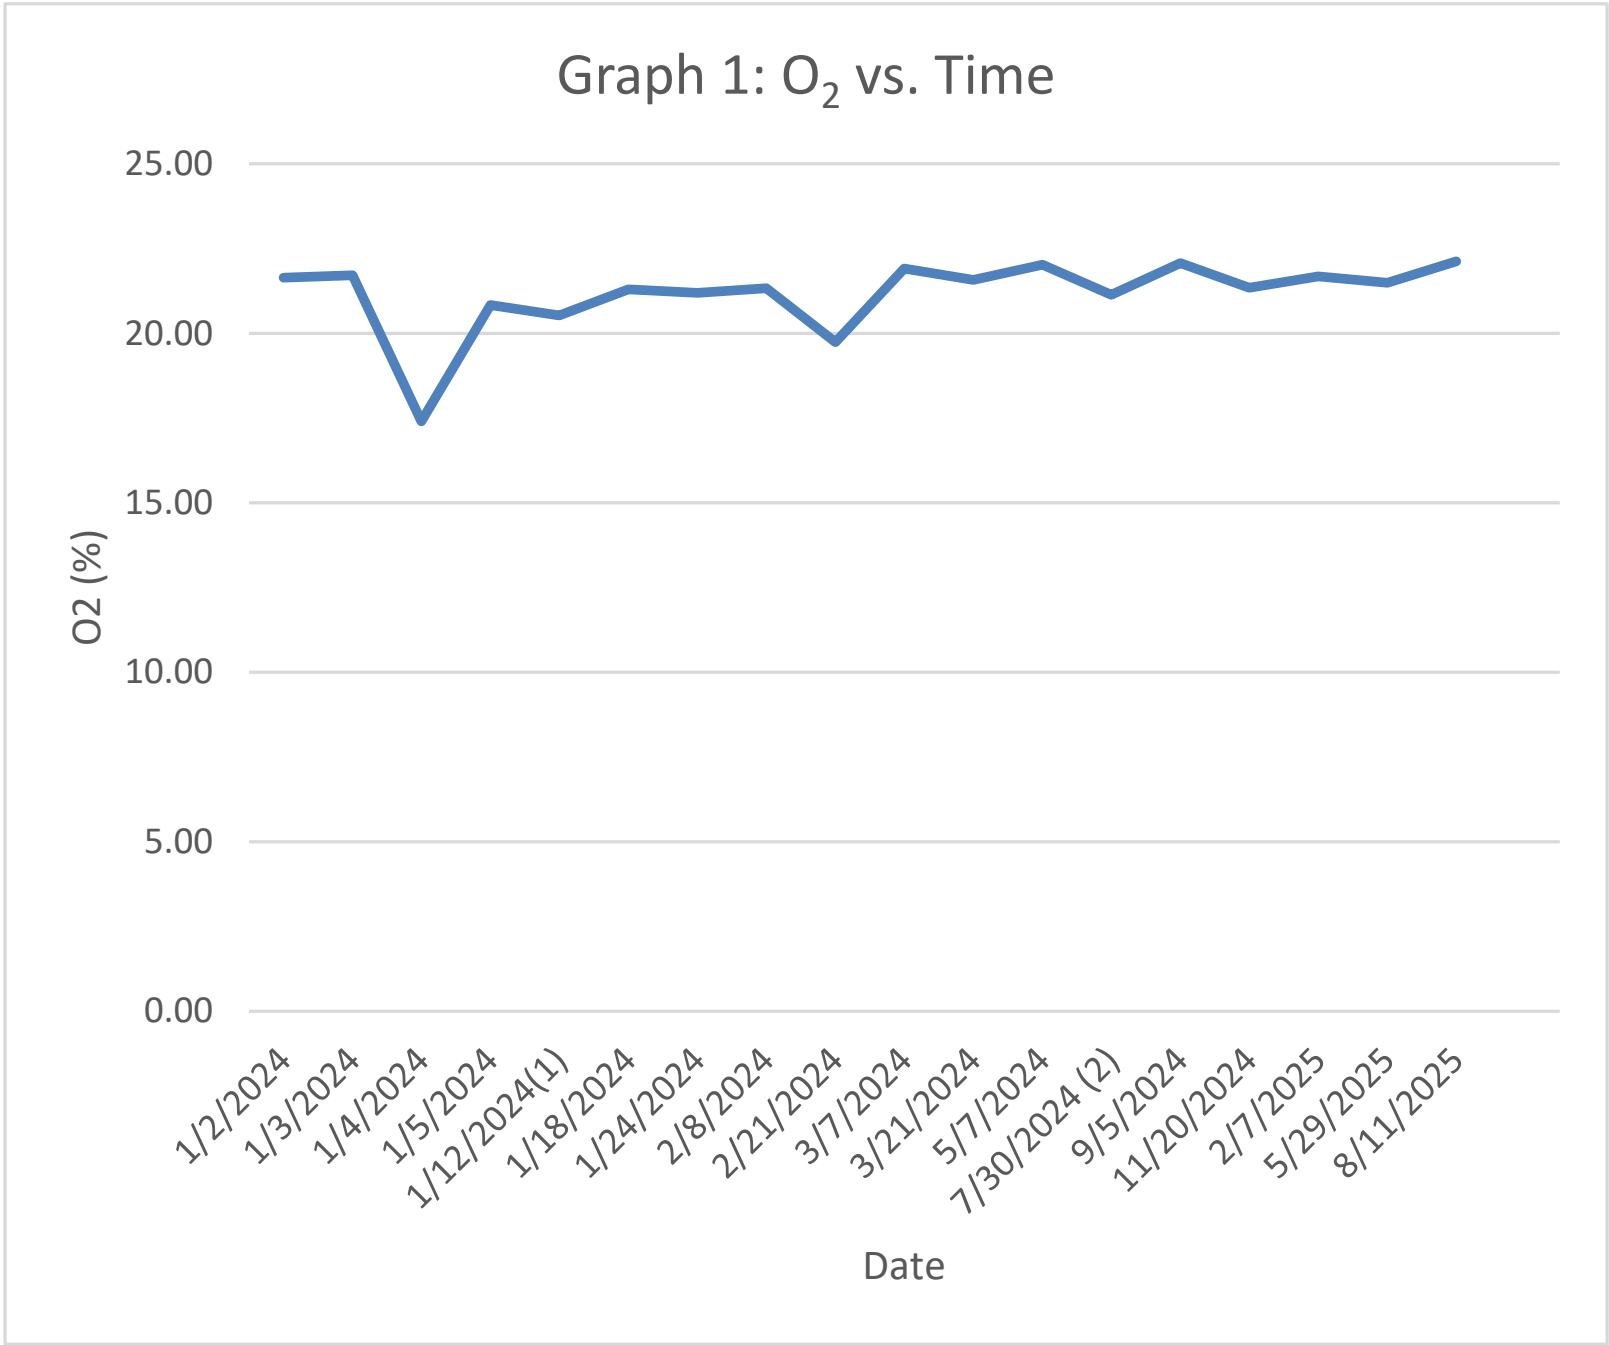

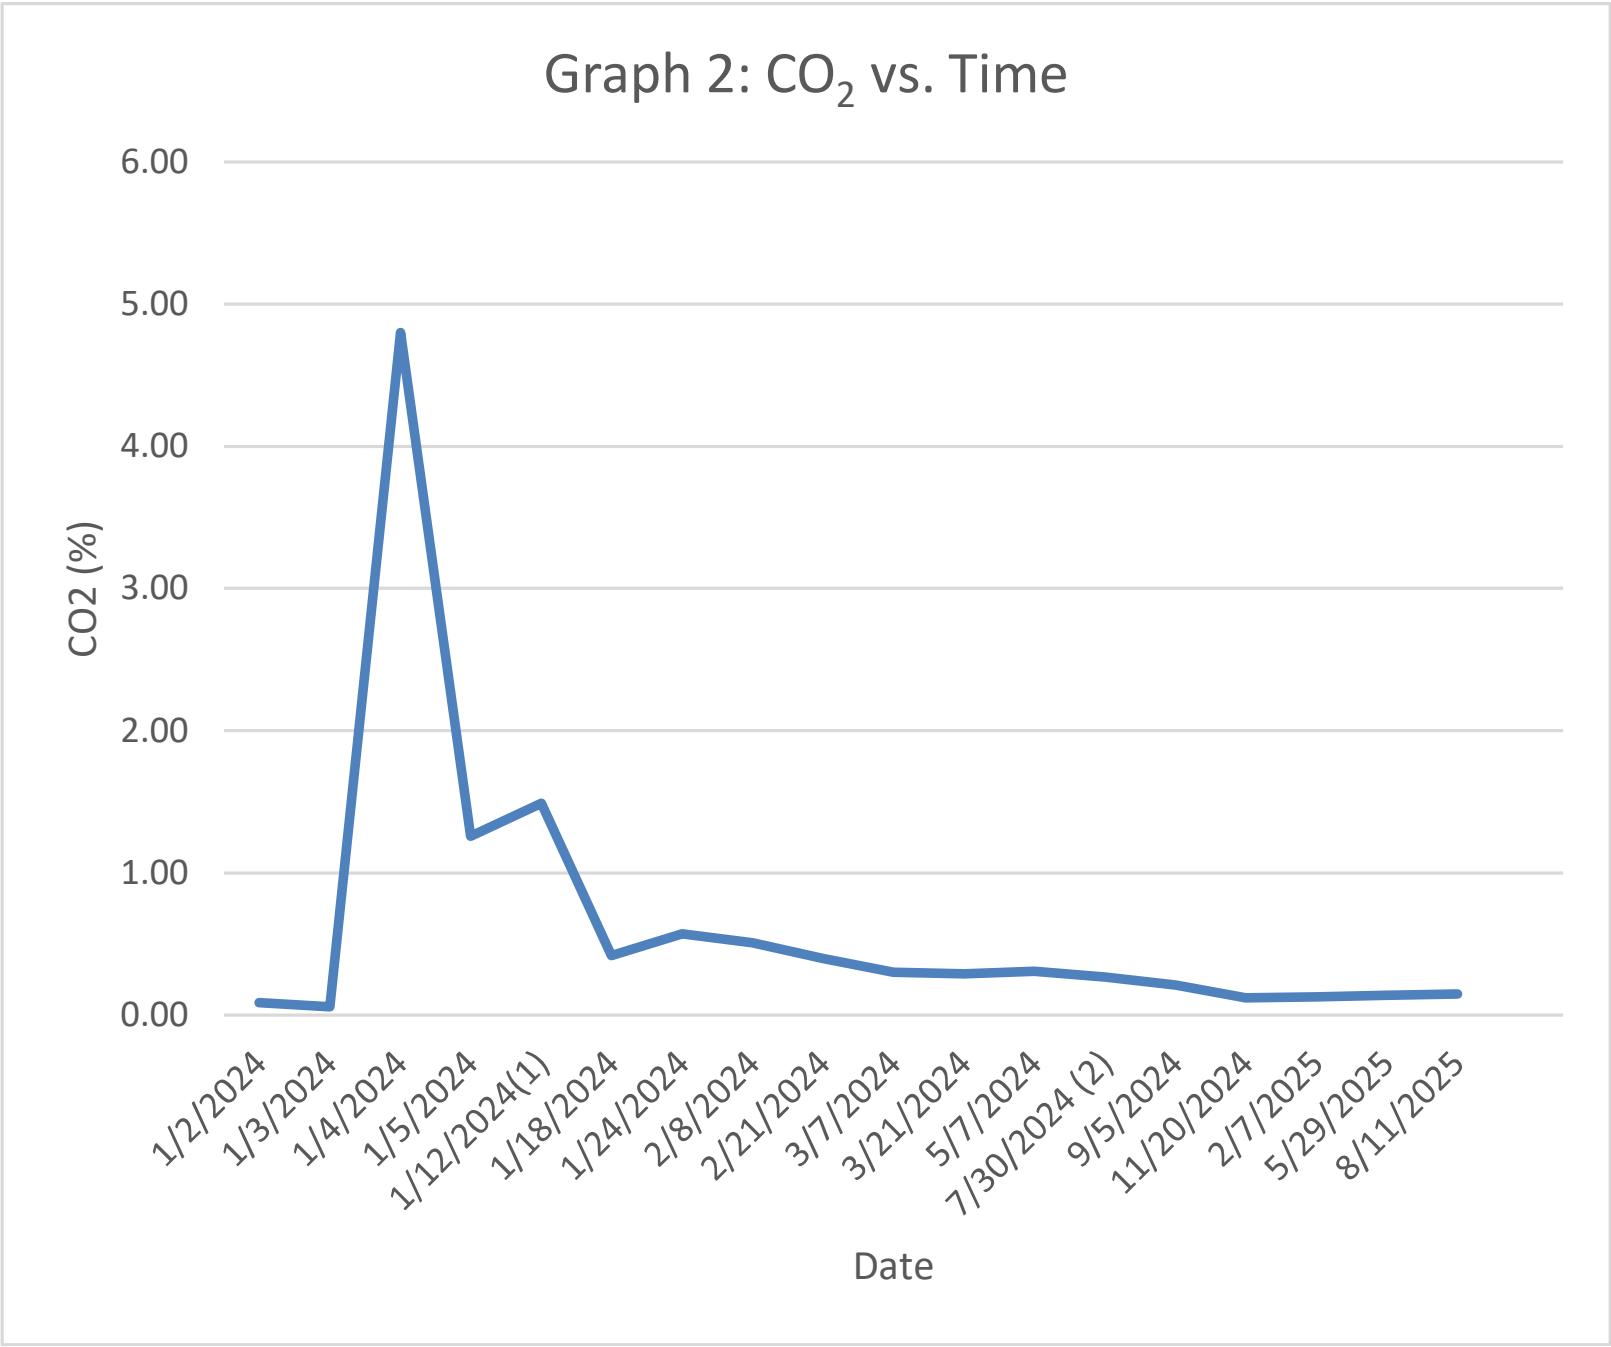



APPENDIX A

O&M Field Notes



STANDARD 1A DPE SYSTEM
O&M FORM

DATE: 7-8
TIME ONSITE: _____

O&M PERSONNEL: B Sinclair
TIME OFFSITE: _____

SVE SYSTEM - MONTHLY O&M

DPE ALARMS: KO TANK HIGH LEVEL

BI-MONTHLY MAINTENANCE, MUST BE PERFORMED/CHECKED TWICE PER MONTH

DPE SYSTEM	READING	TIME	NOTES
Blower Hours (photo)	11822.3	1025	
Transfer Pump Hours (photo)	321.5		
Influent Vacuum Pre-KO (InHg)	1.2		
Fresh Air Bypass (% Open)	15		
Pre-Filter Vacuum (InHg)	19.5		
Post-Filter Vacuum (InHg)	18.0		
Differential Pressure (IWC)	1.0		
Exhaust Temperature (°F)	26.5		
Exhaust PID (ppm)	4.5		
Transfer Pump Pressure (PSI)	10.5		
Transfer Pump Totalizer (Gal) (photo)	145573.0		

Check filter for moisture	Condition:
Is replacement filter needed?	
Remove and Clean Float Assembly	Condition:
Clean Wye Strainer	Condition:
Muffler Drain Plug Check, Check Scale	Condition:
Add Chemical Pellets (once per month)	Date performed:

SVE SYSTEM SAMPLING

SAMPLE ID:			SAMPLE TIME:	
PID (ppm)	7.3	OXYGEN (%)	20.7	
Analytes:	Sample Quarterly for TVPH (8015), 8260 - Full List VOCs, Fixed Gas (CO2 AND O2)			CARBON DIOXIDE (%) <u>ppm</u> 1980
OPERATING WELLS				

Change in Well Operation: _____

MONTHLY O&M MEASUREMENT

WELLHEAD MEASUREMENTS

WELL ID	VACUUM (IWC)	PID HEADSPACE (PPM)	OXYGEN (%)	CARBON DIOXIDE (%)
MW01	102.2	4.9	20.9	1200
MW02	128.7	15.8	20.9	1000
MW03	143.1	32.7	20.9	620
MW06	127.5	2.4	20.7	500
MW10	119.2	8.9	20.9	1020
MW15	103.2	22.6	20.8	5480

MANIFOLD MEASUREMENTS

WELL ID	VACUUM (InHg)	SEE LIQUIDS? (YES/NO)	DIFF. PRESS. (IWC)
MW01	7.75	N	0.43
MW02	11.75		-45.8
MW03	8.25		0.05
MW06	11.0		0.07
MW10	12.5		0.02
MW15	10.0		-29.3

COMMENTS/MAINTENANCE ISSUES

INFLUENCE WELL ID	VACUUM (IWC)
MW04	0
MW07	0

Location Standard #1 Date 7/24/25
Project / Client Deep Clean /

- 1000 Ozone, JST, PPE
Check power and float tube. Flush KO tank
Flush line from stingers. Attempt to clean
Rotameters. 2 cracked
- 1200 P/u repair parts and solution/acid.
"Marriage" sealing off KO tank. Shut down vacuum
Set repair to cure. Pull diff valves to sock
Pull and clean floats. @ Flush and clean KO
tank. Clear Y-green. Check pulley
Flush lines from stingers. Flush/clean KO
tank.
- Power On, check vac and liquids in lines.
MW 2, 3, 4 still flooded, NO good vac readings
Flushed lines, system back ON
Noted sealed/glued tubes, NO clear s/c on
Float DISCO
- 1730 Finished, offsite, Back to SR

STANDARD 1A DPE SYSTEM
O&M FORM

DATE: 8-11

TIME ONSITE:

O&M PERSONNEL: B Sinclair

TIME OFFSITE:

SVE SYSTEM - MONTHLY O&M

DPE ALARMS:

KO TANK HIGH LEVEL

BI-MONTHLY MAINTENANCE, MUST BE PERFORMED/CHECKED TWICE PER MONTH

DPE SYSTEM	READING	TIME	NOTES
Blower Hours (photo)	12628.6	1159	
Transfer Pump Hours (photo)	322.8		
Influent Vacuum Pre-KO (InHg)	1.2		
Fresh Air Bypass (% Open)	1.5		
Pre-Filter Vacuum (InHg)	16.5		
Post-Filter Vacuum (InHg)	15.0		
Differential Pressure (IWC)	0.25		
Exhaust Temperature (°F)	22.5		
Exhaust PID (ppm)	4.8		
Transfer Pump Pressure (PSI)	1.5		
Transfer Pump Totalizer (Gal) (photo)	147354.5		

Check filter for moisture	Condition:
Is replacement filter needed?	
Remove and Clean Float Assembly	Condition:
Clean Wye Strainer	Condition:
Muffler Drain Plug Check, Check Scale	Condition:
Add Chemical Pellets (once per month)	Date performed:

SVE SYSTEM SAMPLING

SAMPLE ID: SVE-1

PID (ppm) 7.2

Analytes: Sample Quarterly for TVPH (8015), 8260 - Full List VOCs, Fixed Gas (CO2 AND O2)

SAMPLE TIME: 1215

CARBON DIOXIDE (%) 920

OPERATING WELLS

Change in Well Operation:

MONTHLY O&M MEASUREMENT

WELLHEAD MEASUREMENTS

WELL ID	VACUUM (IWC)	PID HEADSPACE (PPM)	OXYGEN (%)	CARBON DIOXIDE (%)
MW01	14.89	4.8	20.5	760
MW02	-	-	-	-
MW03	-	-	-	-
MW06	-	-	-	-
MW10	68.6	6.0	20.7	1080
MW15	-	-	-	-

MANIFOLD MEASUREMENTS

WELL ID	VACUUM (InHg)	SEE LIQUIDS? (YES/NO)	DIFF. PRESS. (IWC)
MW01	5.25	N	2.74
MW02	10.0		0.04
MW03	0.0		0.0
MW06	2.0		0.0
MW10	10.75		0.01
MW15	2.0		2.42

INFLUENCE

WELL ID	VACUUM (IWC)
MW04	0
MW07	0

COMMENTS/MAINTENANCE ISSUES

No vacuum on most wells.
• Blower emanating high-pitched sound
• Noise ameliorated by cleaning dust from air filter

STANDARD 1A DPE SYSTEM
O&M FORM

DATE: 8-26
TIME ONSITE: _____

O&M PERSONNEL: B Sinclair
TIME OFFSITE: _____

SVE SYSTEM - MONTHLY O&M

DPE ALARMS: KO TANK HIGH LEVEL

BI-MONTHLY MAINTENANCE, MUST BE PERFORMED/CHECKED TWICE PER MONTH

DPE SYSTEM	READING	TIME	NOTES
Blower Hours (photo)	<u>12987.7</u>	<u>1157</u>	
Transfer Pump Hours (photo)	<u>1322.9</u>		
Influent Vacuum Pre-KO (InHg)	<u>8</u>		
Fresh Air Bypass (% Open)	<u>20</u>		
Pre-Filter Vacuum (InHg)	<u>16.75</u>		
Post-Filter Vacuum (InHg)	<u>15.25</u>		
Differential Pressure (IWC)	<u>0</u>		
Exhaust Temperature (°F)	<u>23.5</u>		
Exhaust PID (ppm)	<u>4.1</u>		
Transfer Pump Pressure (PSI)	<u>18</u>		
Transfer Pump Totalizer (Gal) (photo)	<u>147523.8</u>		

Check filter for moisture	Condition: _____
Is replacement filter needed?	
Remove and Clean Float Assembly	Condition: _____
Clean Wye Strainer	Condition: _____
Muffler Drain Plug Check, Check Scale	Condition: _____
Add Chemical Pellets (once per month)	Date performed: _____

SVE SYSTEM SAMPLING

SAMPLE ID:	SAMPLE TIME:	
PID (ppm) 7.6	OXYGEN (%) 20.9	CARBON DIOXIDE (%) 540
Analytes:	Sample Quarterly for TVPH (8015), 8260 - Full List VOCs, Fixed Gas (CO2 AND O2)	
OPERATING WELLS		

Change in Well Operation: _____

MONTHLY O&M MEASUREMENT

WELLHEAD MEASUREMENTS

WELL ID	VACUUM (IWC)	PID HEADSPACE (PPM)	OXYGEN (%)	CARBON DIOXIDE (%)
MW01	<u>1.17</u>	<u>11.8</u>	<u>20.9</u>	<u>220</u>
MW02	<u>-</u>	<u>-</u>	<u>-</u>	<u>-</u>
MW03	<u>-</u>	<u>-</u>	<u>-</u>	<u>-</u>
MW06	<u>-</u>	<u>-</u>	<u>-</u>	<u>-</u>
MW10	<u>38.6</u>	<u>53.5</u>	<u>20.9</u>	<u>1420</u>
MW15	<u>-</u>	<u>-</u>	<u>-</u>	<u>-</u>


MANIFOLD MEASUREMENTS

WELL ID	VACUUM (InHg)	SEE LIQUIDS? (YES/NO)	DIFF. PRESS. (IWC)
MW01	<u>1.5</u>	<u>N</u>	<u>1.24</u>
MW02	<u>3.75</u>	<u>N</u>	<u>0.10</u>
MW03	<u>1.0</u>	<u>N</u>	<u>0.0</u>
MW06	<u>4.25</u>	<u>N</u>	<u>0.0</u>
MW10	<u>3.0</u>	<u>N</u>	<u>0.03</u>
MW15	<u>1.5</u>	<u>N</u>	<u>0.57</u>

COMMENTS/MAINTENANCE ISSUES

INFLUENCE

WELL ID	VACUUM (IWC)
MW04	<u>0</u>
MW07	<u>0</u>

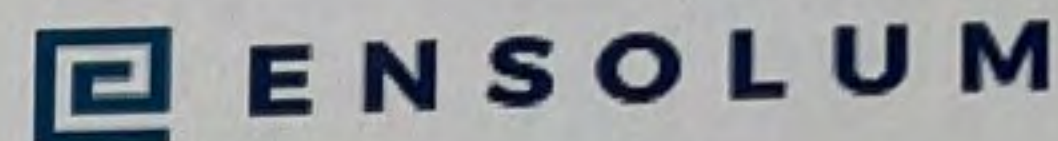

STANDARD 1A DPE SYSTEM
O&M FORM

DATE: 9-9
TIME ONSITE: _____

O&M PERSONNEL: B Sinclair
TIME OFFSITE: _____

SVE SYSTEM - MONTHLY O&M

DPE ALARMS: KO TANK HIGH LEVEL

BI-MONTHLY MAINTENANCE, MUST BE PERFORMED/CHECKED TWICE PER MONTH

DPE SYSTEM	READING	TIME	NOTES
Blower Hours (photo)	13324.1	1229	
Transfer Pump Hours (photo)	322.9		
Influent Vacuum Pre-KO (InHg)	1.2		
Fresh Air Bypass (% Open)	15		
Pre-Filter Vacuum (InHg)	16.5		
Post-Filter Vacuum (InHg)	15.5		
Differential Pressure (IWC)	0		
Exhaust Temperature (°F)	220		
Exhaust PID (ppm)	3.9		
Transfer Pump Pressure (PSI)	16		
Transfer Pump Totalizer (Gal) (photo)	147573.8		

Check filter for moisture	Condition:
Is replacement filter needed?	
Remove and Clean Float Assembly	Condition:
Clean Wye Strainer	Condition:
Muffler Drain Plug Check, Check Scale	Condition:
Add Chemical Pellets (once per month)	Date performed:

SVE SYSTEM SAMPLING

SAMPLE ID:		SAMPLE TIME:	
PID (ppm)	4.5	OXYGEN (%)	20.9
Analytes:	Sample Quarterly for TVPH (8015), 8260 - Full List VOCs, Fixed Gas (CO2 AND O2)		
		CARBON DIOXIDE (%)	620

OPERATING WELLS

Change in Well Operation: _____

MONTHLY O&M MEASUREMENT

WELLHEAD MEASUREMENTS

WELL ID	VACUUM (IWC)	PID HEADSPACE (PPM)	OXYGEN (%)	CARBON DIOXIDE (%)
MW01	1.21	5.7	20.9	570
MW02				
MW03				
MW06				
MW10	42.5	41.2	20.9	980
MW15				


MANIFOLD MEASUREMENTS

WELL ID	VACUUM (InHg)	SEE LIQUIDS? (YES/NO)	DIFF. PRESS. (IWC)
MW01	1.75	N	1.08
MW02	4.0		0.05
MW03	0.5		0
MW06	4.0		0
MW10	3.5		0.02
MW15	2.0		1.31

COMMENTS/MAINTENANCE ISSUES

INFLUENCE

WELL ID	VACUUM (IWC)
MW04	8
MW07	

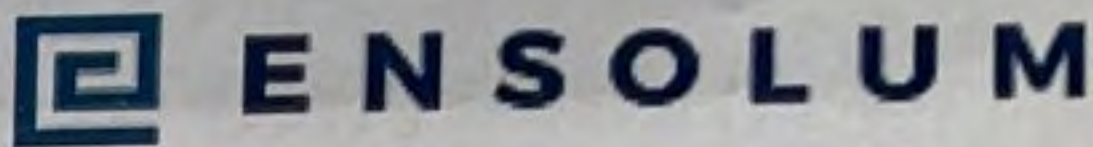

STANDARD 1A DPE SYSTEM
O&M FORM

DATE: 9-29
TIME ONSITE: _____

O&M PERSONNEL: D Sinclair
TIME OFFSITE: _____

SVE SYSTEM - MONTHLY O&M

DPE ALARMS: KO TANK HIGH LEVEL

BI-MONTHLY MAINTENANCE, MUST BE PERFORMED/CHECKED TWICE PER MONTH

DPE SYSTEM	READING	TIME	NOTES
Blower Hours (photo)	13659.6	1134	
Transfer Pump Hours (photo)	322.9		
Influent Vacuum Pre-KO (InHg)	1.3		
Fresh Air Bypass (% Open)	15		
Pre-Filter Vacuum (InHg)	16.0		
Post-Filter Vacuum (InHg)	14.5		
Differential Pressure (IWC)	0.5		
Exhaust Temperature (°F)	220		
Exhaust PID (ppm)	0.0		
Transfer Pump Pressure (PSI)	15.5		
Transfer Pump Totalizer (Gal) (photo)	197680.7		

Check filter for moisture	Condition:
Is replacement filter needed?	
Remove and Clean Float Assembly	Condition:
Clean Wye Strainer	Condition:
Muffler Drain Plug Check, Check Scale	Condition:
Add Chemical Pellets (once per month)	Date performed:

SVE SYSTEM SAMPLING

SAMPLE ID: _____ SAMPLE TIME: _____
PID (ppm) 4.9 OXYGEN (%) 20.9 CARBON DIOXIDE (%) 0
Analytes: Sample Quarterly for TVPH (8015), 8260 - Full List VOCs, Fixed Gas (CO2 AND O2)

OPERATING WELLS

Change in Well Operation: _____

MONTHLY O&M MEASUREMENT

WELLHEAD MEASUREMENTS

WELL ID	VACUUM (IWC)	PID HEADSPACE (PPM)	OXYGEN (%)	CARBON DIOXIDE (%)
MW01	160.5	4.4	20.9	20
MW02	109.6	2.8	16.8	*
MW03	163.1	4.3	20.9	80
MW06	152.6	4.0	20.9	100
MW10	160.6	2.7	20.2	1620
MW15	164.5	190.3	19.3	*

MANIFOLD MEASUREMENTS

WELL ID	VACUUM (InHg)	SEE LIQUIDS? (YES/NO)	DIFF. PRESS. (IWC)
MW01		N	1.27
MW02		N	0.03
MW03		Y	15.03
MW06		Y	0.61
MW10		N	2.32
MW15		Y	

COMMENTS/MAINTENANCE ISSUES

* over 10,000 ppm

INFLUENCE


WELL ID	VACUUM (IWC)
MW04	0
MW07	0



APPENDIX B

Project Photographs

PROJECT PHOTOGRAPHS
Standard #1
San Juan County, New Mexico
Hilcorp Energy Company

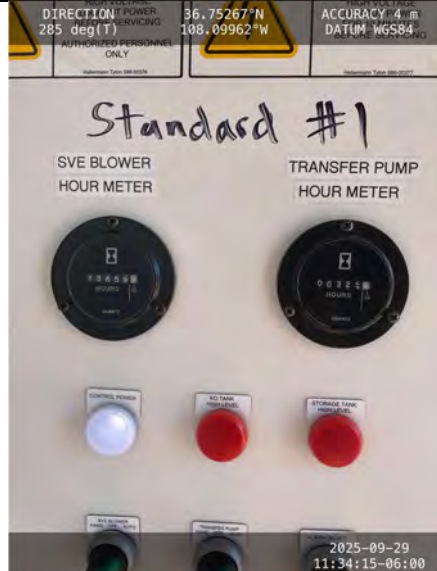Photograph 1 Runtime meter taken on June 27, 2025 at 11:03 AM Hours = 11,682.4	 Photograph 1 shows a close-up of a runtime meter panel for 'Standard #1'. The panel features two large black circular hour meters. The left meter is labeled 'SVE BLOWER HOUR METER' and shows a reading of 11,682.4 hours. The right meter is labeled 'TRANSFER PUMP HOUR METER' and shows a reading of 00320 hours. Above the meters are three buttons: 'CONTROL POWER' (white), 'NO TANK PROBLEMS' (red), and 'STORAGE TANK PROBLEMS' (red). The top of the panel has a header with GPS data: 'DIRECTION 50 deg(T)', '36.75264°N', '108.09967°W', 'ACCURACY 4 m', and 'DATUM WGS84'. There are also two warning labels with lightning bolt symbols and text: 'WARNING HIGH VOLTAGE LOCKOUT POWER BEFORE SERVICING AUTHORIZED PERSONNEL ONLY' and 'DANGER HIGH VOLTAGE LOCKOUT POWER FOR 10 MINUTES BEFORE SERVICING'. A date and time stamp at the bottom right reads '2025-06-27 11:03:20-06:00'.
Photograph 2 Runtime meter taken on September 29, 2025 at 11:34 AM Hours = 13,659.6	 Photograph 2 shows the same runtime meter panel for 'Standard #1' as in Photograph 1. The left meter, 'SVE BLOWER HOUR METER', now shows a reading of 13,659.6 hours. The right meter, 'TRANSFER PUMP HOUR METER', still shows 00320 hours. The buttons and header information are the same. The date and time stamp at the bottom right now reads '2025-09-29 11:34:15-06:00'.

PROJECT PHOTOGRAPHS
Standard #1
San Juan County, New Mexico
Hilcorp Energy Company

Photograph 3 Totalizer taken on June 27, 2025 at 11:03 AM Gallons = 144,802.3	
Photograph 4 Totalizer taken on September 29, 2025 at 11:34 AM Gallons = 147,580.7	



APPENDIX C

DPE Laboratory Analytical Reports



Environment Testing

1

2

3

4

5

6

7

8

9

10

11

12

ANALYTICAL REPORT

PREPARED FOR

Attn: Mitch Killough
Hilcorp Energy
PO BOX 4700
Farmington, New Mexico 87499

Generated 8/25/2025 2:28:00 PM

JOB DESCRIPTION

Standard 1

JOB NUMBER

885-31114-1

Eurofins Albuquerque
4901 Hawkins NE
Albuquerque NM 87109

Eurofins Albuquerque

Job Notes

The test results in this report relate only to the samples as received by the laboratory and will meet all requirements of the methodology, with any exceptions noted. This report shall not be reproduced except in full, without the express written approval of the laboratory. All questions should be directed to the Eurofins Environment Testing South Central, LLC Project Manager.

Authorization



Generated
8/25/2025 2:28:00 PM

Authorized for release by
Michelle Garcia, Project Manager
michelle.garcia@et.eurofinsus.com
(505)345-3975

Client: Hilcorp Energy
Project/Site: Standard 1

Laboratory Job ID: 885-31114-1

Table of Contents

Cover Page	1
Table of Contents	3
Definitions/Glossary	4
Case Narrative	5
Client Sample Results	6
QC Sample Results	8
QC Association Summary	11
Lab Chronicle	12
Certification Summary	13
Subcontract Data	16
Chain of Custody	23
Receipt Checklists	24

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12

Definitions/Glossary

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
☼	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: Hilcorp Energy
Project: Standard 1

Job ID: 885-31114-1

Job ID: 885-31114-1

Eurofins Albuquerque

Job Narrative 885-31114-1

The analytical test results presented in this report meet all requirements of the associated regulatory program listed on the Accreditation/Certification Summary Page, unless otherwise noted. Data qualifiers and/or narrative comments are included to explain any exceptions, if applicable. Regulated compliance samples (e.g. SDWA, NPDES) must comply with associated agency requirements/permits.

- Matrix-specific batch QC (e.g., MS, MSD, SD) may not be reported when insufficient sample volume is available or when site-specific QC samples are not submitted. In such cases, a Laboratory Control Sample Duplicate (LCSD) may be analyzed to provide precision data for the batch.
- For samples analyzed using surrogate and/or isotope dilution analytes, any recoveries falling outside of established acceptance criteria are re-prepared and/or re-analyzed to confirm results, unless the deviation is due to sample dilution or otherwise explained in the case narrative.

Receipt

The sample was received on 8/15/2025 7:15 AM. Unless otherwise noted below, the sample arrived in good condition, and, where required, properly preserved and on ice.

Subcontract Work

Method Fixed Gases: This method was subcontracted to Energy Laboratories, Inc. The subcontract laboratory certification is different from that of the facility issuing the final report. The subcontract report is appended in its entirety.

GC/MS VOA

Method 8260B: Due to sample matrix effect on the internal standard (ISTD), a dilution was required for the following sample: SVE-1 (885-31114-1).

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

Gasoline Range Organics

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Client Sample ID: SVE-1

Lab Sample ID: 885-31114-1

Date Collected: 08/11/25 12:15

Matrix: Air

Date Received: 08/15/25 07:15

Sample Container: Tedlar Bag 1L

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		2.0	ug/L			08/20/25 16:35	20
1,1,1-Trichloroethane	ND		2.0	ug/L			08/20/25 16:35	20
1,1,2,2-Tetrachloroethane	ND		4.0	ug/L			08/20/25 16:35	20
1,1,2-Trichloroethane	ND		2.0	ug/L			08/20/25 16:35	20
1,1-Dichloroethane	ND		2.0	ug/L			08/20/25 16:35	20
1,1-Dichloroethene	ND		2.0	ug/L			08/20/25 16:35	20
1,1-Dichloropropene	ND		2.0	ug/L			08/20/25 16:35	20
1,2,3-Trichlorobenzene	ND		2.0	ug/L			08/20/25 16:35	20
1,2,3-Trichloropropane	ND		4.0	ug/L			08/20/25 16:35	20
1,2,4-Trichlorobenzene	ND		2.0	ug/L			08/20/25 16:35	20
1,2,4-Trimethylbenzene	ND		2.0	ug/L			08/20/25 16:35	20
1,2-Dibromo-3-Chloropropane	ND		4.0	ug/L			08/20/25 16:35	20
1,2-Dibromoethane (EDB)	ND		2.0	ug/L			08/20/25 16:35	20
1,2-Dichlorobenzene	ND		2.0	ug/L			08/20/25 16:35	20
1,2-Dichloroethane (EDC)	ND		2.0	ug/L			08/20/25 16:35	20
1,2-Dichloropropane	ND		2.0	ug/L			08/20/25 16:35	20
1,3,5-Trimethylbenzene	ND		2.0	ug/L			08/20/25 16:35	20
1,3-Dichlorobenzene	ND		2.0	ug/L			08/20/25 16:35	20
1,3-Dichloropropane	ND		2.0	ug/L			08/20/25 16:35	20
1,4-Dichlorobenzene	ND		2.0	ug/L			08/20/25 16:35	20
1-Methylnaphthalene	ND		8.0	ug/L			08/20/25 16:35	20
2,2-Dichloropropane	ND		4.0	ug/L			08/20/25 16:35	20
2-Butanone	ND		20	ug/L			08/20/25 16:35	20
2-Chlorotoluene	ND		2.0	ug/L			08/20/25 16:35	20
2-Hexanone	ND		20	ug/L			08/20/25 16:35	20
2-Methylnaphthalene	ND		8.0	ug/L			08/20/25 16:35	20
4-Chlorotoluene	ND		2.0	ug/L			08/20/25 16:35	20
4-Isopropyltoluene	ND		2.0	ug/L			08/20/25 16:35	20
4-Methyl-2-pentanone	ND		20	ug/L			08/20/25 16:35	20
Acetone	ND		20	ug/L			08/20/25 16:35	20
Benzene	ND		2.0	ug/L			08/20/25 16:35	20
Bromobenzene	ND		2.0	ug/L			08/20/25 16:35	20
Bromodichloromethane	ND		2.0	ug/L			08/20/25 16:35	20
Dibromochloromethane	ND		2.0	ug/L			08/20/25 16:35	20
Bromoform	ND		2.0	ug/L			08/20/25 16:35	20
Bromomethane	ND		6.0	ug/L			08/20/25 16:35	20
Carbon disulfide	ND		20	ug/L			08/20/25 16:35	20
Carbon tetrachloride	ND		2.0	ug/L			08/20/25 16:35	20
Chlorobenzene	ND		2.0	ug/L			08/20/25 16:35	20
Chloroethane	ND		4.0	ug/L			08/20/25 16:35	20
Chloroform	ND		2.0	ug/L			08/20/25 16:35	20
Chloromethane	ND		6.0	ug/L			08/20/25 16:35	20
cis-1,2-Dichloroethene	ND		2.0	ug/L			08/20/25 16:35	20
cis-1,3-Dichloropropene	ND		2.0	ug/L			08/20/25 16:35	20
Dibromomethane	ND		2.0	ug/L			08/20/25 16:35	20
Dichlorodifluoromethane	ND		2.0	ug/L			08/20/25 16:35	20
Ethylbenzene	ND		2.0	ug/L			08/20/25 16:35	20
Hexachlorobutadiene	ND		2.0	ug/L			08/20/25 16:35	20

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Client Sample ID: SVE-1

Lab Sample ID: 885-31114-1

Date Collected: 08/11/25 12:15

Matrix: Air

Date Received: 08/15/25 07:15

Sample Container: Tedlar Bag 1L

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Isopropylbenzene	ND		2.0	ug/L			08/20/25 16:35	20
Methyl-tert-butyl Ether (MTBE)	ND		2.0	ug/L			08/20/25 16:35	20
Methylene Chloride	ND		6.0	ug/L			08/20/25 16:35	20
n-Butylbenzene	ND		6.0	ug/L			08/20/25 16:35	20
N-Propylbenzene	ND		2.0	ug/L			08/20/25 16:35	20
Naphthalene	ND		4.0	ug/L			08/20/25 16:35	20
sec-Butylbenzene	ND		2.0	ug/L			08/20/25 16:35	20
Styrene	ND		2.0	ug/L			08/20/25 16:35	20
tert-Butylbenzene	ND		2.0	ug/L			08/20/25 16:35	20
Tetrachloroethene (PCE)	ND		2.0	ug/L			08/20/25 16:35	20
Toluene	ND		2.0	ug/L			08/20/25 16:35	20
trans-1,2-Dichloroethene	ND		2.0	ug/L			08/20/25 16:35	20
trans-1,3-Dichloropropene	ND		2.0	ug/L			08/20/25 16:35	20
Trichloroethene (TCE)	ND		2.0	ug/L			08/20/25 16:35	20
Trichlorofluoromethane	ND		2.0	ug/L			08/20/25 16:35	20
Vinyl chloride	ND		2.0	ug/L			08/20/25 16:35	20
Xylenes, Total	ND		3.0	ug/L			08/20/25 16:35	20

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	92		70 - 130		08/20/25 16:35	20
Toluene-d8 (Surr)	88		70 - 130		08/20/25 16:35	20
4-Bromofluorobenzene (Surr)	87		70 - 130		08/20/25 16:35	20
Dibromofluoromethane (Surr)	88		70 - 130		08/20/25 16:35	20

Method: SW846 8015D - Gasoline Range Organics (GRO) (GC)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics [C6 - C10]	170		25	ug/L			08/21/25 13:07	5

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	127		15 - 150		08/21/25 13:07	5

Eurofins Albuquerque

QC Sample Results

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Method: 8260B - Volatile Organic Compounds (GC/MS)

Lab Sample ID: MB 885-32817/6

Matrix: Air

Analysis Batch: 32817

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		0.10	ug/L			08/20/25 15:20	1
1,1,1-Trichloroethane	ND		0.10	ug/L			08/20/25 15:20	1
1,1,2,2-Tetrachloroethane	ND		0.20	ug/L			08/20/25 15:20	1
1,1,2-Trichloroethane	ND		0.10	ug/L			08/20/25 15:20	1
1,1-Dichloroethane	ND		0.10	ug/L			08/20/25 15:20	1
1,1-Dichloroethene	ND		0.10	ug/L			08/20/25 15:20	1
1,1-Dichloropropene	ND		0.10	ug/L			08/20/25 15:20	1
1,2,3-Trichlorobenzene	ND		0.10	ug/L			08/20/25 15:20	1
1,2,3-Trichloropropane	ND		0.20	ug/L			08/20/25 15:20	1
1,2,4-Trichlorobenzene	ND		0.10	ug/L			08/20/25 15:20	1
1,2,4-Trimethylbenzene	ND		0.10	ug/L			08/20/25 15:20	1
1,2-Dibromo-3-Chloropropane	ND		0.20	ug/L			08/20/25 15:20	1
1,2-Dibromoethane (EDB)	ND		0.10	ug/L			08/20/25 15:20	1
1,2-Dichlorobenzene	ND		0.10	ug/L			08/20/25 15:20	1
1,2-Dichloroethane (EDC)	ND		0.10	ug/L			08/20/25 15:20	1
1,2-Dichloropropane	ND		0.10	ug/L			08/20/25 15:20	1
1,3,5-Trimethylbenzene	ND		0.10	ug/L			08/20/25 15:20	1
1,3-Dichlorobenzene	ND		0.10	ug/L			08/20/25 15:20	1
1,3-Dichloropropane	ND		0.10	ug/L			08/20/25 15:20	1
1,4-Dichlorobenzene	ND		0.10	ug/L			08/20/25 15:20	1
1-Methylnaphthalene	ND		0.40	ug/L			08/20/25 15:20	1
2,2-Dichloropropane	ND		0.20	ug/L			08/20/25 15:20	1
2-Butanone	ND		1.0	ug/L			08/20/25 15:20	1
2-Chlorotoluene	ND		0.10	ug/L			08/20/25 15:20	1
2-Hexanone	ND		1.0	ug/L			08/20/25 15:20	1
2-Methylnaphthalene	ND		0.40	ug/L			08/20/25 15:20	1
4-Chlorotoluene	ND		0.10	ug/L			08/20/25 15:20	1
4-Isopropyltoluene	ND		0.10	ug/L			08/20/25 15:20	1
4-Methyl-2-pentanone	ND		1.0	ug/L			08/20/25 15:20	1
Acetone	ND		1.0	ug/L			08/20/25 15:20	1
Benzene	ND		0.10	ug/L			08/20/25 15:20	1
Bromobenzene	ND		0.10	ug/L			08/20/25 15:20	1
Bromodichloromethane	ND		0.10	ug/L			08/20/25 15:20	1
Dibromochloromethane	ND		0.10	ug/L			08/20/25 15:20	1
Bromoform	ND		0.10	ug/L			08/20/25 15:20	1
Bromomethane	ND		0.30	ug/L			08/20/25 15:20	1
Carbon disulfide	ND		1.0	ug/L			08/20/25 15:20	1
Carbon tetrachloride	ND		0.10	ug/L			08/20/25 15:20	1
Chlorobenzene	ND		0.10	ug/L			08/20/25 15:20	1
Chloroethane	ND		0.20	ug/L			08/20/25 15:20	1
Chloroform	ND		0.10	ug/L			08/20/25 15:20	1
Chloromethane	ND		0.30	ug/L			08/20/25 15:20	1
cis-1,2-Dichloroethene	ND		0.10	ug/L			08/20/25 15:20	1
cis-1,3-Dichloropropene	ND		0.10	ug/L			08/20/25 15:20	1
Dibromomethane	ND		0.10	ug/L			08/20/25 15:20	1
Dichlorodifluoromethane	ND		0.10	ug/L			08/20/25 15:20	1
Ethylbenzene	ND		0.10	ug/L			08/20/25 15:20	1
Hexachlorobutadiene	ND		0.10	ug/L			08/20/25 15:20	1

Eurofins Albuquerque

QC Sample Results

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Method: 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Lab Sample ID: MB 885-32817/6
Matrix: Air
Analysis Batch: 32817

Client Sample ID: Method Blank
Prep Type: Total/NA

Analyte	MB	MB	RL	Unit	D	Prepared	Analyzed	Dil Fac
	Result	Qualifier						
Isopropylbenzene	ND		0.10	ug/L			08/20/25 15:20	1
Methyl-tert-butyl Ether (MTBE)	ND		0.10	ug/L			08/20/25 15:20	1
Methylene Chloride	ND		0.30	ug/L			08/20/25 15:20	1
n-Butylbenzene	ND		0.30	ug/L			08/20/25 15:20	1
N-Propylbenzene	ND		0.10	ug/L			08/20/25 15:20	1
Naphthalene	ND		0.20	ug/L			08/20/25 15:20	1
sec-Butylbenzene	ND		0.10	ug/L			08/20/25 15:20	1
Styrene	ND		0.10	ug/L			08/20/25 15:20	1
tert-Butylbenzene	ND		0.10	ug/L			08/20/25 15:20	1
Tetrachloroethene (PCE)	ND		0.10	ug/L			08/20/25 15:20	1
Toluene	ND		0.10	ug/L			08/20/25 15:20	1
trans-1,2-Dichloroethene	ND		0.10	ug/L			08/20/25 15:20	1
trans-1,3-Dichloropropene	ND		0.10	ug/L			08/20/25 15:20	1
Trichloroethene (TCE)	ND		0.10	ug/L			08/20/25 15:20	1
Trichlorofluoromethane	ND		0.10	ug/L			08/20/25 15:20	1
Vinyl chloride	ND		0.10	ug/L			08/20/25 15:20	1
Xylenes, Total	ND		0.15	ug/L			08/20/25 15:20	1

Surrogate	MB	MB	Limits	Prepared	Analyzed	Dil Fac
	%Recovery	Qualifier				
1,2-Dichloroethane-d4 (Surr)	96		70 - 130		08/20/25 15:20	1
Toluene-d8 (Surr)	86		70 - 130		08/20/25 15:20	1
4-Bromofluorobenzene (Surr)	85		70 - 130		08/20/25 15:20	1
Dibromofluoromethane (Surr)	87		70 - 130		08/20/25 15:20	1

Lab Sample ID: LCS 885-32817/5
Matrix: Air
Analysis Batch: 32817

Client Sample ID: Lab Control Sample
Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethene	20.0	18.7		ug/L		93	70 - 130
Benzene	20.0	21.1		ug/L		106	70 - 130
Chlorobenzene	20.0	21.9		ug/L		109	70 - 130
Toluene	20.0	21.8		ug/L		109	70 - 130
Trichloroethene (TCE)	20.0	19.8		ug/L		99	70 - 130

Surrogate	LCS	LCS	Limits
	%Recovery	Qualifier	
1,2-Dichloroethane-d4 (Surr)	90		70 - 130
Toluene-d8 (Surr)	86		70 - 130
4-Bromofluorobenzene (Surr)	88		70 - 130
Dibromofluoromethane (Surr)	81		70 - 130

QC Sample Results

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Method: 8015D - Gasoline Range Organics (GRO) (GC)

Lab Sample ID: MB 885-32918/5					Client Sample ID: Method Blank				
Matrix: Air					Prep Type: Total/NA				
Analysis Batch: 32918									
Analyte	MB Result	MB Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac	
Gasoline Range Organics [C6 - C10]	ND		5.0	ug/L			08/21/25 11:56	1	
Surrogate	MB %Recovery	MB Qualifier	Limits			Prepared	Analyzed	Dil Fac	
4-Bromofluorobenzene (Surr)	99		15 - 150				08/21/25 11:56	1	

Lab Sample ID: LCS 885-32918/3					Client Sample ID: Lab Control Sample				
Matrix: Air					Prep Type: Total/NA				
Analysis Batch: 32918									
Analyte			Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Gasoline Range Organics [C6 - C10]			50.0	46.0		ug/L		92	70 - 130
Surrogate	LCS %Recovery	LCS Qualifier	Limits						
4-Bromofluorobenzene (Surr)	201		15 - 150						

QC Association Summary

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

GC/MS VOA

Analysis Batch: 32817

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
885-31114-1	SVE-1	Total/NA	Air	8260B	
MB 885-32817/6	Method Blank	Total/NA	Air	8260B	
LCS 885-32817/5	Lab Control Sample	Total/NA	Air	8260B	

GC VOA

Analysis Batch: 32918

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
885-31114-1	SVE-1	Total/NA	Air	8015D	
MB 885-32918/5	Method Blank	Total/NA	Air	8015D	
LCS 885-32918/3	Lab Control Sample	Total/NA	Air	8015D	

Lab Chronicle

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Client Sample ID: SVE-1
Date Collected: 08/11/25 12:15
Date Received: 08/15/25 07:15

Lab Sample ID: 885-31114-1
Matrix: Air

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		20	32817	RA	EET ALB	08/20/25 16:35
Total/NA	Analysis	8015D		5	32918	AT	EET ALB	08/21/25 13:07

Laboratory References:

= , 1120 South 27th Street, Billings, MT 59101, TEL (406)252-6325

EET ALB = Eurofins Albuquerque, 4901 Hawkins NE, Albuquerque, NM 87109, TEL (505)345-3975

Accreditation/Certification Summary

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Laboratory: Eurofins Albuquerque

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
New Mexico	State	NM9425, NM0901	02-27-26

The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.

Analysis Method	Prep Method	Matrix	Analyte
8015D		Air	Gasoline Range Organics [C6 - C10]
8260B		Air	1,1,1,2-Tetrachloroethane
8260B		Air	1,1,1-Trichloroethane
8260B		Air	1,1,2,2-Tetrachloroethane
8260B		Air	1,1,2-Trichloroethane
8260B		Air	1,1-Dichloroethane
8260B		Air	1,1-Dichloroethene
8260B		Air	1,1-Dichloropropene
8260B		Air	1,2,3-Trichlorobenzene
8260B		Air	1,2,3-Trichloropropane
8260B		Air	1,2,4-Trichlorobenzene
8260B		Air	1,2,4-Trimethylbenzene
8260B		Air	1,2-Dibromo-3-Chloropropane
8260B		Air	1,2-Dibromoethane (EDB)
8260B		Air	1,2-Dichlorobenzene
8260B		Air	1,2-Dichloroethane (EDC)
8260B		Air	1,2-Dichloropropane
8260B		Air	1,3,5-Trimethylbenzene
8260B		Air	1,3-Dichlorobenzene
8260B		Air	1,3-Dichloropropane
8260B		Air	1,4-Dichlorobenzene
8260B		Air	1-Methylnaphthalene
8260B		Air	2,2-Dichloropropane
8260B		Air	2-Butanone
8260B		Air	2-Chlorotoluene
8260B		Air	2-Hexanone
8260B		Air	2-Methylnaphthalene
8260B		Air	4-Chlorotoluene
8260B		Air	4-Isopropyltoluene
8260B		Air	4-Methyl-2-pentanone
8260B		Air	Acetone
8260B		Air	Benzene
8260B		Air	Bromobenzene
8260B		Air	Bromodichloromethane
8260B		Air	Bromoform
8260B		Air	Bromomethane
8260B		Air	Carbon disulfide
8260B		Air	Carbon tetrachloride
8260B		Air	Chlorobenzene
8260B		Air	Chloroethane
8260B		Air	Chloroform
8260B		Air	Chloromethane
8260B		Air	cis-1,2-Dichloroethene
8260B		Air	cis-1,3-Dichloropropene
8260B		Air	Dibromochloromethane

Eurofins Albuquerque

Accreditation/Certification Summary

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Laboratory: Eurofins Albuquerque (Continued)

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.			
Analysis Method	Prep Method	Matrix	Analyte
8260B		Air	Dibromomethane
8260B		Air	Dichlorodifluoromethane
8260B		Air	Ethylbenzene
8260B		Air	Hexachlorobutadiene
8260B		Air	Isopropylbenzene
8260B		Air	Methylene Chloride
8260B		Air	Methyl-tert-butyl Ether (MTBE)
8260B		Air	Naphthalene
8260B		Air	n-Butylbenzene
8260B		Air	N-Propylbenzene
8260B		Air	sec-Butylbenzene
8260B		Air	Styrene
8260B		Air	tert-Butylbenzene
8260B		Air	Tetrachloroethene (PCE)
8260B		Air	Toluene
8260B		Air	trans-1,2-Dichloroethene
8260B		Air	trans-1,3-Dichloropropene
8260B		Air	Trichloroethene (TCE)
8260B		Air	Trichlorofluoromethane
8260B		Air	Vinyl chloride
8260B		Air	Xylenes, Total
Oregon	NELAP	NM100001	02-26-26
The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.			
Analysis Method	Prep Method	Matrix	Analyte
8015D		Air	Gasoline Range Organics [C6 - C10]
8260B		Air	1,1,1,2-Tetrachloroethane
8260B		Air	1,1,1-Trichloroethane
8260B		Air	1,1,2,2-Tetrachloroethane
8260B		Air	1,1,2-Trichloroethane
8260B		Air	1,1-Dichloroethane
8260B		Air	1,1-Dichloroethene
8260B		Air	1,1-Dichloropropene
8260B		Air	1,2,3-Trichlorobenzene
8260B		Air	1,2,3-Trichloropropane
8260B		Air	1,2,4-Trichlorobenzene
8260B		Air	1,2,4-Trimethylbenzene
8260B		Air	1,2-Dibromo-3-Chloropropane
8260B		Air	1,2-Dibromoethane (EDB)
8260B		Air	1,2-Dichlorobenzene
8260B		Air	1,2-Dichloroethane (EDC)
8260B		Air	1,2-Dichloropropane
8260B		Air	1,3,5-Trimethylbenzene
8260B		Air	1,3-Dichlorobenzene
8260B		Air	1,3-Dichloropropane
8260B		Air	1,4-Dichlorobenzene

Eurofins Albuquerque

Accreditation/Certification Summary

Client: Hilcorp Energy
Project/Site: Standard 1

Job ID: 885-31114-1

Laboratory: Eurofins Albuquerque (Continued)

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.			
Analysis Method	Prep Method	Matrix	Analyte
8260B		Air	1-Methylnaphthalene
8260B		Air	2,2-Dichloropropane
8260B		Air	2-Butanone
8260B		Air	2-Chlorotoluene
8260B		Air	2-Hexanone
8260B		Air	2-Methylnaphthalene
8260B		Air	4-Chlorotoluene
8260B		Air	4-Isopropyltoluene
8260B		Air	4-Methyl-2-pentanone
8260B		Air	Acetone
8260B		Air	Benzene
8260B		Air	Bromobenzene
8260B		Air	Bromodichloromethane
8260B		Air	Bromoform
8260B		Air	Bromomethane
8260B		Air	Carbon disulfide
8260B		Air	Carbon tetrachloride
8260B		Air	Chlorobenzene
8260B		Air	Chloroethane
8260B		Air	Chloroform
8260B		Air	Chloromethane
8260B		Air	cis-1,2-Dichloroethene
8260B		Air	cis-1,3-Dichloropropene
8260B		Air	Dibromochloromethane
8260B		Air	Dibromomethane
8260B		Air	Dichlorodifluoromethane
8260B		Air	Ethylbenzene
8260B		Air	Hexachlorobutadiene
8260B		Air	Isopropylbenzene
8260B		Air	Methylene Chloride
8260B		Air	Methyl-tert-butyl Ether (MTBE)
8260B		Air	Naphthalene
8260B		Air	n-Butylbenzene
8260B		Air	N-Propylbenzene
8260B		Air	sec-Butylbenzene
8260B		Air	Styrene
8260B		Air	tert-Butylbenzene
8260B		Air	Tetrachloroethene (PCE)
8260B		Air	Toluene
8260B		Air	trans-1,2-Dichloroethene
8260B		Air	trans-1,3-Dichloropropene
8260B		Air	Trichloroethene (TCE)
8260B		Air	Trichlorofluoromethane
8260B		Air	Vinyl chloride
8260B		Air	Xylenes, Total

Eurofins Albuquerque



Trust our People. Trust our Data.
www.energylab.com

Billings, MT 406.252.6325 • Casper, WY 307.235.0515
Gillette, WY 307.686.7175 • Helena, MT 406.442.0711

ANALYTICAL SUMMARY REPORT

August 22, 2025

Eurofins TestAmerica - Albuquerque

4901 Hawkins St NE Ste D

Albuquerque, NM 87109-4372

Work Order: B25081749

Quote ID: B15626

Project Name: Standard 1 88501698

Energy Laboratories Inc Billings MT received the following 1 sample for Eurofins TestAmerica - Albuquerque on 8/19/2025 for analysis.

Lab ID	Client Sample ID	Collect Date	Receive Date	Matrix	Test
B25081749-001	SVE-1 (885-31114-1)	08/11/25 12:15	08/19/25	Air	Air Correction Calculations Appearance and Comments Calculated Properties GPM @ std cond./1000 cu. ft., moist. Free Natural Gas Analysis Specific Gravity @ 60/60

The analyses presented in this report were performed by Energy Laboratories, Inc., 1120 So. 27th Street, Billings, MT 59101, unless otherwise noted. Any exceptions or problems with the analyses are noted in the report package. Any issues encountered during sample receipt are documented in the Work Order Receipt Checklist.

The results as reported relate only to the item(s) submitted for testing. This report shall be used or copied only in its entirety. Energy Laboratories, Inc. is not responsible for the consequences arising from the use of a partial report.

Energy Laboratories, Inc. verifies the reported results for the analysis has been technically reviewed and approved for release.

If you have any questions regarding these test results, please contact your Project Manager.



Trust our People. Trust our Data.
www.energylab.com

Billings, MT 406.252.6325 • Casper, WY 307.235.0515
Gillette, WY 307.686.7175 • Helena, MT 406.442.0711

LABORATORY ANALYTICAL REPORT

Prepared by Billings, MT Branch

Client: Eurofins TestAmerica - Albuquerque
Project: Standard 1 88501698
Lab ID: B25081749-001
Client Sample ID: SVE-1 (885-31114-1)

Report Date: 08/22/25
Collection Date: 08/11/25 12:15
Date Received: 08/19/25
Matrix: Air

Analyses	Result	Units	Qualifiers	RL	MCL/ QCL	Method	Analysis Date / By
GAS CHROMATOGRAPHY ANALYSIS REPORT							
Oxygen	22.12	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Nitrogen	77.72	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Carbon Dioxide	0.15	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Hydrogen Sulfide	<0.01	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Methane	<0.01	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Ethane	<0.01	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Propane	<0.01	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Isobutane	<0.01	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
n-Butane	<0.01	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Isopentane	<0.01	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
n-Pentane	<0.01	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Hexanes plus	0.01	Mol %		0.01		GPA 2261-13	08/20/25 13:53 / jrj
Propane	< 0.001	gpm		0.001		GPA 2261-13	08/20/25 13:53 / jrj
Isobutane	< 0.001	gpm		0.001		GPA 2261-13	08/20/25 13:53 / jrj
n-Butane	< 0.001	gpm		0.001		GPA 2261-13	08/20/25 13:53 / jrj
Isopentane	< 0.001	gpm		0.001		GPA 2261-13	08/20/25 13:53 / jrj
n-Pentane	< 0.001	gpm		0.001		GPA 2261-13	08/20/25 13:53 / jrj
Hexanes plus	0.004	gpm		0.001		GPA 2261-13	08/20/25 13:53 / jrj
GPM Total	0.004	gpm		0.001		GPA 2261-13	08/20/25 13:53 / jrj
GPM Pentanes plus	0.004	gpm		0.001		GPA 2261-13	08/20/25 13:53 / jrj

CALCULATED PROPERTIES

Gross BTU per cu ft @ Std Cond. (HHV)	ND		1		GPA 2261-13	08/20/25 13:53 / jrj
Net BTU per cu ft @ std cond. (LHV)	ND		1		GPA 2261-13	08/20/25 13:53 / jrj
Pseudo-critical Pressure, psia	546		1		GPA 2261-13	08/20/25 13:53 / jrj
Pseudo-critical Temperature, deg R	239		1		GPA 2261-13	08/20/25 13:53 / jrj
Specific Gravity @ 60/60F	0.999		0.001		D3588-17	08/20/25 13:53 / jrj
Air, %	101.07		0.01		GPA 2261-13	08/20/25 13:53 / jrj
- The analysis was not corrected for air.						

COMMENTS

-						08/20/25 13:53 / jrj
- BTU, GPM, and specific gravity are corrected for deviation from ideal gas behavior. - GPM = gallons of liquid at standard conditions per 1000 cu. ft. of moisture free gas @ standard conditions. - To convert BTU to a water-saturated basis @ standard conditions, multiply by 0.9825. - Standard conditions: 60 F & 14.73 psi on a dry basis.						

Report Definitions: RL - Analyte Reporting Limit
QCL - Quality Control Limit

MCL - Maximum Contaminant Level
ND - Not detected at the Reporting Limit (RL)



Trust our People. Trust our Data.
www.energylab.com

Billings, MT 406.252.6325 • Casper, WY 307.235.0515
Gillette, WY 307.686.7175 • Helena, MT 406.442.0711

QA/QC Summary Report

Prepared by Billings, MT Branch

Work Order: B25081749

Report Date: 08/22/25

Analyte	Count	Result	Units	RL	%REC	Low Limit	High Limit	RPD	RPDLimit	Qual
Method: GPA 2261-13									Batch: R447848	
Lab ID: B25081749-001ADUP	12	Sample Duplicate				Run: GC7890_250820A			08/20/25 13:23	
Oxygen		21.7	Mol %	0.01				1.9	20	
Nitrogen		78.1	Mol %	0.01				0.5	20	
Carbon Dioxide		0.14	Mol %	0.01				6.9	20	
Hydrogen Sulfide		<0.01	Mol %	0.01					20	
Methane		<0.01	Mol %	0.01					20	
Ethane		<0.01	Mol %	0.01					20	
Propane		<0.01	Mol %	0.01					20	
Isobutane		<0.01	Mol %	0.01					20	
n-Butane		<0.01	Mol %	0.01					20	
Isopentane		<0.01	Mol %	0.01					20	
n-Pentane		<0.01	Mol %	0.01					20	
Hexanes plus		0.01	Mol %	0.01				0.0	20	
Lab ID: LCS082025									08/20/25 20:48	
	11	Laboratory Control Sample				Run: GC7890_250820A				
Oxygen		0.59	Mol %	0.01	120	70	130			
Nitrogen		5.51	Mol %	0.01	94	70	130			
Carbon Dioxide		0.98	Mol %	0.01	98	70	130			
Methane		76.5	Mol %	0.01	100	70	130			
Ethane		6.02	Mol %	0.01	99	70	130			
Propane		5.08	Mol %	0.01	102	70	130			
Isobutane		1.98	Mol %	0.01	99	70	130			
n-Butane		2.09	Mol %	0.01	105	70	130			
Isopentane		0.53	Mol %	0.01	106	70	130			
n-Pentane		0.54	Mol %	0.01	108	70	130			
Hexanes plus		0.22	Mol %	0.01	106	70	130			

Qualifiers:

RL - Analyte Reporting Limit

ND - Not detected at the Reporting Limit (RL)



Trust our People. Trust our Data.
www.energylab.com

Billings, MT 406.252.6325 • Casper, WY 307.235.0515
Gillette, WY 307.686.7175 • Helena, MT 406.442.0711

Work Order Receipt Checklist

Eurofins TestAmerica - Albuquerque

B25081749

Login completed by: Crystal M. Jones

Date Received: 8/19/2025

Reviewed by: dharris

Received by: SW

Reviewed Date: 8/20/2025

Carrier name: FedEx NDA

Shipping container/cooler in good condition?	Yes ☒	No ☐	Not Present ☐
Custody seals intact on all shipping container(s)/cooler(s)?	Yes ☒	No ☐	Not Present ☐
Custody seals intact on all sample bottles?	Yes ☐	No ☐	Not Present ☒
Chain of custody present?	Yes ☒	No ☐	
Chain of custody signed when relinquished and received?	Yes ☐	No ☒	
Chain of custody agrees with sample labels?	Yes ☒	No ☐	
Samples in proper container/bottle?	Yes ☒	No ☐	
Sample containers intact?	Yes ☒	No ☐	
Sufficient sample volume for indicated test?	Yes ☒	No ☐	
All samples received within holding time? (Exclude analyses that are considered field parameters such as pH, DO, Res Cl, Sulfite, Ferrous Iron, etc.)	Yes ☒	No ☐	
Temp Blank received in all shipping container(s)/cooler(s)?	Yes ☐	No ☒	Not Applicable ☐
Container/Temp Blank temperature:	22.8°C No Ice		
Containers requiring zero headspace have no headspace or bubble that is <6mm (1/4").	Yes ☐	No ☐	No VOA vials submitted ☒
Water - pH acceptable upon receipt?	Yes ☐	No ☐	Not Applicable ☒

Standard Reporting Procedures:

Lab measurement of analytes considered field parameters that require analysis within 15 minutes of sampling such as pH, Dissolved Oxygen and Residual Chlorine, are qualified as being analyzed outside of recommended holding time.

Solid/soil samples are reported on a wet weight basis (as received) unless specifically indicated. If moisture corrected, data units are typically noted as –dry. For agricultural and mining soil parameters/characteristics, all samples are dried and ground prior to sample analysis.

The reference date for Radon analysis is the sample collection date. The reference date for all other Radiochemical analyses is the analysis date. Radiochemical precision results represent a 2-sigma Total Measurement Uncertainty.

For methods that require zero headspace or require preservation check at the time of analysis due to potential interference, the pH is verified at analysis. Nonconforming sample pH is documented as part of the analysis and included in the sample analysis comments.

Trip Blanks and/or Blind Duplicate samples are assigned the earliest collection time for the associated requested analysis in order to evaluate the holding time unless specifically indicated.

Contact and Corrective Action Comments:

The temperature of the sample(s) in shipping container 1 was 22.8°C and shipping container 2 was 21.6°C. CMJ
08/19/25



Trust our People. Trust our Data.
www.energylab.com

Billings, MT 406.252.6325 • Casper, WY 307.235.0515
Gillette, WY 307.686.7175 • Helena, MT 406.442.0711

Laboratory Certifications and Accreditations

Current certificates are available at www.energylab.com website:

	Agency	Number
Billings, MT  	Alaska	17-023
	California	3087
	Colorado	MT00005
	Department of Defense (DoD)/ISO17025	ADE-2588
	Florida (Primary NELAP)	E87668
	Idaho	MT00005
	Louisiana	05079
	Montana	CERT0044
	Nebraska	NE-OS-13-04
	Nevada	NV-C24-00250
	North Dakota	R-007
	National Radon Proficiency	109383-RMP
	Oregon	4184
	South Dakota	ARSD 74:04:07
	Texas	TX-C24-00302
	US EPA Region VIII	Reciprocal
	USDA Soil Permit	P330-20-00170
	Washington	C1039
Casper, WY 	Alaska	20-006
	California	3021
	Colorado	WY00002
	Florida (Primary NELAP)	E87641
	Idaho	WY00002
	Louisiana	05083
	Montana	CERT0002
	Nebraska	NE-OS-08-04
	Nevada	NV-C24-00245
	North Dakota	R-125
	Oregon	WY200001
	South Dakota	WY00002
	Texas	T104704181-23-21
	US EPA Region VIII	WY00002
	USNRC License	49-26846-01
	Washington	C1012
Gillette, WY	US EPA Region VIII	WY00006
Helena, MT	Colorado	MT00945
	Montana	CERT0079
	Nevada	NV-C24-00119
	US EPA Region VIII	Reciprocal
	USDA Soil Permit	P330-20-00090

4901 Hawkins NE
Albuquerque, NM 87109
Phone: 505-345-3975 Fax: 505-345-4107

 **eurofins** | Environment Testing

[illegible]

Ver: 10/10/2024

ICOC No:
885-6172

Containers

<u>Count</u>	<u>Container Type</u>	<u>Preservative</u>
1	Tedlar Bag 1L	None

Subcontract Method Instructions

Sample IDs	Method	Method Description	Method Comments
1	SUBCONTRACT	SUB - Subcontract - Fixed Gases	Fixed Gases

8/25/2025

Login Sample Receipt Checklist

Client: Hilcorp Energy

Job Number: 885-31114-1

Login Number: 31114

List Source: Eurofins Albuquerque

List Number: 1

Creator: Casarrubias, Tracy

Question	Answer	Comment
Radioactivity wasn't checked or is $\leq$ background as measured by a survey meter.	N/A	
The cooler's custody seal, if present, is intact.	True	
Sample custody seals, if present, are intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	False	Thermal preservation not required.
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the containers received and the COC.	True	
Samples are received within Holding Time (excluding tests with immediate HTs)	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified.	N/A	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
Containers requiring zero headspace have no headspace or bubble is $<6\text{mm}$ (1/4").	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Residual Chlorine Checked.	N/A	



APPENDIX D

Groundwater Laboratory Analytical Reports



Environment Testing

1

2

3

4

5

6

7

8

9

10

11

ANALYTICAL REPORT

PREPARED FOR

Attn: Mitch Killough
Hilcorp Energy
PO BOX 4700
Farmington, New Mexico 87499

Generated 9/26/2025 4:08:28 PM

JOB DESCRIPTION

Standard #1 Groundwater

JOB NUMBER

885-33713-1

Eurofins Albuquerque
4901 Hawkins NE
Albuquerque NM 87109

Eurofins Albuquerque

Job Notes

The test results in this report relate only to the samples as received by the laboratory and will meet all requirements of the methodology, with any exceptions noted. This report shall not be reproduced except in full, without the express written approval of the laboratory. All questions should be directed to the Eurofins Environment Testing South Central, LLC Project Manager.

Authorization



Generated
9/26/2025 4:08:28 PM

Authorized for release by
Michelle Garcia, Project Manager
michelle.garcia@et.eurofinsus.com
(505)345-3975

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Laboratory Job ID: 885-33713-1

Table of Contents

Cover Page	1
Table of Contents	3
Definitions/Glossary	4
Case Narrative	5
Client Sample Results	6
QC Sample Results	28
QC Association Summary	31
Lab Chronicle	32
Certification Summary	34
Chain of Custody	36
Receipt Checklists	37

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11

Definitions/Glossary

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
☼	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: Hilcorp Energy
Project: Standard #1 Groundwater

Job ID: 885-33713-1

Job ID: 885-33713-1Eurofins Albuquerque

Job Narrative 885-33713-1

The analytical test results presented in this report meet all requirements of the associated regulatory program listed on the Accreditation/Certification Summary Page, unless otherwise noted. Data qualifiers and/or narrative comments are included to explain any exceptions, if applicable. Regulated compliance samples (e.g. SDWA, NPDES) must comply with associated agency requirements/permits.

- Matrix-specific batch QC (e.g., MS, MSD, SD) may not be reported when insufficient sample volume is available or when site-specific QC samples are not submitted. In such cases, a Laboratory Control Sample Duplicate (LCSD) may be analyzed to provide precision data for the batch.
- For samples analyzed using surrogate and/or isotope dilution analytes, any recoveries falling outside of established acceptance criteria are re-prepared and/or re-analyzed to confirm results, unless the deviation is due to sample dilution or otherwise explained in the case narrative.

Receipt

The samples were received on 9/19/2025 7:15 AM. Unless otherwise noted below, the samples arrived in good condition, and, where required, properly preserved and on ice. The temperature of the cooler at receipt time was 0.7°C.

GC/MS VOA

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW17

Lab Sample ID: 885-33713-1

Date Collected: 09/15/25 11:10

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		1.0	ug/L			09/22/25 17:10	1
1,1,1-Trichloroethane	ND		1.0	ug/L			09/22/25 17:10	1
1,1,2,2-Tetrachloroethane	ND		2.0	ug/L			09/22/25 17:10	1
1,1,2-Trichloroethane	ND		1.0	ug/L			09/22/25 17:10	1
1,1-Dichloroethane	ND		1.0	ug/L			09/22/25 17:10	1
1,1-Dichloroethene	ND		1.0	ug/L			09/22/25 17:10	1
1,1-Dichloropropene	ND		1.0	ug/L			09/22/25 17:10	1
1,2,3-Trichlorobenzene	ND		1.0	ug/L			09/22/25 17:10	1
1,2,3-Trichloropropane	ND		2.0	ug/L			09/22/25 17:10	1
1,2,4-Trichlorobenzene	ND		1.0	ug/L			09/22/25 17:10	1
1,2,4-Trimethylbenzene	ND		1.0	ug/L			09/22/25 17:10	1
1,2-Dibromo-3-Chloropropane	ND		2.0	ug/L			09/22/25 17:10	1
1,2-Dibromoethane (EDB)	ND		1.0	ug/L			09/22/25 17:10	1
1,2-Dichlorobenzene	ND		1.0	ug/L			09/22/25 17:10	1
1,2-Dichloroethane (EDC)	ND		1.0	ug/L			09/22/25 17:10	1
1,2-Dichloropropane	ND		1.0	ug/L			09/22/25 17:10	1
1,3,5-Trimethylbenzene	ND		1.0	ug/L			09/22/25 17:10	1
1,3-Dichlorobenzene	ND		1.0	ug/L			09/22/25 17:10	1
1,3-Dichloropropane	ND		1.0	ug/L			09/22/25 17:10	1
1,4-Dichlorobenzene	ND		1.0	ug/L			09/22/25 17:10	1
1-Methylnaphthalene	ND		4.0	ug/L			09/22/25 17:10	1
2,2-Dichloropropane	ND		2.0	ug/L			09/22/25 17:10	1
2-Butanone	ND		10	ug/L			09/22/25 17:10	1
2-Chlorotoluene	ND		1.0	ug/L			09/22/25 17:10	1
2-Hexanone	ND		10	ug/L			09/22/25 17:10	1
2-Methylnaphthalene	ND		4.0	ug/L			09/22/25 17:10	1
4-Chlorotoluene	ND		1.0	ug/L			09/22/25 17:10	1
4-Isopropyltoluene	ND		1.0	ug/L			09/22/25 17:10	1
4-Methyl-2-pentanone	ND		10	ug/L			09/22/25 17:10	1
Acetone	ND		10	ug/L			09/22/25 17:10	1
Benzene	ND		1.0	ug/L			09/22/25 17:10	1
Bromobenzene	ND		1.0	ug/L			09/22/25 17:10	1
Bromodichloromethane	ND		1.0	ug/L			09/22/25 17:10	1
Dibromochloromethane	ND		1.0	ug/L			09/22/25 17:10	1
Bromoform	ND		1.0	ug/L			09/22/25 17:10	1
Bromomethane	ND		3.0	ug/L			09/22/25 17:10	1
Carbon disulfide	ND		10	ug/L			09/22/25 17:10	1
Carbon tetrachloride	ND		1.0	ug/L			09/22/25 17:10	1
Chlorobenzene	ND		1.0	ug/L			09/22/25 17:10	1
Chloroethane	ND		2.0	ug/L			09/22/25 17:10	1
Chloroform	ND		1.0	ug/L			09/22/25 17:10	1
Chloromethane	ND		3.0	ug/L			09/22/25 17:10	1
cis-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 17:10	1
cis-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 17:10	1
Dibromomethane	ND		1.0	ug/L			09/22/25 17:10	1
Dichlorodifluoromethane	ND		1.0	ug/L			09/22/25 17:10	1
Ethylbenzene	ND		1.0	ug/L			09/22/25 17:10	1
Hexachlorobutadiene	ND		1.0	ug/L			09/22/25 17:10	1
Isopropylbenzene	ND		1.0	ug/L			09/22/25 17:10	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW17

Lab Sample ID: 885-33713-1

Date Collected: 09/15/25 11:10

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		1.0	ug/L			09/22/25 17:10	1
Methylene Chloride	ND		2.5	ug/L			09/22/25 17:10	1
n-Butylbenzene	ND		3.0	ug/L			09/22/25 17:10	1
N-Propylbenzene	ND		1.0	ug/L			09/22/25 17:10	1
Naphthalene	ND		2.0	ug/L			09/22/25 17:10	1
sec-Butylbenzene	ND		1.0	ug/L			09/22/25 17:10	1
Styrene	ND		1.0	ug/L			09/22/25 17:10	1
tert-Butylbenzene	ND		1.0	ug/L			09/22/25 17:10	1
Tetrachloroethene (PCE)	ND		1.0	ug/L			09/22/25 17:10	1
Toluene	ND		1.0	ug/L			09/22/25 17:10	1
trans-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 17:10	1
trans-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 17:10	1
Trichloroethene (TCE)	ND		1.0	ug/L			09/22/25 17:10	1
Trichlorofluoromethane	ND		1.0	ug/L			09/22/25 17:10	1
Vinyl chloride	ND		1.0	ug/L			09/22/25 17:10	1
Xylenes, Total	ND		1.5	ug/L			09/22/25 17:10	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	89		70 - 130		09/22/25 17:10	1
Toluene-d8 (Surr)	108		70 - 130		09/22/25 17:10	1
4-Bromofluorobenzene (Surr)	95		70 - 130		09/22/25 17:10	1
Dibromofluoromethane (Surr)	103		70 - 130		09/22/25 17:10	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW16

Lab Sample ID: 885-33713-2

Date Collected: 09/15/25 11:50

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		20	ug/L			09/22/25 20:21	20
1,1,1-Trichloroethane	ND		20	ug/L			09/22/25 20:21	20
1,1,2,2-Tetrachloroethane	ND		40	ug/L			09/22/25 20:21	20
1,1,2-Trichloroethane	ND		20	ug/L			09/22/25 20:21	20
1,1-Dichloroethane	ND		20	ug/L			09/22/25 20:21	20
1,1-Dichloroethene	ND		20	ug/L			09/22/25 20:21	20
1,1-Dichloropropene	ND		20	ug/L			09/22/25 20:21	20
1,2,3-Trichlorobenzene	ND		20	ug/L			09/22/25 20:21	20
1,2,3-Trichloropropane	ND		40	ug/L			09/22/25 20:21	20
1,2,4-Trichlorobenzene	ND		20	ug/L			09/22/25 20:21	20
1,2,4-Trimethylbenzene	550		20	ug/L			09/22/25 20:21	20
1,2-Dibromo-3-Chloropropane	ND		40	ug/L			09/22/25 20:21	20
1,2-Dibromoethane (EDB)	ND		20	ug/L			09/22/25 20:21	20
1,2-Dichlorobenzene	ND		20	ug/L			09/22/25 20:21	20
1,2-Dichloroethane (EDC)	ND		20	ug/L			09/22/25 20:21	20
1,2-Dichloropropane	ND		20	ug/L			09/22/25 20:21	20
1,3,5-Trimethylbenzene	ND		20	ug/L			09/22/25 20:21	20
1,3-Dichlorobenzene	ND		20	ug/L			09/22/25 20:21	20
1,3-Dichloropropane	ND		20	ug/L			09/22/25 20:21	20
1,4-Dichlorobenzene	ND		20	ug/L			09/22/25 20:21	20
1-Methylnaphthalene	ND		80	ug/L			09/22/25 20:21	20
2,2-Dichloropropane	ND		40	ug/L			09/22/25 20:21	20
2-Butanone	ND		200	ug/L			09/22/25 20:21	20
2-Chlorotoluene	ND		20	ug/L			09/22/25 20:21	20
2-Hexanone	ND		200	ug/L			09/22/25 20:21	20
2-Methylnaphthalene	ND		80	ug/L			09/22/25 20:21	20
4-Chlorotoluene	ND		20	ug/L			09/22/25 20:21	20
4-Isopropyltoluene	ND		20	ug/L			09/22/25 20:21	20
4-Methyl-2-pentanone	ND		200	ug/L			09/22/25 20:21	20
Acetone	ND		200	ug/L			09/22/25 20:21	20
Benzene	81		20	ug/L			09/22/25 20:21	20
Bromobenzene	ND		20	ug/L			09/22/25 20:21	20
Bromodichloromethane	ND		20	ug/L			09/22/25 20:21	20
Dibromochloromethane	ND		20	ug/L			09/22/25 20:21	20
Bromoform	ND		20	ug/L			09/22/25 20:21	20
Bromomethane	ND		60	ug/L			09/22/25 20:21	20
Carbon disulfide	ND		200	ug/L			09/22/25 20:21	20
Carbon tetrachloride	ND		20	ug/L			09/22/25 20:21	20
Chlorobenzene	ND		20	ug/L			09/22/25 20:21	20
Chloroethane	ND		40	ug/L			09/22/25 20:21	20
Chloroform	ND		20	ug/L			09/22/25 20:21	20
Chloromethane	ND		60	ug/L			09/22/25 20:21	20
cis-1,2-Dichloroethene	ND		20	ug/L			09/22/25 20:21	20
cis-1,3-Dichloropropene	ND		20	ug/L			09/22/25 20:21	20
Dibromomethane	ND		20	ug/L			09/22/25 20:21	20
Dichlorodifluoromethane	ND		20	ug/L			09/22/25 20:21	20
Ethylbenzene	130		20	ug/L			09/22/25 20:21	20
Hexachlorobutadiene	ND		20	ug/L			09/22/25 20:21	20
Isopropylbenzene	45		20	ug/L			09/22/25 20:21	20

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW16

Lab Sample ID: 885-33713-2

Date Collected: 09/15/25 11:50

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		20	ug/L			09/22/25 20:21	20
Methylene Chloride	ND		50	ug/L			09/22/25 20:21	20
n-Butylbenzene	ND		60	ug/L			09/22/25 20:21	20
N-Propylbenzene	43		20	ug/L			09/22/25 20:21	20
Naphthalene	ND		40	ug/L			09/22/25 20:21	20
sec-Butylbenzene	ND		20	ug/L			09/22/25 20:21	20
Styrene	ND		20	ug/L			09/22/25 20:21	20
tert-Butylbenzene	ND		20	ug/L			09/22/25 20:21	20
Tetrachloroethene (PCE)	ND		20	ug/L			09/22/25 20:21	20
Toluene	ND		20	ug/L			09/22/25 20:21	20
trans-1,2-Dichloroethene	ND		20	ug/L			09/22/25 20:21	20
trans-1,3-Dichloropropene	ND		20	ug/L			09/22/25 20:21	20
Trichloroethene (TCE)	ND		20	ug/L			09/22/25 20:21	20
Trichlorofluoromethane	ND		20	ug/L			09/22/25 20:21	20
Vinyl chloride	ND		20	ug/L			09/22/25 20:21	20
Xylenes, Total	ND		30	ug/L			09/22/25 20:21	20

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	91		70 - 130		09/22/25 20:21	20
Toluene-d8 (Surr)	105		70 - 130		09/22/25 20:21	20
4-Bromofluorobenzene (Surr)	91		70 - 130		09/22/25 20:21	20
Dibromofluoromethane (Surr)	105		70 - 130		09/22/25 20:21	20

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW19

Lab Sample ID: 885-33713-3

Date Collected: 09/15/25 13:55

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		200	ug/L			09/22/25 21:44	200
1,1,1-Trichloroethane	ND		200	ug/L			09/22/25 21:44	200
1,1,2,2-Tetrachloroethane	ND		400	ug/L			09/22/25 21:44	200
1,1,2-Trichloroethane	ND		200	ug/L			09/22/25 21:44	200
1,1-Dichloroethane	ND		200	ug/L			09/22/25 21:44	200
1,1-Dichloroethene	ND		200	ug/L			09/22/25 21:44	200
1,1-Dichloropropene	ND		200	ug/L			09/22/25 21:44	200
1,2,3-Trichlorobenzene	ND		200	ug/L			09/22/25 21:44	200
1,2,3-Trichloropropane	ND		400	ug/L			09/22/25 21:44	200
1,2,4-Trichlorobenzene	ND		200	ug/L			09/22/25 21:44	200
1,2,4-Trimethylbenzene	400		200	ug/L			09/22/25 21:44	200
1,2-Dibromo-3-Chloropropane	ND		400	ug/L			09/22/25 21:44	200
1,2-Dibromoethane (EDB)	ND		200	ug/L			09/22/25 21:44	200
1,2-Dichlorobenzene	ND		200	ug/L			09/22/25 21:44	200
1,2-Dichloroethane (EDC)	ND		200	ug/L			09/22/25 21:44	200
1,2-Dichloropropane	ND		200	ug/L			09/22/25 21:44	200
1,3,5-Trimethylbenzene	ND		200	ug/L			09/22/25 21:44	200
1,3-Dichlorobenzene	ND		200	ug/L			09/22/25 21:44	200
1,3-Dichloropropane	ND		200	ug/L			09/22/25 21:44	200
1,4-Dichlorobenzene	ND		200	ug/L			09/22/25 21:44	200
1-Methylnaphthalene	ND		800	ug/L			09/22/25 21:44	200
2,2-Dichloropropane	ND		400	ug/L			09/22/25 21:44	200
2-Butanone	ND		2000	ug/L			09/22/25 21:44	200
2-Chlorotoluene	ND		200	ug/L			09/22/25 21:44	200
2-Hexanone	ND		2000	ug/L			09/22/25 21:44	200
2-Methylnaphthalene	ND		800	ug/L			09/22/25 21:44	200
4-Chlorotoluene	ND		200	ug/L			09/22/25 21:44	200
4-Isopropyltoluene	ND		200	ug/L			09/22/25 21:44	200
4-Methyl-2-pentanone	ND		2000	ug/L			09/22/25 21:44	200
Acetone	ND		2000	ug/L			09/22/25 21:44	200
Benzene	4400		200	ug/L			09/22/25 21:44	200
Bromobenzene	ND		200	ug/L			09/22/25 21:44	200
Bromodichloromethane	ND		200	ug/L			09/22/25 21:44	200
Dibromochloromethane	ND		200	ug/L			09/22/25 21:44	200
Bromoform	ND		200	ug/L			09/22/25 21:44	200
Bromomethane	ND		600	ug/L			09/22/25 21:44	200
Carbon disulfide	ND		2000	ug/L			09/22/25 21:44	200
Carbon tetrachloride	ND		200	ug/L			09/22/25 21:44	200
Chlorobenzene	ND		200	ug/L			09/22/25 21:44	200
Chloroethane	ND		400	ug/L			09/22/25 21:44	200
Chloroform	ND		200	ug/L			09/22/25 21:44	200
Chloromethane	ND		600	ug/L			09/22/25 21:44	200
cis-1,2-Dichloroethene	ND		200	ug/L			09/22/25 21:44	200
cis-1,3-Dichloropropene	ND		200	ug/L			09/22/25 21:44	200
Dibromomethane	ND		200	ug/L			09/22/25 21:44	200
Dichlorodifluoromethane	ND		200	ug/L			09/22/25 21:44	200
Ethylbenzene	1300		200	ug/L			09/22/25 21:44	200
Hexachlorobutadiene	ND		200	ug/L			09/22/25 21:44	200
Isopropylbenzene	ND		200	ug/L			09/22/25 21:44	200

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW19

Lab Sample ID: 885-33713-3

Date Collected: 09/15/25 13:55

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		200	ug/L			09/22/25 21:44	200
Methylene Chloride	ND		500	ug/L			09/22/25 21:44	200
n-Butylbenzene	ND		600	ug/L			09/22/25 21:44	200
N-Propylbenzene	ND		200	ug/L			09/22/25 21:44	200
Naphthalene	ND		400	ug/L			09/22/25 21:44	200
sec-Butylbenzene	ND		200	ug/L			09/22/25 21:44	200
Styrene	ND		200	ug/L			09/22/25 21:44	200
tert-Butylbenzene	ND		200	ug/L			09/22/25 21:44	200
Tetrachloroethene (PCE)	ND		200	ug/L			09/22/25 21:44	200
Toluene	16000		200	ug/L			09/22/25 21:44	200
trans-1,2-Dichloroethene	ND		200	ug/L			09/22/25 21:44	200
trans-1,3-Dichloropropene	ND		200	ug/L			09/22/25 21:44	200
Trichloroethene (TCE)	ND		200	ug/L			09/22/25 21:44	200
Trichlorofluoromethane	ND		200	ug/L			09/22/25 21:44	200
Vinyl chloride	ND		200	ug/L			09/22/25 21:44	200
Xylenes, Total	9700		300	ug/L			09/22/25 21:44	200

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	91		70 - 130		09/22/25 21:44	200
Toluene-d8 (Surr)	109		70 - 130		09/22/25 21:44	200
4-Bromofluorobenzene (Surr)	95		70 - 130		09/22/25 21:44	200
Dibromofluoromethane (Surr)	107		70 - 130		09/22/25 21:44	200

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW09

Lab Sample ID: 885-33713-4

Date Collected: 09/15/25 15:40

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		10	ug/L			09/22/25 22:39	10
1,1,1-Trichloroethane	ND		10	ug/L			09/22/25 22:39	10
1,1,2,2-Tetrachloroethane	ND		20	ug/L			09/22/25 22:39	10
1,1,2-Trichloroethane	ND		10	ug/L			09/22/25 22:39	10
1,1-Dichloroethane	ND		10	ug/L			09/22/25 22:39	10
1,1-Dichloroethene	ND		10	ug/L			09/22/25 22:39	10
1,1-Dichloropropene	ND		10	ug/L			09/22/25 22:39	10
1,2,3-Trichlorobenzene	ND		10	ug/L			09/22/25 22:39	10
1,2,3-Trichloropropane	ND		20	ug/L			09/22/25 22:39	10
1,2,4-Trichlorobenzene	ND		10	ug/L			09/22/25 22:39	10
1,2,4-Trimethylbenzene	57		10	ug/L			09/22/25 22:39	10
1,2-Dibromo-3-Chloropropane	ND		20	ug/L			09/22/25 22:39	10
1,2-Dibromoethane (EDB)	ND		10	ug/L			09/22/25 22:39	10
1,2-Dichlorobenzene	ND		10	ug/L			09/22/25 22:39	10
1,2-Dichloroethane (EDC)	ND		10	ug/L			09/22/25 22:39	10
1,2-Dichloropropane	ND		10	ug/L			09/22/25 22:39	10
1,3,5-Trimethylbenzene	ND		10	ug/L			09/22/25 22:39	10
1,3-Dichlorobenzene	ND		10	ug/L			09/22/25 22:39	10
1,3-Dichloropropane	ND		10	ug/L			09/22/25 22:39	10
1,4-Dichlorobenzene	ND		10	ug/L			09/22/25 22:39	10
1-Methylnaphthalene	ND		40	ug/L			09/22/25 22:39	10
2,2-Dichloropropane	ND		20	ug/L			09/22/25 22:39	10
2-Butanone	ND		100	ug/L			09/22/25 22:39	10
2-Chlorotoluene	ND		10	ug/L			09/22/25 22:39	10
2-Hexanone	ND		100	ug/L			09/22/25 22:39	10
2-Methylnaphthalene	ND		40	ug/L			09/22/25 22:39	10
4-Chlorotoluene	ND		10	ug/L			09/22/25 22:39	10
4-Isopropyltoluene	ND		10	ug/L			09/22/25 22:39	10
4-Methyl-2-pentanone	ND		100	ug/L			09/22/25 22:39	10
Acetone	ND		100	ug/L			09/22/25 22:39	10
Benzene	870		10	ug/L			09/22/25 22:39	10
Bromobenzene	ND		10	ug/L			09/22/25 22:39	10
Bromodichloromethane	ND		10	ug/L			09/22/25 22:39	10
Dibromochloromethane	ND		10	ug/L			09/22/25 22:39	10
Bromoform	ND		10	ug/L			09/22/25 22:39	10
Bromomethane	ND		30	ug/L			09/22/25 22:39	10
Carbon disulfide	ND		100	ug/L			09/22/25 22:39	10
Carbon tetrachloride	ND		10	ug/L			09/22/25 22:39	10
Chlorobenzene	ND		10	ug/L			09/22/25 22:39	10
Chloroethane	ND		20	ug/L			09/22/25 22:39	10
Chloroform	ND		10	ug/L			09/22/25 22:39	10
Chloromethane	ND		30	ug/L			09/22/25 22:39	10
cis-1,2-Dichloroethene	ND		10	ug/L			09/22/25 22:39	10
cis-1,3-Dichloropropene	ND		10	ug/L			09/22/25 22:39	10
Dibromomethane	ND		10	ug/L			09/22/25 22:39	10
Dichlorodifluoromethane	ND		10	ug/L			09/22/25 22:39	10
Ethylbenzene	100		10	ug/L			09/22/25 22:39	10
Hexachlorobutadiene	ND		10	ug/L			09/22/25 22:39	10
Isopropylbenzene	ND		10	ug/L			09/22/25 22:39	10

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW09

Lab Sample ID: 885-33713-4

Date Collected: 09/15/25 15:40

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		10	ug/L			09/22/25 22:39	10
Methylene Chloride	ND		25	ug/L			09/22/25 22:39	10
n-Butylbenzene	ND		30	ug/L			09/22/25 22:39	10
N-Propylbenzene	ND		10	ug/L			09/22/25 22:39	10
Naphthalene	ND		20	ug/L			09/22/25 22:39	10
sec-Butylbenzene	ND		10	ug/L			09/22/25 22:39	10
Styrene	ND		10	ug/L			09/22/25 22:39	10
tert-Butylbenzene	ND		10	ug/L			09/22/25 22:39	10
Tetrachloroethene (PCE)	ND		10	ug/L			09/22/25 22:39	10
Toluene	ND		10	ug/L			09/22/25 22:39	10
trans-1,2-Dichloroethene	ND		10	ug/L			09/22/25 22:39	10
trans-1,3-Dichloropropene	ND		10	ug/L			09/22/25 22:39	10
Trichloroethene (TCE)	ND		10	ug/L			09/22/25 22:39	10
Trichlorofluoromethane	ND		10	ug/L			09/22/25 22:39	10
Vinyl chloride	ND		10	ug/L			09/22/25 22:39	10
Xylenes, Total	ND		15	ug/L			09/22/25 22:39	10

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	92		70 - 130		09/22/25 22:39	10
Toluene-d8 (Surr)	106		70 - 130		09/22/25 22:39	10
4-Bromofluorobenzene (Surr)	97		70 - 130		09/22/25 22:39	10
Dibromofluoromethane (Surr)	106		70 - 130		09/22/25 22:39	10

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW12

Lab Sample ID: 885-33713-5

Date Collected: 09/16/25 10:55

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		1.0	ug/L			09/22/25 17:37	1
1,1,1-Trichloroethane	ND		1.0	ug/L			09/22/25 17:37	1
1,1,2,2-Tetrachloroethane	ND		2.0	ug/L			09/22/25 17:37	1
1,1,2-Trichloroethane	ND		1.0	ug/L			09/22/25 17:37	1
1,1-Dichloroethane	ND		1.0	ug/L			09/22/25 17:37	1
1,1-Dichloroethene	ND		1.0	ug/L			09/22/25 17:37	1
1,1-Dichloropropene	ND		1.0	ug/L			09/22/25 17:37	1
1,2,3-Trichlorobenzene	ND		1.0	ug/L			09/22/25 17:37	1
1,2,3-Trichloropropane	ND		2.0	ug/L			09/22/25 17:37	1
1,2,4-Trichlorobenzene	ND		1.0	ug/L			09/22/25 17:37	1
1,2,4-Trimethylbenzene	1.7		1.0	ug/L			09/22/25 17:37	1
1,2-Dibromo-3-Chloropropane	ND		2.0	ug/L			09/22/25 17:37	1
1,2-Dibromoethane (EDB)	ND		1.0	ug/L			09/22/25 17:37	1
1,2-Dichlorobenzene	ND		1.0	ug/L			09/22/25 17:37	1
1,2-Dichloroethane (EDC)	ND		1.0	ug/L			09/22/25 17:37	1
1,2-Dichloropropane	ND		1.0	ug/L			09/22/25 17:37	1
1,3,5-Trimethylbenzene	ND		1.0	ug/L			09/22/25 17:37	1
1,3-Dichlorobenzene	ND		1.0	ug/L			09/22/25 17:37	1
1,3-Dichloropropane	ND		1.0	ug/L			09/22/25 17:37	1
1,4-Dichlorobenzene	ND		1.0	ug/L			09/22/25 17:37	1
1-Methylnaphthalene	ND		4.0	ug/L			09/22/25 17:37	1
2,2-Dichloropropane	ND		2.0	ug/L			09/22/25 17:37	1
2-Butanone	ND		10	ug/L			09/22/25 17:37	1
2-Chlorotoluene	ND		1.0	ug/L			09/22/25 17:37	1
2-Hexanone	ND		10	ug/L			09/22/25 17:37	1
2-Methylnaphthalene	ND		4.0	ug/L			09/22/25 17:37	1
4-Chlorotoluene	ND		1.0	ug/L			09/22/25 17:37	1
4-Isopropyltoluene	ND		1.0	ug/L			09/22/25 17:37	1
4-Methyl-2-pentanone	ND		10	ug/L			09/22/25 17:37	1
Acetone	ND		10	ug/L			09/22/25 17:37	1
Benzene	13		1.0	ug/L			09/22/25 17:37	1
Bromobenzene	ND		1.0	ug/L			09/22/25 17:37	1
Bromodichloromethane	1.8		1.0	ug/L			09/22/25 17:37	1
Dibromochloromethane	ND		1.0	ug/L			09/22/25 17:37	1
Bromoform	ND		1.0	ug/L			09/22/25 17:37	1
Bromomethane	ND		3.0	ug/L			09/22/25 17:37	1
Carbon disulfide	ND		10	ug/L			09/22/25 17:37	1
Carbon tetrachloride	ND		1.0	ug/L			09/22/25 17:37	1
Chlorobenzene	ND		1.0	ug/L			09/22/25 17:37	1
Chloroethane	ND		2.0	ug/L			09/22/25 17:37	1
Chloroform	11		1.0	ug/L			09/22/25 17:37	1
Chloromethane	ND		3.0	ug/L			09/22/25 17:37	1
cis-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 17:37	1
cis-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 17:37	1
Dibromomethane	ND		1.0	ug/L			09/22/25 17:37	1
Dichlorodifluoromethane	ND		1.0	ug/L			09/22/25 17:37	1
Ethylbenzene	3.3		1.0	ug/L			09/22/25 17:37	1
Hexachlorobutadiene	ND		1.0	ug/L			09/22/25 17:37	1
Isopropylbenzene	5.4		1.0	ug/L			09/22/25 17:37	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW12

Lab Sample ID: 885-33713-5

Date Collected: 09/16/25 10:55

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		1.0	ug/L			09/22/25 17:37	1
Methylene Chloride	ND		2.5	ug/L			09/22/25 17:37	1
n-Butylbenzene	ND		3.0	ug/L			09/22/25 17:37	1
N-Propylbenzene	3.0		1.0	ug/L			09/22/25 17:37	1
Naphthalene	5.4		2.0	ug/L			09/22/25 17:37	1
sec-Butylbenzene	1.5		1.0	ug/L			09/22/25 17:37	1
Styrene	ND		1.0	ug/L			09/22/25 17:37	1
tert-Butylbenzene	ND		1.0	ug/L			09/22/25 17:37	1
Tetrachloroethene (PCE)	ND		1.0	ug/L			09/22/25 17:37	1
Toluene	ND		1.0	ug/L			09/22/25 17:37	1
trans-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 17:37	1
trans-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 17:37	1
Trichloroethene (TCE)	ND		1.0	ug/L			09/22/25 17:37	1
Trichlorofluoromethane	ND		1.0	ug/L			09/22/25 17:37	1
Vinyl chloride	ND		1.0	ug/L			09/22/25 17:37	1
Xylenes, Total	9.4		1.5	ug/L			09/22/25 17:37	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	86		70 - 130		09/22/25 17:37	1
Toluene-d8 (Surr)	105		70 - 130		09/22/25 17:37	1
4-Bromofluorobenzene (Surr)	100		70 - 130		09/22/25 17:37	1
Dibromofluoromethane (Surr)	100		70 - 130		09/22/25 17:37	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW11

Lab Sample ID: 885-33713-6

Date Collected: 09/16/25 11:30

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		1.0	ug/L			09/22/25 18:04	1
1,1,1-Trichloroethane	ND		1.0	ug/L			09/22/25 18:04	1
1,1,2,2-Tetrachloroethane	ND		2.0	ug/L			09/22/25 18:04	1
1,1,2-Trichloroethane	ND		1.0	ug/L			09/22/25 18:04	1
1,1-Dichloroethane	ND		1.0	ug/L			09/22/25 18:04	1
1,1-Dichloroethene	ND		1.0	ug/L			09/22/25 18:04	1
1,1-Dichloropropene	ND		1.0	ug/L			09/22/25 18:04	1
1,2,3-Trichlorobenzene	ND		1.0	ug/L			09/22/25 18:04	1
1,2,3-Trichloropropane	ND		2.0	ug/L			09/22/25 18:04	1
1,2,4-Trichlorobenzene	ND		1.0	ug/L			09/22/25 18:04	1
1,2,4-Trimethylbenzene	ND		1.0	ug/L			09/22/25 18:04	1
1,2-Dibromo-3-Chloropropane	ND		2.0	ug/L			09/22/25 18:04	1
1,2-Dibromoethane (EDB)	ND		1.0	ug/L			09/22/25 18:04	1
1,2-Dichlorobenzene	ND		1.0	ug/L			09/22/25 18:04	1
1,2-Dichloroethane (EDC)	ND		1.0	ug/L			09/22/25 18:04	1
1,2-Dichloropropane	ND		1.0	ug/L			09/22/25 18:04	1
1,3,5-Trimethylbenzene	ND		1.0	ug/L			09/22/25 18:04	1
1,3-Dichlorobenzene	ND		1.0	ug/L			09/22/25 18:04	1
1,3-Dichloropropane	ND		1.0	ug/L			09/22/25 18:04	1
1,4-Dichlorobenzene	ND		1.0	ug/L			09/22/25 18:04	1
1-Methylnaphthalene	ND		4.0	ug/L			09/22/25 18:04	1
2,2-Dichloropropane	ND		2.0	ug/L			09/22/25 18:04	1
2-Butanone	ND		10	ug/L			09/22/25 18:04	1
2-Chlorotoluene	ND		1.0	ug/L			09/22/25 18:04	1
2-Hexanone	ND		10	ug/L			09/22/25 18:04	1
2-Methylnaphthalene	ND		4.0	ug/L			09/22/25 18:04	1
4-Chlorotoluene	ND		1.0	ug/L			09/22/25 18:04	1
4-Isopropyltoluene	ND		1.0	ug/L			09/22/25 18:04	1
4-Methyl-2-pentanone	ND		10	ug/L			09/22/25 18:04	1
Acetone	ND		10	ug/L			09/22/25 18:04	1
Benzene	ND		1.0	ug/L			09/22/25 18:04	1
Bromobenzene	ND		1.0	ug/L			09/22/25 18:04	1
Bromodichloromethane	6.3		1.0	ug/L			09/22/25 18:04	1
Dibromochloromethane	1.2		1.0	ug/L			09/22/25 18:04	1
Bromoform	ND		1.0	ug/L			09/22/25 18:04	1
Bromomethane	ND		3.0	ug/L			09/22/25 18:04	1
Carbon disulfide	ND		10	ug/L			09/22/25 18:04	1
Carbon tetrachloride	ND		1.0	ug/L			09/22/25 18:04	1
Chlorobenzene	ND		1.0	ug/L			09/22/25 18:04	1
Chloroethane	ND		2.0	ug/L			09/22/25 18:04	1
Chloroform	21		1.0	ug/L			09/22/25 18:04	1
Chloromethane	ND		3.0	ug/L			09/22/25 18:04	1
cis-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 18:04	1
cis-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 18:04	1
Dibromomethane	ND		1.0	ug/L			09/22/25 18:04	1
Dichlorodifluoromethane	ND		1.0	ug/L			09/22/25 18:04	1
Ethylbenzene	ND		1.0	ug/L			09/22/25 18:04	1
Hexachlorobutadiene	ND		1.0	ug/L			09/22/25 18:04	1
Isopropylbenzene	ND		1.0	ug/L			09/22/25 18:04	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW11

Lab Sample ID: 885-33713-6

Date Collected: 09/16/25 11:30

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		1.0	ug/L			09/22/25 18:04	1
Methylene Chloride	ND		2.5	ug/L			09/22/25 18:04	1
n-Butylbenzene	ND		3.0	ug/L			09/22/25 18:04	1
N-Propylbenzene	ND		1.0	ug/L			09/22/25 18:04	1
Naphthalene	ND		2.0	ug/L			09/22/25 18:04	1
sec-Butylbenzene	ND		1.0	ug/L			09/22/25 18:04	1
Styrene	ND		1.0	ug/L			09/22/25 18:04	1
tert-Butylbenzene	ND		1.0	ug/L			09/22/25 18:04	1
Tetrachloroethene (PCE)	ND		1.0	ug/L			09/22/25 18:04	1
Toluene	ND		1.0	ug/L			09/22/25 18:04	1
trans-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 18:04	1
trans-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 18:04	1
Trichloroethene (TCE)	ND		1.0	ug/L			09/22/25 18:04	1
Trichlorofluoromethane	ND		1.0	ug/L			09/22/25 18:04	1
Vinyl chloride	ND		1.0	ug/L			09/22/25 18:04	1
Xylenes, Total	ND		1.5	ug/L			09/22/25 18:04	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	92		70 - 130		09/22/25 18:04	1
Toluene-d8 (Surr)	108		70 - 130		09/22/25 18:04	1
4-Bromofluorobenzene (Surr)	93		70 - 130		09/22/25 18:04	1
Dibromofluoromethane (Surr)	105		70 - 130		09/22/25 18:04	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW22

Lab Sample ID: 885-33713-7

Date Collected: 09/16/25 13:45

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		1.0	ug/L			09/22/25 18:32	1
1,1,1-Trichloroethane	ND		1.0	ug/L			09/22/25 18:32	1
1,1,2,2-Tetrachloroethane	ND		2.0	ug/L			09/22/25 18:32	1
1,1,2-Trichloroethane	ND		1.0	ug/L			09/22/25 18:32	1
1,1-Dichloroethane	ND		1.0	ug/L			09/22/25 18:32	1
1,1-Dichloroethene	ND		1.0	ug/L			09/22/25 18:32	1
1,1-Dichloropropene	ND		1.0	ug/L			09/22/25 18:32	1
1,2,3-Trichlorobenzene	ND		1.0	ug/L			09/22/25 18:32	1
1,2,3-Trichloropropane	ND		2.0	ug/L			09/22/25 18:32	1
1,2,4-Trichlorobenzene	ND		1.0	ug/L			09/22/25 18:32	1
1,2,4-Trimethylbenzene	ND		1.0	ug/L			09/22/25 18:32	1
1,2-Dibromo-3-Chloropropane	ND		2.0	ug/L			09/22/25 18:32	1
1,2-Dibromoethane (EDB)	ND		1.0	ug/L			09/22/25 18:32	1
1,2-Dichlorobenzene	ND		1.0	ug/L			09/22/25 18:32	1
1,2-Dichloroethane (EDC)	ND		1.0	ug/L			09/22/25 18:32	1
1,2-Dichloropropane	ND		1.0	ug/L			09/22/25 18:32	1
1,3,5-Trimethylbenzene	ND		1.0	ug/L			09/22/25 18:32	1
1,3-Dichlorobenzene	ND		1.0	ug/L			09/22/25 18:32	1
1,3-Dichloropropane	ND		1.0	ug/L			09/22/25 18:32	1
1,4-Dichlorobenzene	ND		1.0	ug/L			09/22/25 18:32	1
1-Methylnaphthalene	ND		4.0	ug/L			09/22/25 18:32	1
2,2-Dichloropropane	ND		2.0	ug/L			09/22/25 18:32	1
2-Butanone	ND		10	ug/L			09/22/25 18:32	1
2-Chlorotoluene	ND		1.0	ug/L			09/22/25 18:32	1
2-Hexanone	ND		10	ug/L			09/22/25 18:32	1
2-Methylnaphthalene	ND		4.0	ug/L			09/22/25 18:32	1
4-Chlorotoluene	ND		1.0	ug/L			09/22/25 18:32	1
4-Isopropyltoluene	ND		1.0	ug/L			09/22/25 18:32	1
4-Methyl-2-pentanone	ND		10	ug/L			09/22/25 18:32	1
Acetone	ND		10	ug/L			09/22/25 18:32	1
Benzene	ND		1.0	ug/L			09/22/25 18:32	1
Bromobenzene	ND		1.0	ug/L			09/22/25 18:32	1
Bromodichloromethane	ND		1.0	ug/L			09/22/25 18:32	1
Dibromochloromethane	ND		1.0	ug/L			09/22/25 18:32	1
Bromoform	ND		1.0	ug/L			09/22/25 18:32	1
Bromomethane	ND		3.0	ug/L			09/22/25 18:32	1
Carbon disulfide	ND		10	ug/L			09/22/25 18:32	1
Carbon tetrachloride	ND		1.0	ug/L			09/22/25 18:32	1
Chlorobenzene	ND		1.0	ug/L			09/22/25 18:32	1
Chloroethane	ND		2.0	ug/L			09/22/25 18:32	1
Chloroform	3.1		1.0	ug/L			09/22/25 18:32	1
Chloromethane	ND		3.0	ug/L			09/22/25 18:32	1
cis-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 18:32	1
cis-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 18:32	1
Dibromomethane	ND		1.0	ug/L			09/22/25 18:32	1
Dichlorodifluoromethane	ND		1.0	ug/L			09/22/25 18:32	1
Ethylbenzene	ND		1.0	ug/L			09/22/25 18:32	1
Hexachlorobutadiene	ND		1.0	ug/L			09/22/25 18:32	1
Isopropylbenzene	ND		1.0	ug/L			09/22/25 18:32	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW22

Lab Sample ID: 885-33713-7

Date Collected: 09/16/25 13:45

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		1.0	ug/L			09/22/25 18:32	1
Methylene Chloride	ND		2.5	ug/L			09/22/25 18:32	1
n-Butylbenzene	ND		3.0	ug/L			09/22/25 18:32	1
N-Propylbenzene	ND		1.0	ug/L			09/22/25 18:32	1
Naphthalene	ND		2.0	ug/L			09/22/25 18:32	1
sec-Butylbenzene	ND		1.0	ug/L			09/22/25 18:32	1
Styrene	ND		1.0	ug/L			09/22/25 18:32	1
tert-Butylbenzene	ND		1.0	ug/L			09/22/25 18:32	1
Tetrachloroethene (PCE)	ND		1.0	ug/L			09/22/25 18:32	1
Toluene	ND		1.0	ug/L			09/22/25 18:32	1
trans-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 18:32	1
trans-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 18:32	1
Trichloroethene (TCE)	ND		1.0	ug/L			09/22/25 18:32	1
Trichlorofluoromethane	ND		1.0	ug/L			09/22/25 18:32	1
Vinyl chloride	ND		1.0	ug/L			09/22/25 18:32	1
Xylenes, Total	ND		1.5	ug/L			09/22/25 18:32	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	90		70 - 130		09/22/25 18:32	1
Toluene-d8 (Surr)	109		70 - 130		09/22/25 18:32	1
4-Bromofluorobenzene (Surr)	95		70 - 130		09/22/25 18:32	1
Dibromofluoromethane (Surr)	103		70 - 130		09/22/25 18:32	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW18

Lab Sample ID: 885-33713-8

Date Collected: 09/16/25 14:25

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		5.0	ug/L			09/22/25 23:06	5
1,1,1-Trichloroethane	ND		5.0	ug/L			09/22/25 23:06	5
1,1,2,2-Tetrachloroethane	ND		10	ug/L			09/22/25 23:06	5
1,1,2-Trichloroethane	ND		5.0	ug/L			09/22/25 23:06	5
1,1-Dichloroethane	ND		5.0	ug/L			09/22/25 23:06	5
1,1-Dichloroethene	ND		5.0	ug/L			09/22/25 23:06	5
1,1-Dichloropropene	ND		5.0	ug/L			09/22/25 23:06	5
1,2,3-Trichlorobenzene	ND		5.0	ug/L			09/22/25 23:06	5
1,2,3-Trichloropropane	ND		10	ug/L			09/22/25 23:06	5
1,2,4-Trichlorobenzene	ND		5.0	ug/L			09/22/25 23:06	5
1,2,4-Trimethylbenzene	ND		5.0	ug/L			09/22/25 23:06	5
1,2-Dibromo-3-Chloropropane	ND		10	ug/L			09/22/25 23:06	5
1,2-Dibromoethane (EDB)	ND		5.0	ug/L			09/22/25 23:06	5
1,2-Dichlorobenzene	ND		5.0	ug/L			09/22/25 23:06	5
1,2-Dichloroethane (EDC)	ND		5.0	ug/L			09/22/25 23:06	5
1,2-Dichloropropane	ND		5.0	ug/L			09/22/25 23:06	5
1,3,5-Trimethylbenzene	ND		5.0	ug/L			09/22/25 23:06	5
1,3-Dichlorobenzene	ND		5.0	ug/L			09/22/25 23:06	5
1,3-Dichloropropane	ND		5.0	ug/L			09/22/25 23:06	5
1,4-Dichlorobenzene	ND		5.0	ug/L			09/22/25 23:06	5
1-Methylnaphthalene	ND		20	ug/L			09/22/25 23:06	5
2,2-Dichloropropane	ND		10	ug/L			09/22/25 23:06	5
2-Butanone	ND		50	ug/L			09/22/25 23:06	5
2-Chlorotoluene	ND		5.0	ug/L			09/22/25 23:06	5
2-Hexanone	ND		50	ug/L			09/22/25 23:06	5
2-Methylnaphthalene	ND		20	ug/L			09/22/25 23:06	5
4-Chlorotoluene	ND		5.0	ug/L			09/22/25 23:06	5
4-Isopropyltoluene	5.3		5.0	ug/L			09/22/25 23:06	5
4-Methyl-2-pentanone	ND		50	ug/L			09/22/25 23:06	5
Acetone	ND		50	ug/L			09/22/25 23:06	5
Benzene	290		5.0	ug/L			09/22/25 23:06	5
Bromobenzene	ND		5.0	ug/L			09/22/25 23:06	5
Bromodichloromethane	ND		5.0	ug/L			09/22/25 23:06	5
Dibromochloromethane	ND		5.0	ug/L			09/22/25 23:06	5
Bromoform	ND		5.0	ug/L			09/22/25 23:06	5
Bromomethane	ND		15	ug/L			09/22/25 23:06	5
Carbon disulfide	ND		50	ug/L			09/22/25 23:06	5
Carbon tetrachloride	ND		5.0	ug/L			09/22/25 23:06	5
Chlorobenzene	ND		5.0	ug/L			09/22/25 23:06	5
Chloroethane	ND		10	ug/L			09/22/25 23:06	5
Chloroform	ND		5.0	ug/L			09/22/25 23:06	5
Chloromethane	ND		15	ug/L			09/22/25 23:06	5
cis-1,2-Dichloroethene	ND		5.0	ug/L			09/22/25 23:06	5
cis-1,3-Dichloropropene	ND		5.0	ug/L			09/22/25 23:06	5
Dibromomethane	ND		5.0	ug/L			09/22/25 23:06	5
Dichlorodifluoromethane	ND		5.0	ug/L			09/22/25 23:06	5
Ethylbenzene	ND		5.0	ug/L			09/22/25 23:06	5
Hexachlorobutadiene	ND		5.0	ug/L			09/22/25 23:06	5
Isopropylbenzene	34		5.0	ug/L			09/22/25 23:06	5

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW18

Lab Sample ID: 885-33713-8

Date Collected: 09/16/25 14:25

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		5.0	ug/L			09/22/25 23:06	5
Methylene Chloride	ND		13	ug/L			09/22/25 23:06	5
n-Butylbenzene	ND		15	ug/L			09/22/25 23:06	5
N-Propylbenzene	18		5.0	ug/L			09/22/25 23:06	5
Naphthalene	45		10	ug/L			09/22/25 23:06	5
sec-Butylbenzene	5.6		5.0	ug/L			09/22/25 23:06	5
Styrene	ND		5.0	ug/L			09/22/25 23:06	5
tert-Butylbenzene	ND		5.0	ug/L			09/22/25 23:06	5
Tetrachloroethene (PCE)	ND		5.0	ug/L			09/22/25 23:06	5
Toluene	ND		5.0	ug/L			09/22/25 23:06	5
trans-1,2-Dichloroethene	ND		5.0	ug/L			09/22/25 23:06	5
trans-1,3-Dichloropropene	ND		5.0	ug/L			09/22/25 23:06	5
Trichloroethene (TCE)	ND		5.0	ug/L			09/22/25 23:06	5
Trichlorofluoromethane	ND		5.0	ug/L			09/22/25 23:06	5
Vinyl chloride	ND		5.0	ug/L			09/22/25 23:06	5
Xylenes, Total	ND		7.5	ug/L			09/22/25 23:06	5
Surrogate	%Recovery	Qualifier	Limits			Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	93		70 - 130				09/22/25 23:06	5
Toluene-d8 (Surr)	106		70 - 130				09/22/25 23:06	5
4-Bromofluorobenzene (Surr)	99		70 - 130				09/22/25 23:06	5
Dibromofluoromethane (Surr)	105		70 - 130				09/22/25 23:06	5

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW26

Lab Sample ID: 885-33713-9

Date Collected: 09/16/25 16:30

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		1.0	ug/L			09/22/25 18:59	1
1,1,1-Trichloroethane	ND		1.0	ug/L			09/22/25 18:59	1
1,1,2,2-Tetrachloroethane	ND		2.0	ug/L			09/22/25 18:59	1
1,1,2-Trichloroethane	ND		1.0	ug/L			09/22/25 18:59	1
1,1-Dichloroethane	ND		1.0	ug/L			09/22/25 18:59	1
1,1-Dichloroethene	ND		1.0	ug/L			09/22/25 18:59	1
1,1-Dichloropropene	ND		1.0	ug/L			09/22/25 18:59	1
1,2,3-Trichlorobenzene	ND		1.0	ug/L			09/22/25 18:59	1
1,2,3-Trichloropropane	ND		2.0	ug/L			09/22/25 18:59	1
1,2,4-Trichlorobenzene	ND		1.0	ug/L			09/22/25 18:59	1
1,2,4-Trimethylbenzene	ND		1.0	ug/L			09/22/25 18:59	1
1,2-Dibromo-3-Chloropropane	ND		2.0	ug/L			09/22/25 18:59	1
1,2-Dibromoethane (EDB)	ND		1.0	ug/L			09/22/25 18:59	1
1,2-Dichlorobenzene	ND		1.0	ug/L			09/22/25 18:59	1
1,2-Dichloroethane (EDC)	ND		1.0	ug/L			09/22/25 18:59	1
1,2-Dichloropropane	ND		1.0	ug/L			09/22/25 18:59	1
1,3,5-Trimethylbenzene	ND		1.0	ug/L			09/22/25 18:59	1
1,3-Dichlorobenzene	ND		1.0	ug/L			09/22/25 18:59	1
1,3-Dichloropropane	ND		1.0	ug/L			09/22/25 18:59	1
1,4-Dichlorobenzene	ND		1.0	ug/L			09/22/25 18:59	1
1-Methylnaphthalene	ND		4.0	ug/L			09/22/25 18:59	1
2,2-Dichloropropane	ND		2.0	ug/L			09/22/25 18:59	1
2-Butanone	ND		10	ug/L			09/22/25 18:59	1
2-Chlorotoluene	ND		1.0	ug/L			09/22/25 18:59	1
2-Hexanone	ND		10	ug/L			09/22/25 18:59	1
2-Methylnaphthalene	ND		4.0	ug/L			09/22/25 18:59	1
4-Chlorotoluene	ND		1.0	ug/L			09/22/25 18:59	1
4-Isopropyltoluene	ND		1.0	ug/L			09/22/25 18:59	1
4-Methyl-2-pentanone	ND		10	ug/L			09/22/25 18:59	1
Acetone	ND		10	ug/L			09/22/25 18:59	1
Benzene	ND		1.0	ug/L			09/22/25 18:59	1
Bromobenzene	ND		1.0	ug/L			09/22/25 18:59	1
Bromodichloromethane	7.9		1.0	ug/L			09/22/25 18:59	1
Dibromochloromethane	2.5		1.0	ug/L			09/22/25 18:59	1
Bromoform	ND		1.0	ug/L			09/22/25 18:59	1
Bromomethane	ND		3.0	ug/L			09/22/25 18:59	1
Carbon disulfide	ND		10	ug/L			09/22/25 18:59	1
Carbon tetrachloride	ND		1.0	ug/L			09/22/25 18:59	1
Chlorobenzene	ND		1.0	ug/L			09/22/25 18:59	1
Chloroethane	ND		2.0	ug/L			09/22/25 18:59	1
Chloroform	26		1.0	ug/L			09/22/25 18:59	1
Chloromethane	ND		3.0	ug/L			09/22/25 18:59	1
cis-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 18:59	1
cis-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 18:59	1
Dibromomethane	ND		1.0	ug/L			09/22/25 18:59	1
Dichlorodifluoromethane	ND		1.0	ug/L			09/22/25 18:59	1
Ethylbenzene	ND		1.0	ug/L			09/22/25 18:59	1
Hexachlorobutadiene	ND		1.0	ug/L			09/22/25 18:59	1
Isopropylbenzene	ND		1.0	ug/L			09/22/25 18:59	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW26

Lab Sample ID: 885-33713-9

Date Collected: 09/16/25 16:30

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		1.0	ug/L			09/22/25 18:59	1
Methylene Chloride	ND		2.5	ug/L			09/22/25 18:59	1
n-Butylbenzene	ND		3.0	ug/L			09/22/25 18:59	1
N-Propylbenzene	ND		1.0	ug/L			09/22/25 18:59	1
Naphthalene	ND		2.0	ug/L			09/22/25 18:59	1
sec-Butylbenzene	ND		1.0	ug/L			09/22/25 18:59	1
Styrene	ND		1.0	ug/L			09/22/25 18:59	1
tert-Butylbenzene	ND		1.0	ug/L			09/22/25 18:59	1
Tetrachloroethene (PCE)	ND		1.0	ug/L			09/22/25 18:59	1
Toluene	ND		1.0	ug/L			09/22/25 18:59	1
trans-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 18:59	1
trans-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 18:59	1
Trichloroethene (TCE)	ND		1.0	ug/L			09/22/25 18:59	1
Trichlorofluoromethane	ND		1.0	ug/L			09/22/25 18:59	1
Vinyl chloride	ND		1.0	ug/L			09/22/25 18:59	1
Xylenes, Total	ND		1.5	ug/L			09/22/25 18:59	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	92		70 - 130		09/22/25 18:59	1
Toluene-d8 (Surr)	107		70 - 130		09/22/25 18:59	1
4-Bromofluorobenzene (Surr)	94		70 - 130		09/22/25 18:59	1
Dibromofluoromethane (Surr)	106		70 - 130		09/22/25 18:59	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW08

Lab Sample ID: 885-33713-10

Date Collected: 09/16/25 17:10

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		1.0	ug/L			09/22/25 19:26	1
1,1,1-Trichloroethane	ND		1.0	ug/L			09/22/25 19:26	1
1,1,2,2-Tetrachloroethane	ND		2.0	ug/L			09/22/25 19:26	1
1,1,2-Trichloroethane	ND		1.0	ug/L			09/22/25 19:26	1
1,1-Dichloroethane	ND		1.0	ug/L			09/22/25 19:26	1
1,1-Dichloroethene	ND		1.0	ug/L			09/22/25 19:26	1
1,1-Dichloropropene	ND		1.0	ug/L			09/22/25 19:26	1
1,2,3-Trichlorobenzene	ND		1.0	ug/L			09/22/25 19:26	1
1,2,3-Trichloropropane	ND		2.0	ug/L			09/22/25 19:26	1
1,2,4-Trichlorobenzene	ND		1.0	ug/L			09/22/25 19:26	1
1,2,4-Trimethylbenzene	ND		1.0	ug/L			09/22/25 19:26	1
1,2-Dibromo-3-Chloropropane	ND		2.0	ug/L			09/22/25 19:26	1
1,2-Dibromoethane (EDB)	ND		1.0	ug/L			09/22/25 19:26	1
1,2-Dichlorobenzene	ND		1.0	ug/L			09/22/25 19:26	1
1,2-Dichloroethane (EDC)	ND		1.0	ug/L			09/22/25 19:26	1
1,2-Dichloropropane	ND		1.0	ug/L			09/22/25 19:26	1
1,3,5-Trimethylbenzene	ND		1.0	ug/L			09/22/25 19:26	1
1,3-Dichlorobenzene	ND		1.0	ug/L			09/22/25 19:26	1
1,3-Dichloropropane	ND		1.0	ug/L			09/22/25 19:26	1
1,4-Dichlorobenzene	ND		1.0	ug/L			09/22/25 19:26	1
1-Methylnaphthalene	ND		4.0	ug/L			09/22/25 19:26	1
2,2-Dichloropropane	ND		2.0	ug/L			09/22/25 19:26	1
2-Butanone	ND		10	ug/L			09/22/25 19:26	1
2-Chlorotoluene	ND		1.0	ug/L			09/22/25 19:26	1
2-Hexanone	ND		10	ug/L			09/22/25 19:26	1
2-Methylnaphthalene	ND		4.0	ug/L			09/22/25 19:26	1
4-Chlorotoluene	ND		1.0	ug/L			09/22/25 19:26	1
4-Isopropyltoluene	ND		1.0	ug/L			09/22/25 19:26	1
4-Methyl-2-pentanone	ND		10	ug/L			09/22/25 19:26	1
Acetone	ND		10	ug/L			09/22/25 19:26	1
Benzene	ND		1.0	ug/L			09/22/25 19:26	1
Bromobenzene	ND		1.0	ug/L			09/22/25 19:26	1
Bromodichloromethane	1.3		1.0	ug/L			09/22/25 19:26	1
Dibromochloromethane	ND		1.0	ug/L			09/22/25 19:26	1
Bromoform	ND		1.0	ug/L			09/22/25 19:26	1
Bromomethane	ND		3.0	ug/L			09/22/25 19:26	1
Carbon disulfide	ND		10	ug/L			09/22/25 19:26	1
Carbon tetrachloride	ND		1.0	ug/L			09/22/25 19:26	1
Chlorobenzene	ND		1.0	ug/L			09/22/25 19:26	1
Chloroethane	ND		2.0	ug/L			09/22/25 19:26	1
Chloroform	11		1.0	ug/L			09/22/25 19:26	1
Chloromethane	ND		3.0	ug/L			09/22/25 19:26	1
cis-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 19:26	1
cis-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 19:26	1
Dibromomethane	ND		1.0	ug/L			09/22/25 19:26	1
Dichlorodifluoromethane	ND		1.0	ug/L			09/22/25 19:26	1
Ethylbenzene	ND		1.0	ug/L			09/22/25 19:26	1
Hexachlorobutadiene	ND		1.0	ug/L			09/22/25 19:26	1
Isopropylbenzene	ND		1.0	ug/L			09/22/25 19:26	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW08

Lab Sample ID: 885-33713-10

Date Collected: 09/16/25 17:10

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		1.0	ug/L			09/22/25 19:26	1
Methylene Chloride	ND		2.5	ug/L			09/22/25 19:26	1
n-Butylbenzene	ND		3.0	ug/L			09/22/25 19:26	1
N-Propylbenzene	ND		1.0	ug/L			09/22/25 19:26	1
Naphthalene	ND		2.0	ug/L			09/22/25 19:26	1
sec-Butylbenzene	ND		1.0	ug/L			09/22/25 19:26	1
Styrene	ND		1.0	ug/L			09/22/25 19:26	1
tert-Butylbenzene	ND		1.0	ug/L			09/22/25 19:26	1
Tetrachloroethene (PCE)	ND		1.0	ug/L			09/22/25 19:26	1
Toluene	ND		1.0	ug/L			09/22/25 19:26	1
trans-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 19:26	1
trans-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 19:26	1
Trichloroethene (TCE)	ND		1.0	ug/L			09/22/25 19:26	1
Trichlorofluoromethane	ND		1.0	ug/L			09/22/25 19:26	1
Vinyl chloride	ND		1.0	ug/L			09/22/25 19:26	1
Xylenes, Total	ND		1.5	ug/L			09/22/25 19:26	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	91		70 - 130		09/22/25 19:26	1
Toluene-d8 (Surr)	108		70 - 130		09/22/25 19:26	1
4-Bromofluorobenzene (Surr)	92		70 - 130		09/22/25 19:26	1
Dibromofluoromethane (Surr)	105		70 - 130		09/22/25 19:26	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW23

Lab Sample ID: 885-33713-11

Date Collected: 09/16/25 18:20

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		1.0	ug/L			09/22/25 19:54	1
1,1,1-Trichloroethane	ND		1.0	ug/L			09/22/25 19:54	1
1,1,2,2-Tetrachloroethane	ND		2.0	ug/L			09/22/25 19:54	1
1,1,2-Trichloroethane	ND		1.0	ug/L			09/22/25 19:54	1
1,1-Dichloroethane	ND		1.0	ug/L			09/22/25 19:54	1
1,1-Dichloroethene	ND		1.0	ug/L			09/22/25 19:54	1
1,1-Dichloropropene	ND		1.0	ug/L			09/22/25 19:54	1
1,2,3-Trichlorobenzene	ND		1.0	ug/L			09/22/25 19:54	1
1,2,3-Trichloropropane	ND		2.0	ug/L			09/22/25 19:54	1
1,2,4-Trichlorobenzene	ND		1.0	ug/L			09/22/25 19:54	1
1,2,4-Trimethylbenzene	ND		1.0	ug/L			09/22/25 19:54	1
1,2-Dibromo-3-Chloropropane	ND		2.0	ug/L			09/22/25 19:54	1
1,2-Dibromoethane (EDB)	ND		1.0	ug/L			09/22/25 19:54	1
1,2-Dichlorobenzene	ND		1.0	ug/L			09/22/25 19:54	1
1,2-Dichloroethane (EDC)	ND		1.0	ug/L			09/22/25 19:54	1
1,2-Dichloropropane	ND		1.0	ug/L			09/22/25 19:54	1
1,3,5-Trimethylbenzene	ND		1.0	ug/L			09/22/25 19:54	1
1,3-Dichlorobenzene	ND		1.0	ug/L			09/22/25 19:54	1
1,3-Dichloropropane	ND		1.0	ug/L			09/22/25 19:54	1
1,4-Dichlorobenzene	ND		1.0	ug/L			09/22/25 19:54	1
1-Methylnaphthalene	ND		4.0	ug/L			09/22/25 19:54	1
2,2-Dichloropropane	ND		2.0	ug/L			09/22/25 19:54	1
2-Butanone	ND		10	ug/L			09/22/25 19:54	1
2-Chlorotoluene	ND		1.0	ug/L			09/22/25 19:54	1
2-Hexanone	ND		10	ug/L			09/22/25 19:54	1
2-Methylnaphthalene	ND		4.0	ug/L			09/22/25 19:54	1
4-Chlorotoluene	ND		1.0	ug/L			09/22/25 19:54	1
4-Isopropyltoluene	ND		1.0	ug/L			09/22/25 19:54	1
4-Methyl-2-pentanone	ND		10	ug/L			09/22/25 19:54	1
Acetone	ND		10	ug/L			09/22/25 19:54	1
Benzene	ND		1.0	ug/L			09/22/25 19:54	1
Bromobenzene	ND		1.0	ug/L			09/22/25 19:54	1
Bromodichloromethane	ND		1.0	ug/L			09/22/25 19:54	1
Dibromochloromethane	ND		1.0	ug/L			09/22/25 19:54	1
Bromoform	ND		1.0	ug/L			09/22/25 19:54	1
Bromomethane	ND		3.0	ug/L			09/22/25 19:54	1
Carbon disulfide	ND		10	ug/L			09/22/25 19:54	1
Carbon tetrachloride	ND		1.0	ug/L			09/22/25 19:54	1
Chlorobenzene	ND		1.0	ug/L			09/22/25 19:54	1
Chloroethane	ND		2.0	ug/L			09/22/25 19:54	1
Chloroform	1.2		1.0	ug/L			09/22/25 19:54	1
Chloromethane	ND		3.0	ug/L			09/22/25 19:54	1
cis-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 19:54	1
cis-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 19:54	1
Dibromomethane	ND		1.0	ug/L			09/22/25 19:54	1
Dichlorodifluoromethane	ND		1.0	ug/L			09/22/25 19:54	1
Ethylbenzene	ND		1.0	ug/L			09/22/25 19:54	1
Hexachlorobutadiene	ND		1.0	ug/L			09/22/25 19:54	1
Isopropylbenzene	ND		1.0	ug/L			09/22/25 19:54	1

Eurofins Albuquerque

Client Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW23

Lab Sample ID: 885-33713-11

Date Collected: 09/16/25 18:20

Matrix: Water

Date Received: 09/19/25 07:15

Method: SW846 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Methyl-tert-butyl Ether (MTBE)	ND		1.0	ug/L			09/22/25 19:54	1
Methylene Chloride	ND		2.5	ug/L			09/22/25 19:54	1
n-Butylbenzene	ND		3.0	ug/L			09/22/25 19:54	1
N-Propylbenzene	ND		1.0	ug/L			09/22/25 19:54	1
Naphthalene	ND		2.0	ug/L			09/22/25 19:54	1
sec-Butylbenzene	ND		1.0	ug/L			09/22/25 19:54	1
Styrene	ND		1.0	ug/L			09/22/25 19:54	1
tert-Butylbenzene	ND		1.0	ug/L			09/22/25 19:54	1
Tetrachloroethene (PCE)	ND		1.0	ug/L			09/22/25 19:54	1
Toluene	ND		1.0	ug/L			09/22/25 19:54	1
trans-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 19:54	1
trans-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 19:54	1
Trichloroethene (TCE)	ND		1.0	ug/L			09/22/25 19:54	1
Trichlorofluoromethane	ND		1.0	ug/L			09/22/25 19:54	1
Vinyl chloride	ND		1.0	ug/L			09/22/25 19:54	1
Xylenes, Total	ND		1.5	ug/L			09/22/25 19:54	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1,2-Dichloroethane-d4 (Surr)	93		70 - 130		09/22/25 19:54	1
Toluene-d8 (Surr)	107		70 - 130		09/22/25 19:54	1
4-Bromofluorobenzene (Surr)	92		70 - 130		09/22/25 19:54	1
Dibromofluoromethane (Surr)	110		70 - 130		09/22/25 19:54	1

Eurofins Albuquerque

QC Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Method: 8260B - Volatile Organic Compounds (GC/MS)

Lab Sample ID: MB 885-35165/4

Matrix: Water

Analysis Batch: 35165

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
1,1,1,2-Tetrachloroethane	ND		1.0	ug/L			09/22/25 13:57	1
1,1,1-Trichloroethane	ND		1.0	ug/L			09/22/25 13:57	1
1,1,2,2-Tetrachloroethane	ND		2.0	ug/L			09/22/25 13:57	1
1,1,2-Trichloroethane	ND		1.0	ug/L			09/22/25 13:57	1
1,1-Dichloroethane	ND		1.0	ug/L			09/22/25 13:57	1
1,1-Dichloroethene	ND		1.0	ug/L			09/22/25 13:57	1
1,1-Dichloropropene	ND		1.0	ug/L			09/22/25 13:57	1
1,2,3-Trichlorobenzene	ND		1.0	ug/L			09/22/25 13:57	1
1,2,3-Trichloropropane	ND		2.0	ug/L			09/22/25 13:57	1
1,2,4-Trichlorobenzene	ND		1.0	ug/L			09/22/25 13:57	1
1,2,4-Trimethylbenzene	ND		1.0	ug/L			09/22/25 13:57	1
1,2-Dibromo-3-Chloropropane	ND		2.0	ug/L			09/22/25 13:57	1
1,2-Dibromoethane (EDB)	ND		1.0	ug/L			09/22/25 13:57	1
1,2-Dichlorobenzene	ND		1.0	ug/L			09/22/25 13:57	1
1,2-Dichloroethane (EDC)	ND		1.0	ug/L			09/22/25 13:57	1
1,2-Dichloropropane	ND		1.0	ug/L			09/22/25 13:57	1
1,3,5-Trimethylbenzene	ND		1.0	ug/L			09/22/25 13:57	1
1,3-Dichlorobenzene	ND		1.0	ug/L			09/22/25 13:57	1
1,3-Dichloropropane	ND		1.0	ug/L			09/22/25 13:57	1
1,4-Dichlorobenzene	ND		1.0	ug/L			09/22/25 13:57	1
1-Methylnaphthalene	ND		4.0	ug/L			09/22/25 13:57	1
2,2-Dichloropropane	ND		2.0	ug/L			09/22/25 13:57	1
2-Butanone	ND		10	ug/L			09/22/25 13:57	1
2-Chlorotoluene	ND		1.0	ug/L			09/22/25 13:57	1
2-Hexanone	ND		10	ug/L			09/22/25 13:57	1
2-Methylnaphthalene	ND		4.0	ug/L			09/22/25 13:57	1
4-Chlorotoluene	ND		1.0	ug/L			09/22/25 13:57	1
4-Isopropyltoluene	ND		1.0	ug/L			09/22/25 13:57	1
4-Methyl-2-pentanone	ND		10	ug/L			09/22/25 13:57	1
Acetone	ND		10	ug/L			09/22/25 13:57	1
Benzene	ND		1.0	ug/L			09/22/25 13:57	1
Bromobenzene	ND		1.0	ug/L			09/22/25 13:57	1
Bromodichloromethane	ND		1.0	ug/L			09/22/25 13:57	1
Dibromochloromethane	ND		1.0	ug/L			09/22/25 13:57	1
Bromoform	ND		1.0	ug/L			09/22/25 13:57	1
Bromomethane	ND		3.0	ug/L			09/22/25 13:57	1
Carbon disulfide	ND		10	ug/L			09/22/25 13:57	1
Carbon tetrachloride	ND		1.0	ug/L			09/22/25 13:57	1
Chlorobenzene	ND		1.0	ug/L			09/22/25 13:57	1
Chloroethane	ND		2.0	ug/L			09/22/25 13:57	1
Chloroform	ND		1.0	ug/L			09/22/25 13:57	1
Chloromethane	ND		3.0	ug/L			09/22/25 13:57	1
cis-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 13:57	1
cis-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 13:57	1
Dibromomethane	ND		1.0	ug/L			09/22/25 13:57	1
Dichlorodifluoromethane	ND		1.0	ug/L			09/22/25 13:57	1
Ethylbenzene	ND		1.0	ug/L			09/22/25 13:57	1
Hexachlorobutadiene	ND		1.0	ug/L			09/22/25 13:57	1

Eurofins Albuquerque

QC Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Method: 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Lab Sample ID: MB 885-35165/4

Matrix: Water

Analysis Batch: 35165

Client Sample ID: Method Blank

Prep Type: Total/NA

Analyte	MB	MB	RL	Unit	D	Prepared	Analyzed	Dil Fac
	Result	Qualifier						
Isopropylbenzene	ND		1.0	ug/L			09/22/25 13:57	1
Methyl-tert-butyl Ether (MTBE)	ND		1.0	ug/L			09/22/25 13:57	1
Methylene Chloride	ND		2.5	ug/L			09/22/25 13:57	1
n-Butylbenzene	ND		3.0	ug/L			09/22/25 13:57	1
N-Propylbenzene	ND		1.0	ug/L			09/22/25 13:57	1
Naphthalene	ND		2.0	ug/L			09/22/25 13:57	1
sec-Butylbenzene	ND		1.0	ug/L			09/22/25 13:57	1
Styrene	ND		1.0	ug/L			09/22/25 13:57	1
tert-Butylbenzene	ND		1.0	ug/L			09/22/25 13:57	1
Tetrachloroethene (PCE)	ND		1.0	ug/L			09/22/25 13:57	1
Toluene	ND		1.0	ug/L			09/22/25 13:57	1
trans-1,2-Dichloroethene	ND		1.0	ug/L			09/22/25 13:57	1
trans-1,3-Dichloropropene	ND		1.0	ug/L			09/22/25 13:57	1
Trichloroethene (TCE)	ND		1.0	ug/L			09/22/25 13:57	1
Trichlorofluoromethane	ND		1.0	ug/L			09/22/25 13:57	1
Vinyl chloride	ND		1.0	ug/L			09/22/25 13:57	1
Xylenes, Total	ND		1.5	ug/L			09/22/25 13:57	1

Surrogate	MB	MB	Limits	Prepared	Analyzed	Dil Fac
	%Recovery	Qualifier				
1,2-Dichloroethane-d4 (Surr)	91		70 - 130		09/22/25 13:57	1
Toluene-d8 (Surr)	109		70 - 130		09/22/25 13:57	1
4-Bromofluorobenzene (Surr)	92		70 - 130		09/22/25 13:57	1
Dibromofluoromethane (Surr)	103		70 - 130		09/22/25 13:57	1

Lab Sample ID: LCS 885-35165/3

Matrix: Water

Analysis Batch: 35165

Client Sample ID: Lab Control Sample

Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
1,1-Dichloroethene	20.0	17.5		ug/L		88	70 - 130
Benzene	20.0	19.6		ug/L		98	70 - 130
Chlorobenzene	20.0	21.8		ug/L		109	70 - 130
Toluene	20.0	21.4		ug/L		107	70 - 130
Trichloroethene (TCE)	20.0	17.6		ug/L		88	70 - 130

Surrogate	LCS	LCS	Limits
	%Recovery	Qualifier	
1,2-Dichloroethane-d4 (Surr)	88		70 - 130
Toluene-d8 (Surr)	106		70 - 130
4-Bromofluorobenzene (Surr)	94		70 - 130
Dibromofluoromethane (Surr)	101		70 - 130

Lab Sample ID: 885-33713-2 MS

Matrix: Water

Analysis Batch: 35165

Client Sample ID: MW16

Prep Type: Total/NA

Analyte	Sample	Sample	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
	Result	Qualifier							
1,1-Dichloroethene	ND		400	350		ug/L		88	70 - 130
Benzene	81		400	473		ug/L		98	70 - 130

Eurofins Albuquerque

QC Sample Results

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Method: 8260B - Volatile Organic Compounds (GC/MS) (Continued)

Lab Sample ID: 885-33713-2 MS

Matrix: Water

Analysis Batch: 35165

Client Sample ID: MW16

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Chlorobenzene	ND		400	421		ug/L		105	70 - 130
Toluene	ND		400	409		ug/L		102	70 - 130
Trichloroethene (TCE)	ND		400	356		ug/L		89	70 - 130
	MS %Recovery	MS Qualifier	MS Limits						
Surrogate									
1,2-Dichloroethane-d4 (Surr)	94		70 - 130						
Toluene-d8 (Surr)	108		70 - 130						
4-Bromofluorobenzene (Surr)	95		70 - 130						
Dibromofluoromethane (Surr)	106		70 - 130						

Lab Sample ID: 885-33713-2 MSD

Matrix: Water

Analysis Batch: 35165

Client Sample ID: MW16

Prep Type: Total/NA

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
1,1-Dichloroethene	ND		400	345		ug/L		86	70 - 130	2	20
Benzene	81		400	472		ug/L		98	70 - 130	0	20
Chlorobenzene	ND		400	419		ug/L		105	70 - 130	1	20
Toluene	ND		400	408		ug/L		102	70 - 130	0	20
Trichloroethene (TCE)	ND		400	352		ug/L		88	70 - 130	1	20
	MSD %Recovery	MSD Qualifier	MSD Limits								
Surrogate											
1,2-Dichloroethane-d4 (Surr)	92		70 - 130								
Toluene-d8 (Surr)	108		70 - 130								
4-Bromofluorobenzene (Surr)	94		70 - 130								
Dibromofluoromethane (Surr)	109		70 - 130								

Eurofins Albuquerque

QC Association Summary

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

GC/MS VOA

Analysis Batch: 35165

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
885-33713-1	MW17	Total/NA	Water	8260B	
885-33713-2	MW16	Total/NA	Water	8260B	
885-33713-3	MW19	Total/NA	Water	8260B	
885-33713-4	MW09	Total/NA	Water	8260B	
885-33713-5	MW12	Total/NA	Water	8260B	
885-33713-6	MW11	Total/NA	Water	8260B	
885-33713-7	MW22	Total/NA	Water	8260B	
885-33713-8	MW18	Total/NA	Water	8260B	
885-33713-9	MW26	Total/NA	Water	8260B	
885-33713-10	MW08	Total/NA	Water	8260B	
885-33713-11	MW23	Total/NA	Water	8260B	
MB 885-35165/4	Method Blank	Total/NA	Water	8260B	
LCS 885-35165/3	Lab Control Sample	Total/NA	Water	8260B	
885-33713-2 MS	MW16	Total/NA	Water	8260B	
885-33713-2 MSD	MW16	Total/NA	Water	8260B	

Lab Chronicle

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW17**Lab Sample ID: 885-33713-1****Date Collected: 09/15/25 11:10****Matrix: Water****Date Received: 09/19/25 07:15**

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		1	35165	JP	EET ALB	09/22/25 17:10

Client Sample ID: MW16**Lab Sample ID: 885-33713-2****Date Collected: 09/15/25 11:50****Matrix: Water****Date Received: 09/19/25 07:15**

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		20	35165	JP	EET ALB	09/22/25 20:21

Client Sample ID: MW19**Lab Sample ID: 885-33713-3****Date Collected: 09/15/25 13:55****Matrix: Water****Date Received: 09/19/25 07:15**

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		200	35165	JP	EET ALB	09/22/25 21:44

Client Sample ID: MW09**Lab Sample ID: 885-33713-4****Date Collected: 09/15/25 15:40****Matrix: Water****Date Received: 09/19/25 07:15**

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		10	35165	JP	EET ALB	09/22/25 22:39

Client Sample ID: MW12**Lab Sample ID: 885-33713-5****Date Collected: 09/16/25 10:55****Matrix: Water****Date Received: 09/19/25 07:15**

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		1	35165	JP	EET ALB	09/22/25 17:37

Client Sample ID: MW11**Lab Sample ID: 885-33713-6****Date Collected: 09/16/25 11:30****Matrix: Water****Date Received: 09/19/25 07:15**

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		1	35165	JP	EET ALB	09/22/25 18:04

Client Sample ID: MW22**Lab Sample ID: 885-33713-7****Date Collected: 09/16/25 13:45****Matrix: Water****Date Received: 09/19/25 07:15**

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		1	35165	JP	EET ALB	09/22/25 18:32

Eurofins Albuquerque

Lab Chronicle

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Client Sample ID: MW18
Date Collected: 09/16/25 14:25
Date Received: 09/19/25 07:15

Lab Sample ID: 885-33713-8
Matrix: Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		5	35165	JP	EET ALB	09/22/25 23:06

Client Sample ID: MW26
Date Collected: 09/16/25 16:30
Date Received: 09/19/25 07:15

Lab Sample ID: 885-33713-9
Matrix: Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		1	35165	JP	EET ALB	09/22/25 18:59

Client Sample ID: MW08
Date Collected: 09/16/25 17:10
Date Received: 09/19/25 07:15

Lab Sample ID: 885-33713-10
Matrix: Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		1	35165	JP	EET ALB	09/22/25 19:26

Client Sample ID: MW23
Date Collected: 09/16/25 18:20
Date Received: 09/19/25 07:15

Lab Sample ID: 885-33713-11
Matrix: Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8260B		1	35165	JP	EET ALB	09/22/25 19:54

Laboratory References:
EET ALB = Eurofins Albuquerque, 4901 Hawkins NE, Albuquerque, NM 87109, TEL (505)345-3975

Accreditation/Certification Summary

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Laboratory: Eurofins Albuquerque

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
New Mexico	State	NM9425, NM0901	02-27-26

The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.

Analysis Method	Prep Method	Matrix	Analyte
8260B		Water	1,1,1,2-Tetrachloroethane
8260B		Water	1,1,1-Trichloroethane
8260B		Water	1,1,2,2-Tetrachloroethane
8260B		Water	1,1,2-Trichloroethane
8260B		Water	1,1-Dichloroethane
8260B		Water	1,1-Dichloroethene
8260B		Water	1,1-Dichloropropene
8260B		Water	1,2,3-Trichlorobenzene
8260B		Water	1,2,3-Trichloropropane
8260B		Water	1,2,4-Trichlorobenzene
8260B		Water	1,2,4-Trimethylbenzene
8260B		Water	1,2-Dibromo-3-Chloropropane
8260B		Water	1,2-Dibromoethane (EDB)
8260B		Water	1,2-Dichlorobenzene
8260B		Water	1,2-Dichloroethane (EDC)
8260B		Water	1,2-Dichloropropane
8260B		Water	1,3,5-Trimethylbenzene
8260B		Water	1,3-Dichlorobenzene
8260B		Water	1,3-Dichloropropane
8260B		Water	1,4-Dichlorobenzene
8260B		Water	1-Methylnaphthalene
8260B		Water	2,2-Dichloropropane
8260B		Water	2-Butanone
8260B		Water	2-Chlorotoluene
8260B		Water	2-Hexanone
8260B		Water	2-Methylnaphthalene
8260B		Water	4-Chlorotoluene
8260B		Water	4-Isopropyltoluene
8260B		Water	4-Methyl-2-pentanone
8260B		Water	Acetone
8260B		Water	Benzene
8260B		Water	Bromobenzene
8260B		Water	Bromodichloromethane
8260B		Water	Bromoform
8260B		Water	Bromomethane
8260B		Water	Carbon disulfide
8260B		Water	Carbon tetrachloride
8260B		Water	Chlorobenzene
8260B		Water	Chloroethane
8260B		Water	Chloroform
8260B		Water	Chloromethane
8260B		Water	cis-1,2-Dichloroethene
8260B		Water	cis-1,3-Dichloropropene
8260B		Water	Dibromochloromethane
8260B		Water	Dibromomethane

Eurofins Albuquerque

Accreditation/Certification Summary

Client: Hilcorp Energy
Project/Site: Standard #1 Groundwater

Job ID: 885-33713-1

Laboratory: Eurofins Albuquerque (Continued)

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.			
Analysis Method	Prep Method	Matrix	Analyte
8260B		Water	Dichlorodifluoromethane
8260B		Water	Ethylbenzene
8260B		Water	Hexachlorobutadiene
8260B		Water	Isopropylbenzene
8260B		Water	Methylene Chloride
8260B		Water	Methyl-tert-butyl Ether (MTBE)
8260B		Water	Naphthalene
8260B		Water	n-Butylbenzene
8260B		Water	N-Propylbenzene
8260B		Water	sec-Butylbenzene
8260B		Water	Styrene
8260B		Water	tert-Butylbenzene
8260B		Water	Tetrachloroethene (PCE)
8260B		Water	Toluene
8260B		Water	trans-1,2-Dichloroethene
8260B		Water	trans-1,3-Dichloropropene
8260B		Water	Trichloroethene (TCE)
8260B		Water	Trichlorofluoromethane
8260B		Water	Vinyl chloride
8260B		Water	Xylenes, Total
Oregon	NELAP	NM100001	09-23-25

Login Sample Receipt Checklist

Client: Hilcorp Energy

Job Number: 885-33713-1

Login Number: 33713

List Source: Eurofins Albuquerque

List Number: 1

Creator: Casarrubias, Tracy

Question	Answer	Comment
Radioactivity wasn't checked or is $\leq$ background as measured by a survey meter.	N/A	
The cooler's custody seal, if present, is intact.	True	
Sample custody seals, if present, are intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the containers received and the COC.	True	
Samples are received within Holding Time (excluding tests with immediate HTs)	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified.	N/A	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
Containers requiring zero headspace have no headspace or bubble is $<6\text{mm}$ (1/4").	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Residual Chlorine Checked.	N/A	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 514699

CONDITIONS

Operator: HILCORP ENERGY COMPANY 1111 Travis Street Houston, TX 77002	OGRID: 372171
	Action Number: 514699
	Action Type: [REPORT] Alternative Remediation Report (C-141AR)

CONDITIONS

Created By	Condition	Condition Date
nvez	1. Continue O&M & sampling as stated in Discussions and Recommendations in report. 2. Submit next quarterly report by January 15, 2026.	10/20/2025