



SITE CHARACTERIZATION AND REMEDIATION PLAN

Prepared For:

Devon Energy Production Company, LP.

5315 Buena Vista Dr.

Carlsbad, NM 88220

Site Information:

Flagler 8 CTB 1

Incident Numbers nAPP2521623297 and nAPP2524723254

Unit M, Section 8, Township 25 South, Range 30 East

Lea County, New Mexico

(32.13873°, -103.59416°)

Carlsbad • Houston • Midland • San Antonio • Lubbock • Hobbs • Lafayette

SYNOPSIS

Etech Environmental & Safety Solutions, Inc. (Etech), on behalf of Devon Energy Production Company, LP (Devon), presents the following Site Characterization and Remediation Plan (SCRP) detailing delineation soil sampling activities and subsequent confirmation soil sampling activities, associated with two inadvertent releases of produced water at the Flagler 8 CTB 1 (Site). Based on laboratory analytical results, Devon proposes this SCR, which summarizes initial response efforts and details remediation objectives to rectify environmental impacts.

SITE LOCATION AND RELEASE BACKGROUND

The production pad facility (fAPP2122855254) for the Site is associated with oil and gas exploration and production operations on Federal Land managed by the BLM, located at (32.1387, -103.5941). The subject releases are located approximately 0.42 miles northwest of the production facility (32.14032, -103.60106).

nAPP2521623297

On August 8, 2025, a pinhole leak from a valve was discovered, releasing approximately 10 barrels (bbls) of produced water onto a containment skid, which overflowed onto the production pad surface. A vacuum truck was immediately dispatched and recovered approximately 9 bbls of free-standing fluids from the containment skid. The incident was reported to the NMOCD on a Release Notification and Corrective Action Form (Form C-141) on August 11, 2025, and was assigned Incident Number nAPP2521623297. The observed extent of the release was mapped using a handheld Global Positioning System (GPS) unit, hereafter referred to as Area of Concern #1 (AOC #1), as depicted in **Figure 2 of Appendix A**.

nAPP2524723254

On September 3, 2025, a pinhole leak on a water dump line was discovered, releasing approximately 5 bbls of produced water onto the production pad surface, overlapping AOC #1. A vacuum truck was immediately dispatched and recovered approximately 3 bbls of free-standing fluids from the production pad surface. The incident was reported to the NMOCD on a Form C-141 on September 17, 2025, and assigned Incident Number nAPP2524723254. The observed extent of the release was mapped using a handheld GPS unit, hereafter referred to as Area of Concern #2 (AOC #2), as depicted in **Figure 2 in Appendix A**.

Devon submitted an extension request for Incident Numbers nAPP2521623297 and nAPP2524723254 on October 31, 2025, and December 1, 2025, respectively, to allow sufficient time for further planning, soil sampling, and preparation of a Sampling Variance Request (SVR). Given the presence of critical surface production equipment within AOC #1 and AOC #2, hereafter collectively referred to as the Area of Concern (AOC), soil beneath the surface equipment was not accessible for confirmation soil sampling. However, the NMOCD advised that the SVR submission was best characterized as an alternative sampling plan rather than a formal SVR. The NMOCD approved the alternative sampling plan on December 1, 2025, allowing the revised approach to proceed.

SITE CHARACTERIZATION AND CLOSURE CRITERIA

Etech characterized the Site according to Table I, Closure Criteria for Soils Impacted by a Release, of Title 19, Chapter 15, Part 29, Section 12 (19.15.29.12) of the New Mexico Administrative Code (NMAC), considering depth to groundwater and the proximity to:

- Any continuously flowing watercourse or any other significant watercourse;
- Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark);
- An occupied permanent residence, school, hospital, institution, or church;

- A spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes;
- Any freshwater well or spring;
- Incorporated municipal boundaries or a defined municipal fresh water well field covered under a municipal ordinance;
- A wetland;
- A subsurface mine;
- An unstable area (i.e. high karst potential); and
- A 100-year floodplain.

Regional depth to groundwater at the Site is estimated to be between 51 and 100 feet below ground surface (bgs) based on a nearby soil boring advanced by Atkins Engineering Associates, Inc., located approximately ½-mile southeast of the Site. Soil boring (C-04627-POD1) was advanced on June 7, 2022, via a truck mounted drill rig equipped with a hollow stem auger to a total depth of 55 feet bgs. No fluids were observed throughout the drilling process, nor after a 72-hour observation period. Following the observation period, the borehole was plugged and abandoned in accordance with the applicable regulations. The referenced well record is provided in Appendix B. The soil boring location and other nearby soil borings and/or regional groundwater well locations are shown in **Figure 1A** in **Appendix A**.

All other potential receptors are not within the established buffers in NMAC 19.15.29.12. Receptor details and sources used to determine the site characterization are included in Figure 1B and Figure 1C in Appendix A.

Based on the results from the desktop review and estimated regional depth to groundwater at the Site, the following Closure Criteria will be applied:

Constituents of Concern (COCs)	Laboratory Analytical Method	Closure Criteria [†]
Chloride	Environmental Protection Agency (EPA) 300.0	10,000 milligram per kilogram (mg/kg)
Total Petroleum Hydrocarbon (TPH)	EPA 8015 M/D	2,500 mg/kg
TPH-Gasoline Range Organics (GRO) + TPH-Diesel Range Organics (DRO)	EPA 8015 M/D	1,000 mg/kg
Benzene	EPA 8021B/8260B	10 mg/kg
Benzene, Toluene, Ethylbenzene, Total Xylenes (BTEX)	EPA 8021B/8260B	50 mg/kg

[†]The reclamation concentration requirements of 600 mg/kg chloride and 100 mg/kg TPH apply to the top 4 feet of areas to be immediately reclaimed following remediation pursuant to NMAC 19.15.17.13.

DELINEATION SOIL SAMPLING ACTIVITIES

From September 25, 2025, to December 15, 2025, Etech conducted delineation activities to assess the presence of residual soil impacts associated with the AOC. Eighteen delineation boreholes were advanced within and around the AOC via hand auger. Delineation was driven by field screening soil for volatile organic compounds (VOCs) utilizing a calibrated photoionization detector (PID) and chloride using Hach® chloride QuanTab® test strips. A minimum of two soil samples were collected from each delineation soil sampling location, representing the highest observed field screening concentrations and the greatest depth. Field screening results and soil descriptions are included on soil sampling logs shown in **Appendix C**. The delineation soil sample locations are shown in **Figure 2** in **Appendix A**. Photographic documentation of delineation activities is included in **Appendix D**.

Delineation soil samples were placed directly into lab provided pre-cleaned glass jars, packaged with minimal void space, labeled, and immediately placed on ice. The soil samples were transported under strict

chain-of-custody procedures to Envirotech, Inc. Laboratories (Envirotech) in Farmington, New Mexico, for analysis of COCs.

DELINEATION LABORATORY ANALYTICAL RESULTS

Laboratory analytical results indicated that concentrations of the COCs in all delineation soil samples were below the applicable Site Closure Criteria, except for chloride concentrations in soil samples collected from BH01, BH02, and BH05 up to 1-foot bgs. Chloride exceedances with respect to the Site Closure Criteria were characterized by concentrations ranging from 10,900 mg/kg to 17,800 mg/kg.

Laboratory analytical results are summarized in **Table 1**, included in **Appendix E**. The executed chain-of-custody form and laboratory reports are provided in **Appendix F**.

CONFIRMATION SOIL SAMPLING ACTIVITIES

Concurrently with delineation activities, Etech collected 5-point composite confirmation soil samples within the AOC at an approved sampling frequency for the floors, with each composite representing no more than 400 square feet (FS01 through FS09), and from sidewalls (SW01 and SW02) at the standard 200 square feet per composite soil sample. Each 5-point composite soil sample was comprised of five equivalent aliquots homogenized in a 1-gallon, resealable plastic bag. Confirmation soil samples were handled and analyzed as previously described. The locations of the confirmation soil samples are shown in **Figure 3** in **Appendix A**. Photographic documentation of soil sampling activities is included in **Appendix D**.

CONFIRMATION LABORATORY ANALYTICAL RESULTS

Laboratory analytical results indicated that concentrations of BTEX and TPH in all confirmation soil samples were below the Site Closure Criteria.

With the exception of confirmation soil sampling location FS06, laboratory analytical results indicated that chloride concentrations for eight of the nine confirmation soil sampling locations exceeded the applicable Site Closure Criteria (FS01 through FS05, and FS07 through FS09). Residual chloride impacts are characterized by concentrations of 11,200 mg/kg and 45,200 mg/kg, respectively. Laboratory analytical results are summarized in **Table 1**, included in **Appendix E**. The executed chain-of-custody form and laboratory reports are provided in **Appendix F**.

PROPOSED REMEDIATION WORK PLAN

Based on delineation and confirmation soil sampling results, the following conclusions regarding the inadvertent releases are presented:

- Laboratory analytical results indicated chloride concentrations appear to exist at the surface throughout the majority of the AOC and within proximity of delineation soil sample locations BH01, BH02, and BH05 up to 2 feet bgs.
- Laboratory analytical results for delineation soil samples collected from BH08 and BH10 through BH17 indicated COC concentrations were below the Site Closure Criteria, which will assist with defining the lateral extent of impacts associated with the AOC.

Based on the conclusions drawn above, Devon proposes the following remedial corrective actions:

- Driven by confirmation and delineation soil sample analytical results, excavation(s) will be advanced laterally and vertically until the Site Closure Criteria is met and/or to the Maximum Extent Practical (MEP) as shown in **Figure 4** of **Appendix A**. However, advancement of the excavation may be inhibited by active production equipment or utilities, in which case, Devon may implement

encroachment requirements for the health and safety of on-site personnel and for the structural integrity of active production equipment. Such restrictions include:

- Decreasing the proposed excavation depth(s) in order to maintain surface and/or subsurface utility and production equipment stability.
- Decreasing or alternating the proposed excavation extent(s) in order to maintain surface and/or subsurface utility and production equipment stability.
- Impacted soil will be transported to a nearby landfill facility for disposal under approved Devon waste manifests.
- Following the completion of excavation activities, 5-point composite confirmation soil samples will be collected from the excavation floor and sidewalls. Confirmation soil samples will consist of five equivalent aliquots and will be homogenized in a 1-gallon resealable plastic bag. The soil samples will be handled and analyzed for COCs by an accredited laboratory as previously described.
- Upon receipt of confirmation soil sample laboratory analytical results, Devon will backfill the excavation(s) with clean, locally sourced soil and restored to "as close to its original state as possible".

PROPOSED SCHEDULE

Upon the notice of NMOCD approval of this SCRP, Devon will begin the proposed remediation activities and determine the next appropriate measure of action that will include:

- Documenting and estimating the amount of impacted soil located directly adjacent and/or beneath active production equipment and utilities to be left in place at the Site with a subsequent Deferral Request Report detailing remediation efforts and soil sampling activities.

Devon believes this SCRP will meet the requirements set forth in NMAC 19.15.29.13 and to be protective of human health, the environment, and groundwater. As Such Devon respectfully requests approval of this SCRP from the NMOCD.

If you have any questions or comments, please do not hesitate to contact Erick Herrera at (432) 305-6416 or erick@etechenv.com or Joseph S. Hernandez at (432) 305-6413 or joseph@etechenv.com. **Appendix G** provides email notification receipts for the subject release.



Erick Herrera
Operations Manager, EGTG
Consultant, Geologist



Joseph S. Hernandez
Division Director, EGTG (TX and NM)
Environmental and Geoscience Technical Group

cc: Jim Raley, Devon
New Mexico Oil Conservation Division
Bureau of Land Management

Appendices:

Appendix A: Figure 1: Site Map

Figure 1A: Site Characterization Map – Groundwater

Figure 1B: Site Characterization Map – Surficial Receptors

Figure 1C: Site Characterization Map – Subsurface Receptors

Figure 2: Delineation Soil Sample Locations

Figure 3: Confirmation Soil Sample Locations

Figure 4: Proposed Excavation Areas

Appendix B: Referenced Well Records

Appendix C: Soil Sampling Logs

Appendix D: Photographic Log

Appendix E: Tables

Appendix F: Laboratory Analytical Reports & Chain-of-Custody Documentation

Appendix G: Correspondence & Notifications

APPENDIX A

Figures



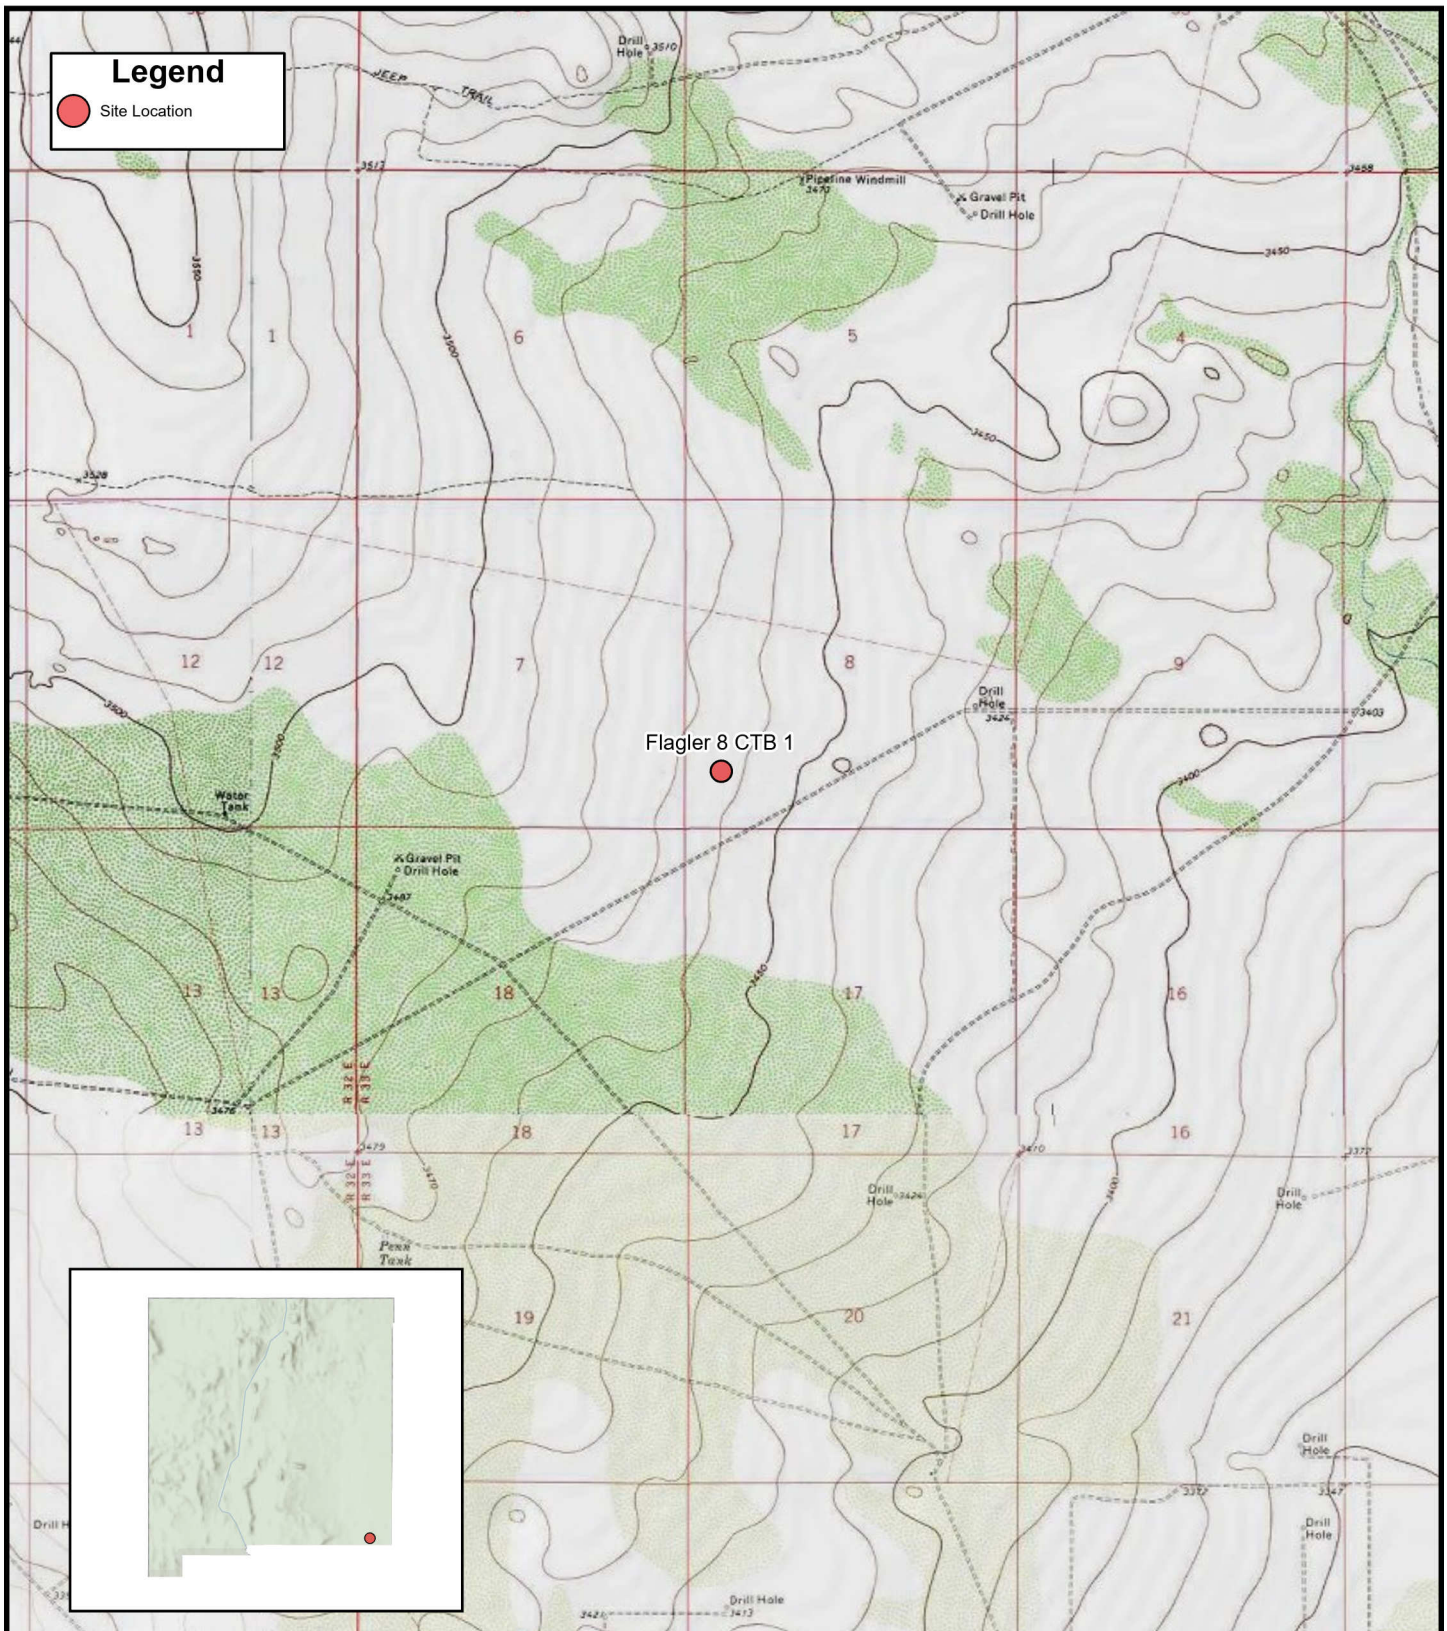

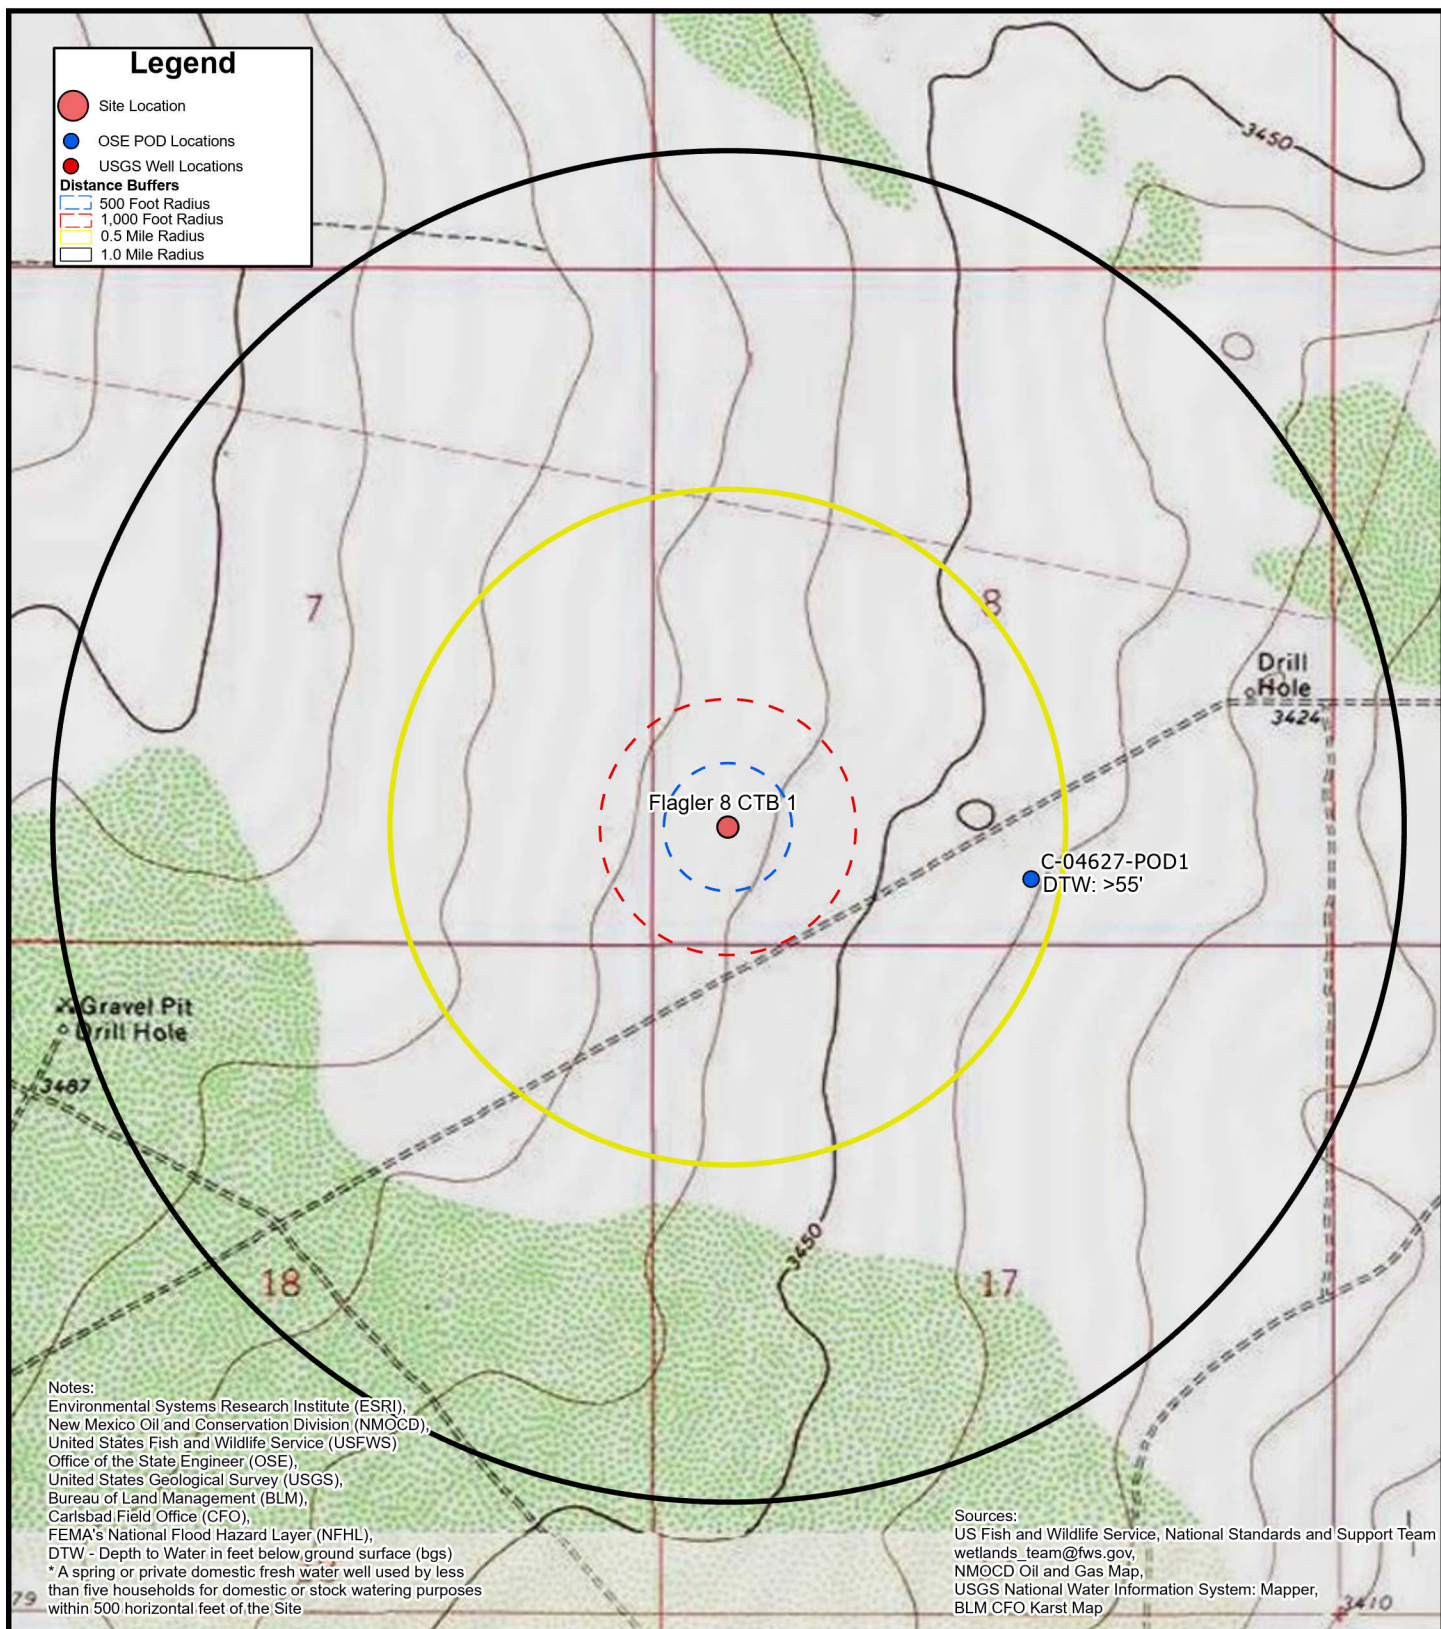


FIGURE 1

Site Location Map


Devon Energy Production Company, LP
Flagler 8 CTB 1
Unit M Sec 8 T25S R33E
Lea County, New Mexico





**FIGURE 1A
 Site Characterization Map
 Groundwater**

Devon Energy Production Company, LP
 Flagler 8 CTB 1
 Unit M Sec 8 T25S R33E
 Lea County, New Mexico



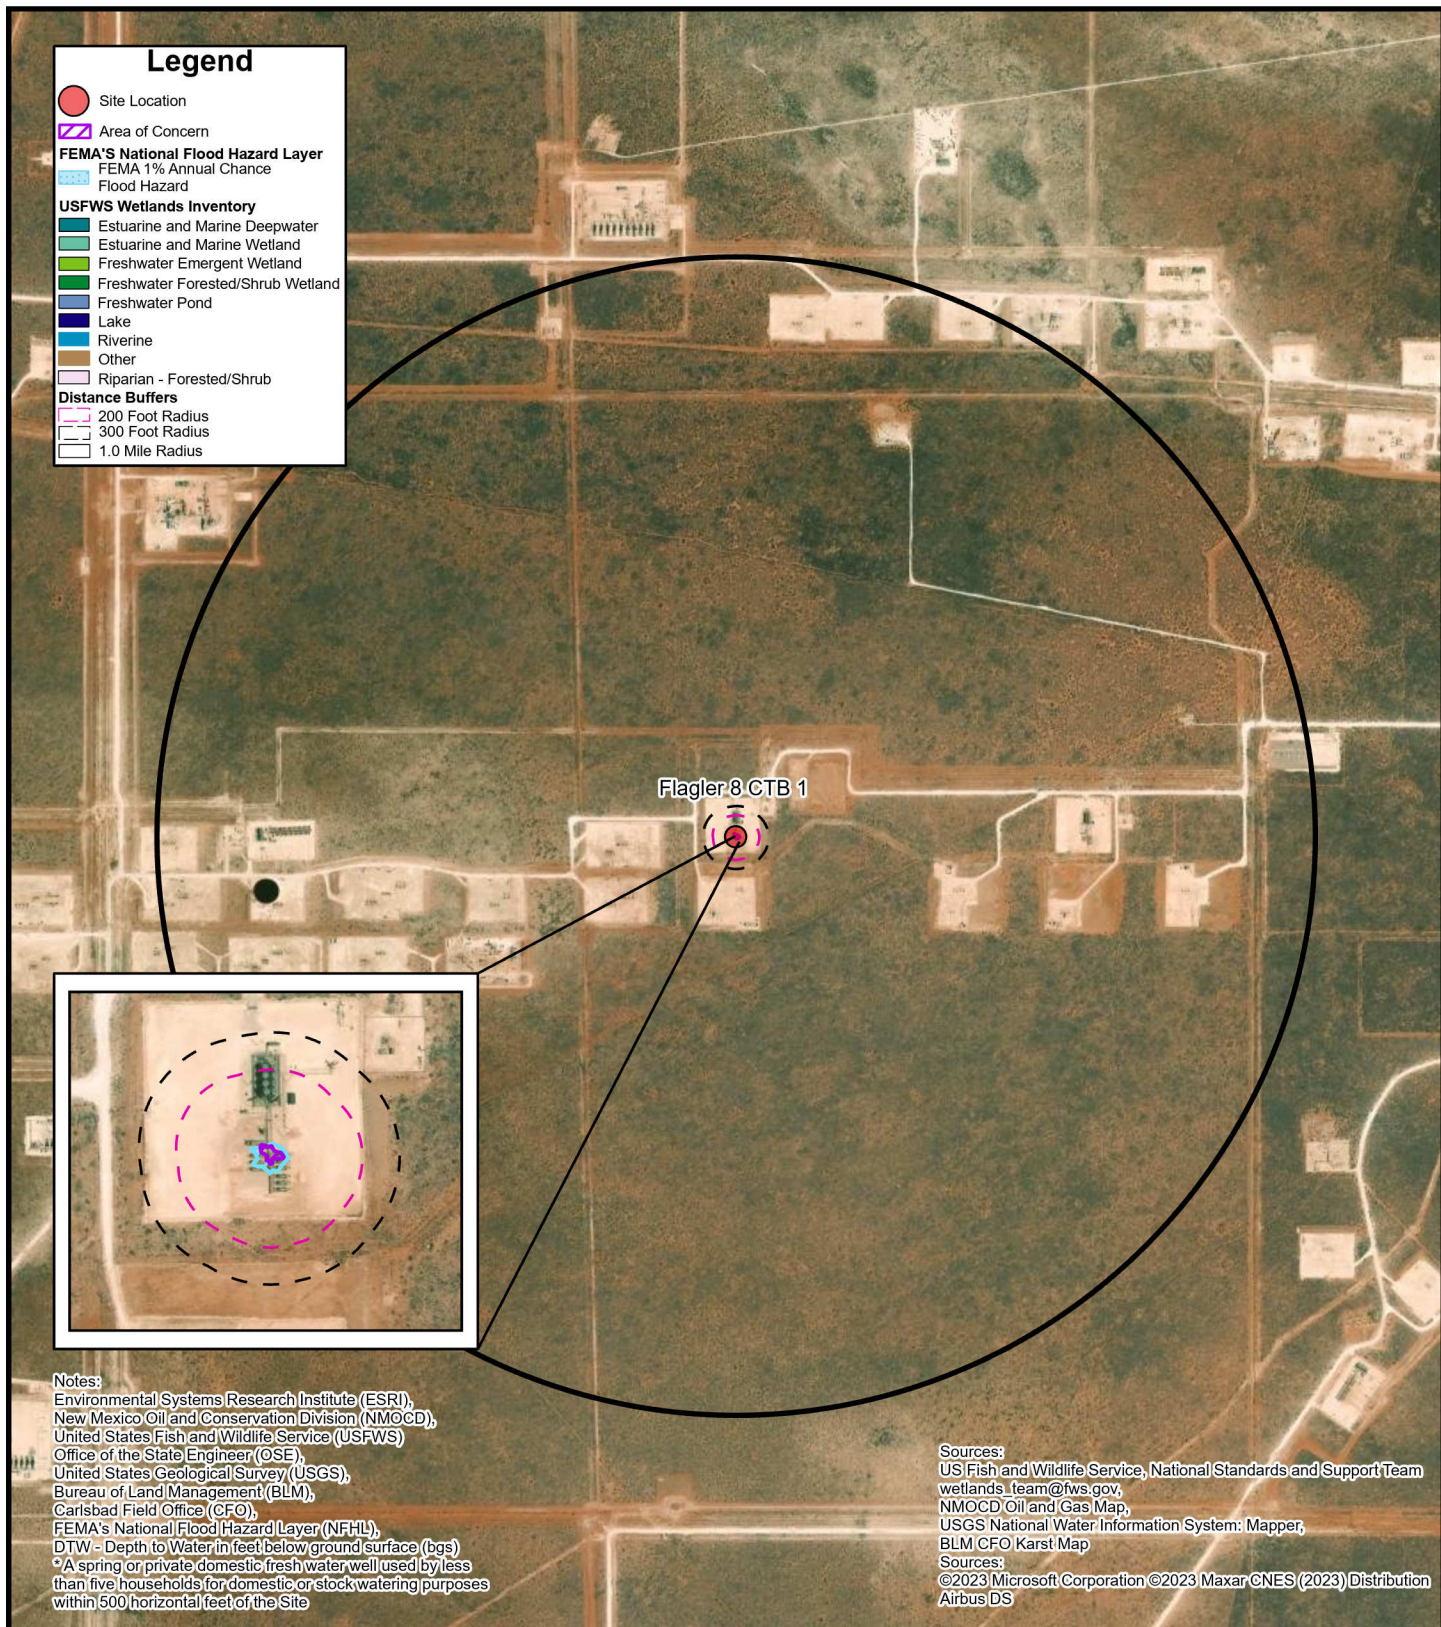
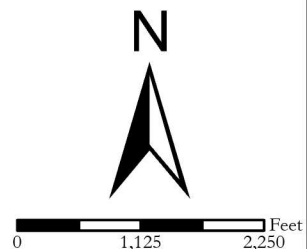


FIGURE 1B
Site Characterization Map
Surficial Receptors

Devon Energy Production Company, LP
 Flagler 8 CTB 1
 Unit M Sec 8 T25S R33E
 Lea County, New Mexico



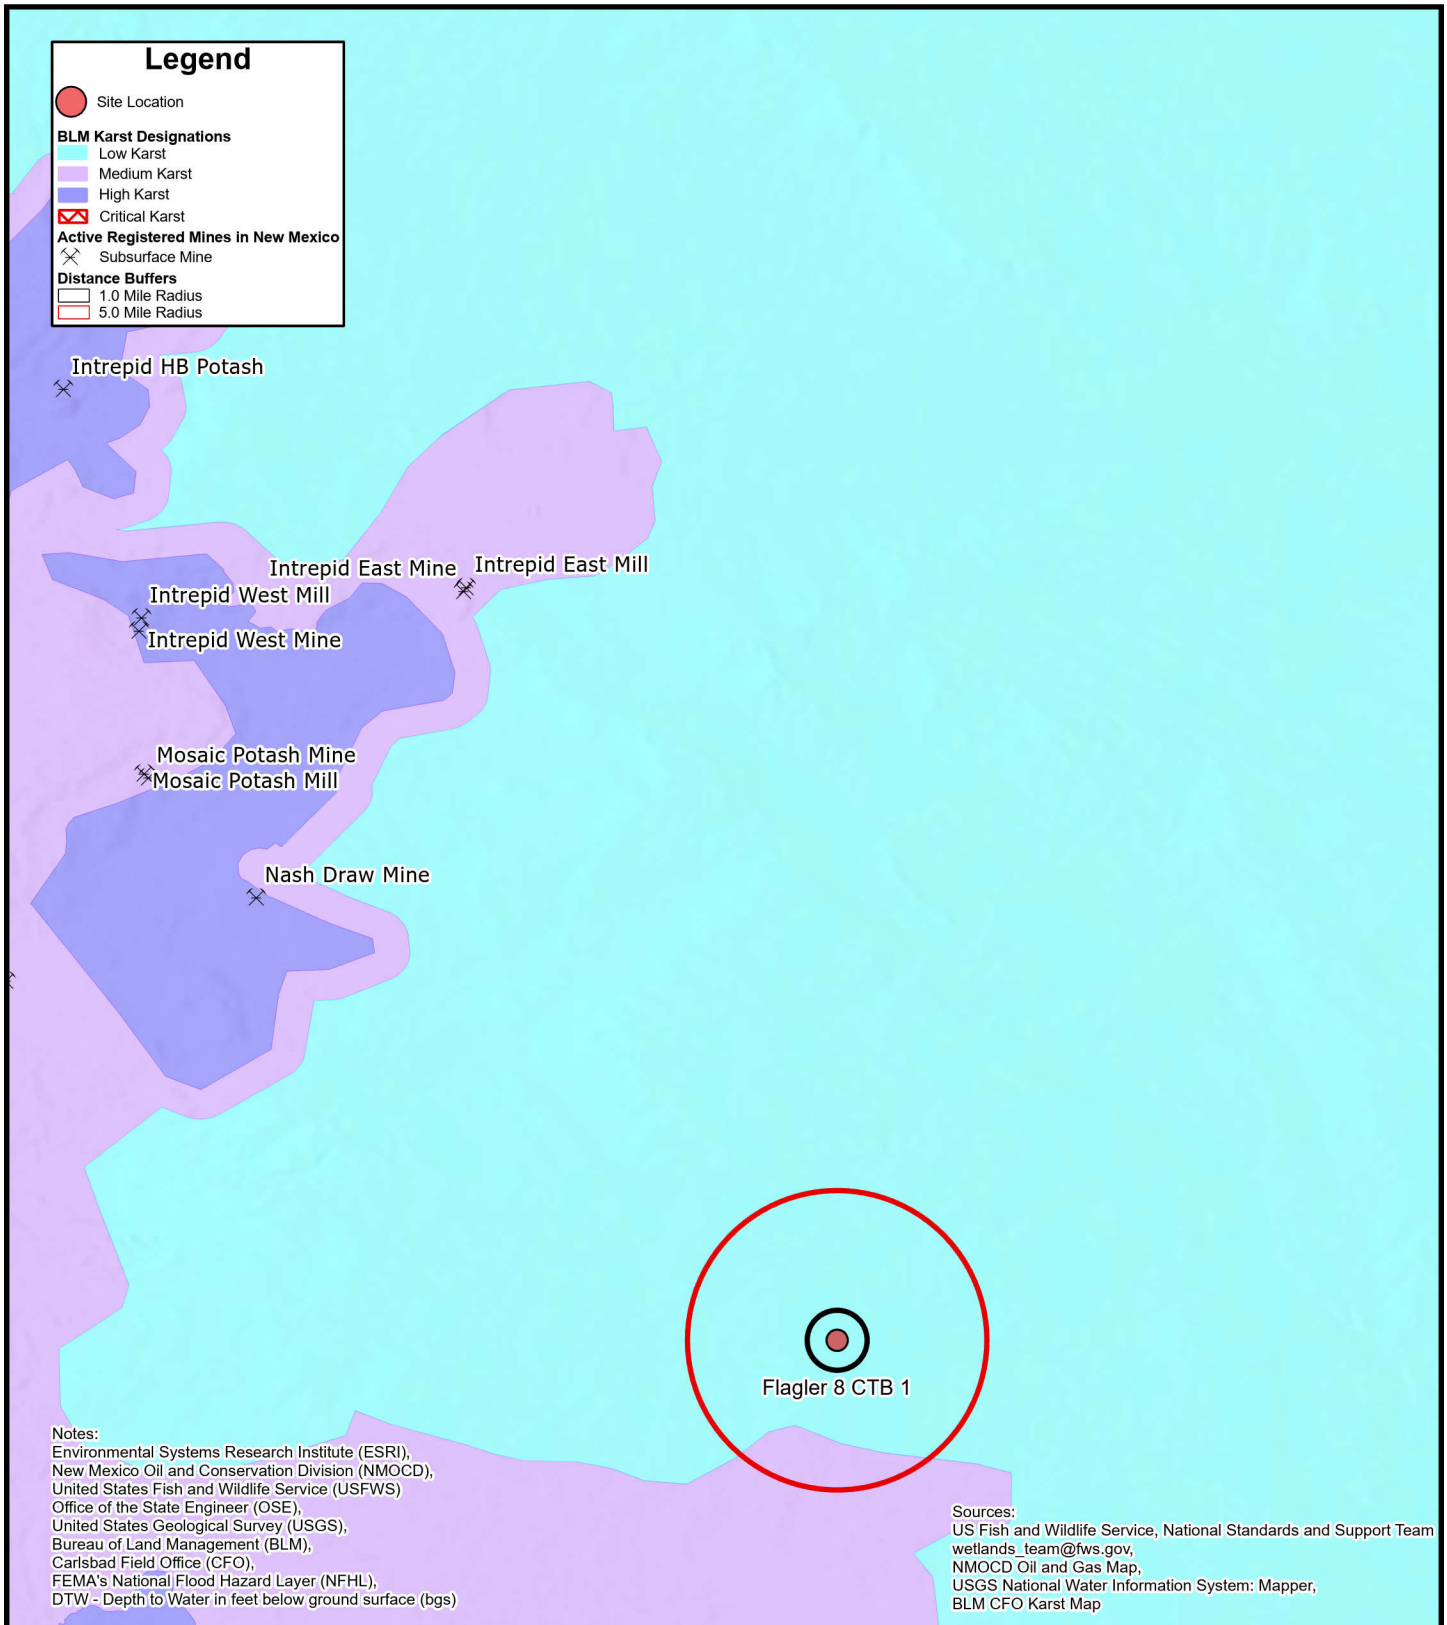



FIGURE 1C
Site Characterization Map
Subsurface Receptors

Devon Energy Production Company, LP
 Flagler 8 CTB 1
 Unit M Sec 8 T25S R33E
 Lea County, New Mexico



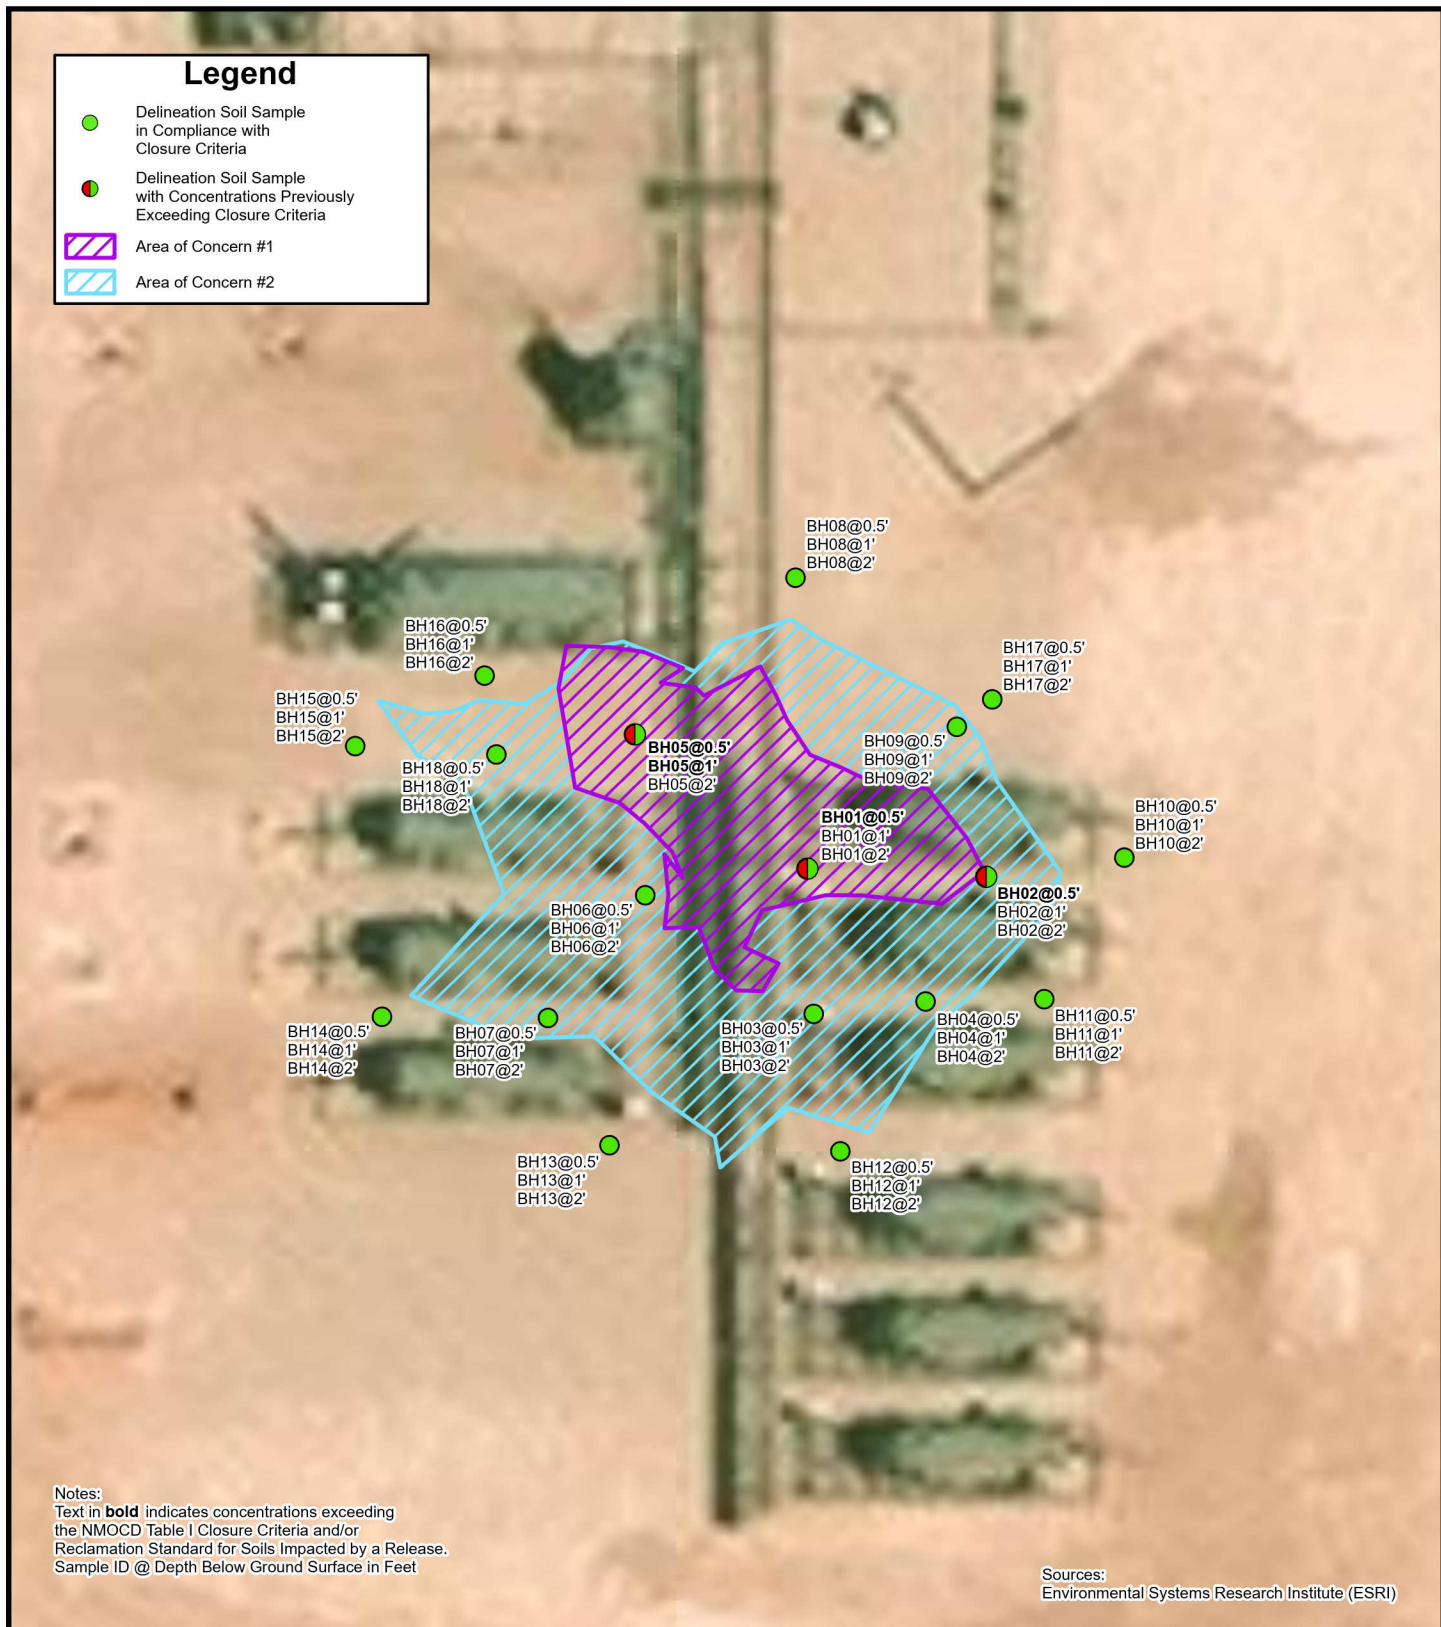
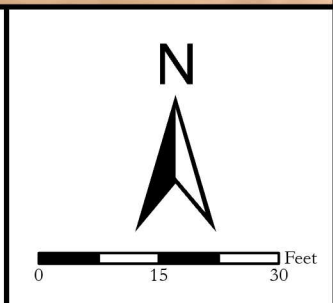


FIGURE 2
Delineation Soil Sample Locations
 Devon Energy Production Company, LP
 Flagler 8 CTB 1
 Unit M Sec 8 T25S R33E
 Lea County, New Mexico



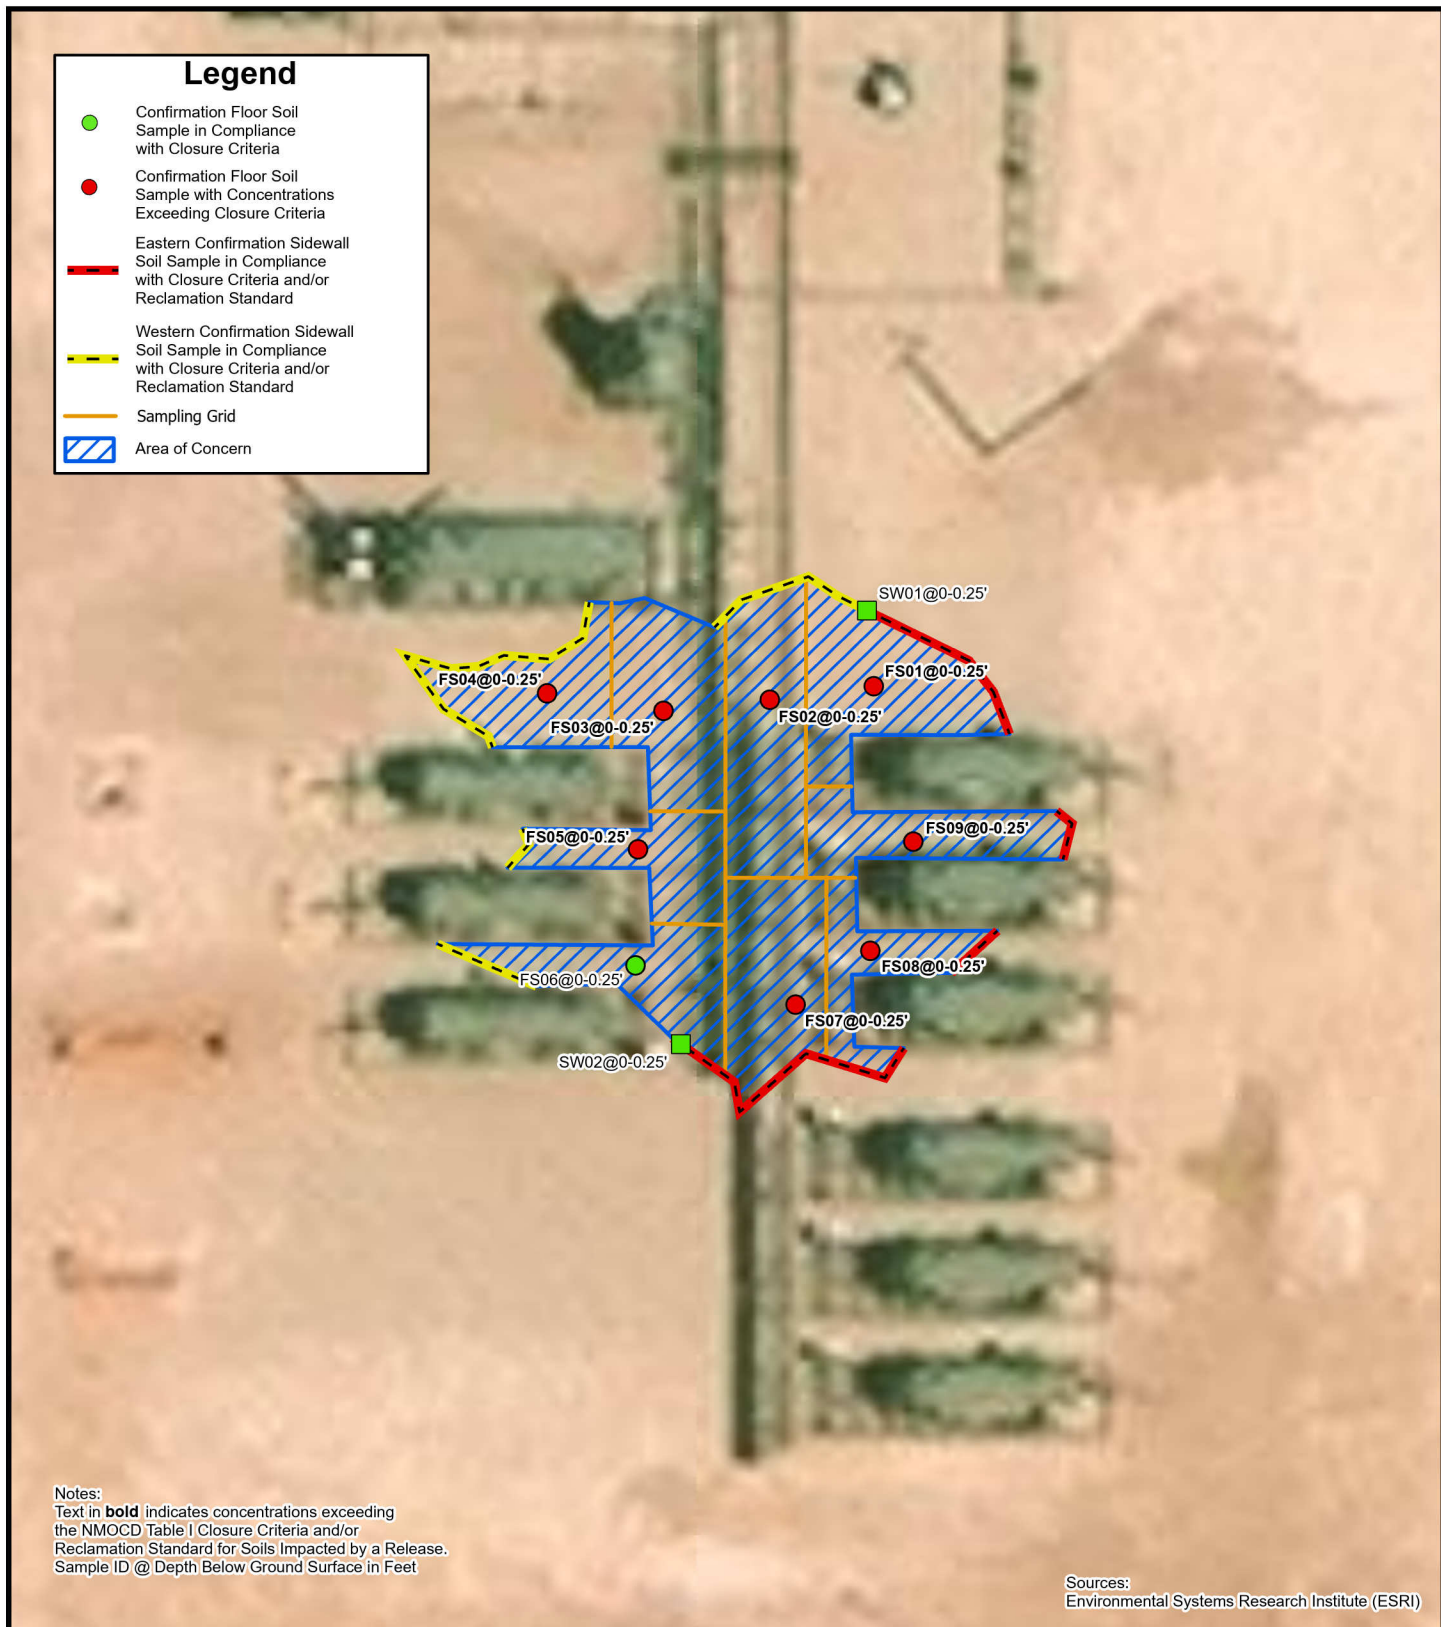
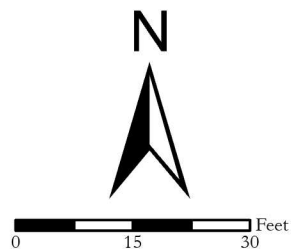


FIGURE 3
Confirmation Soil Sample Locations

Devon Energy Production Company, LP
 Flagler 8 CTB 1
 Unit M Sec 8 T25S R33E
 Lea County, New Mexico




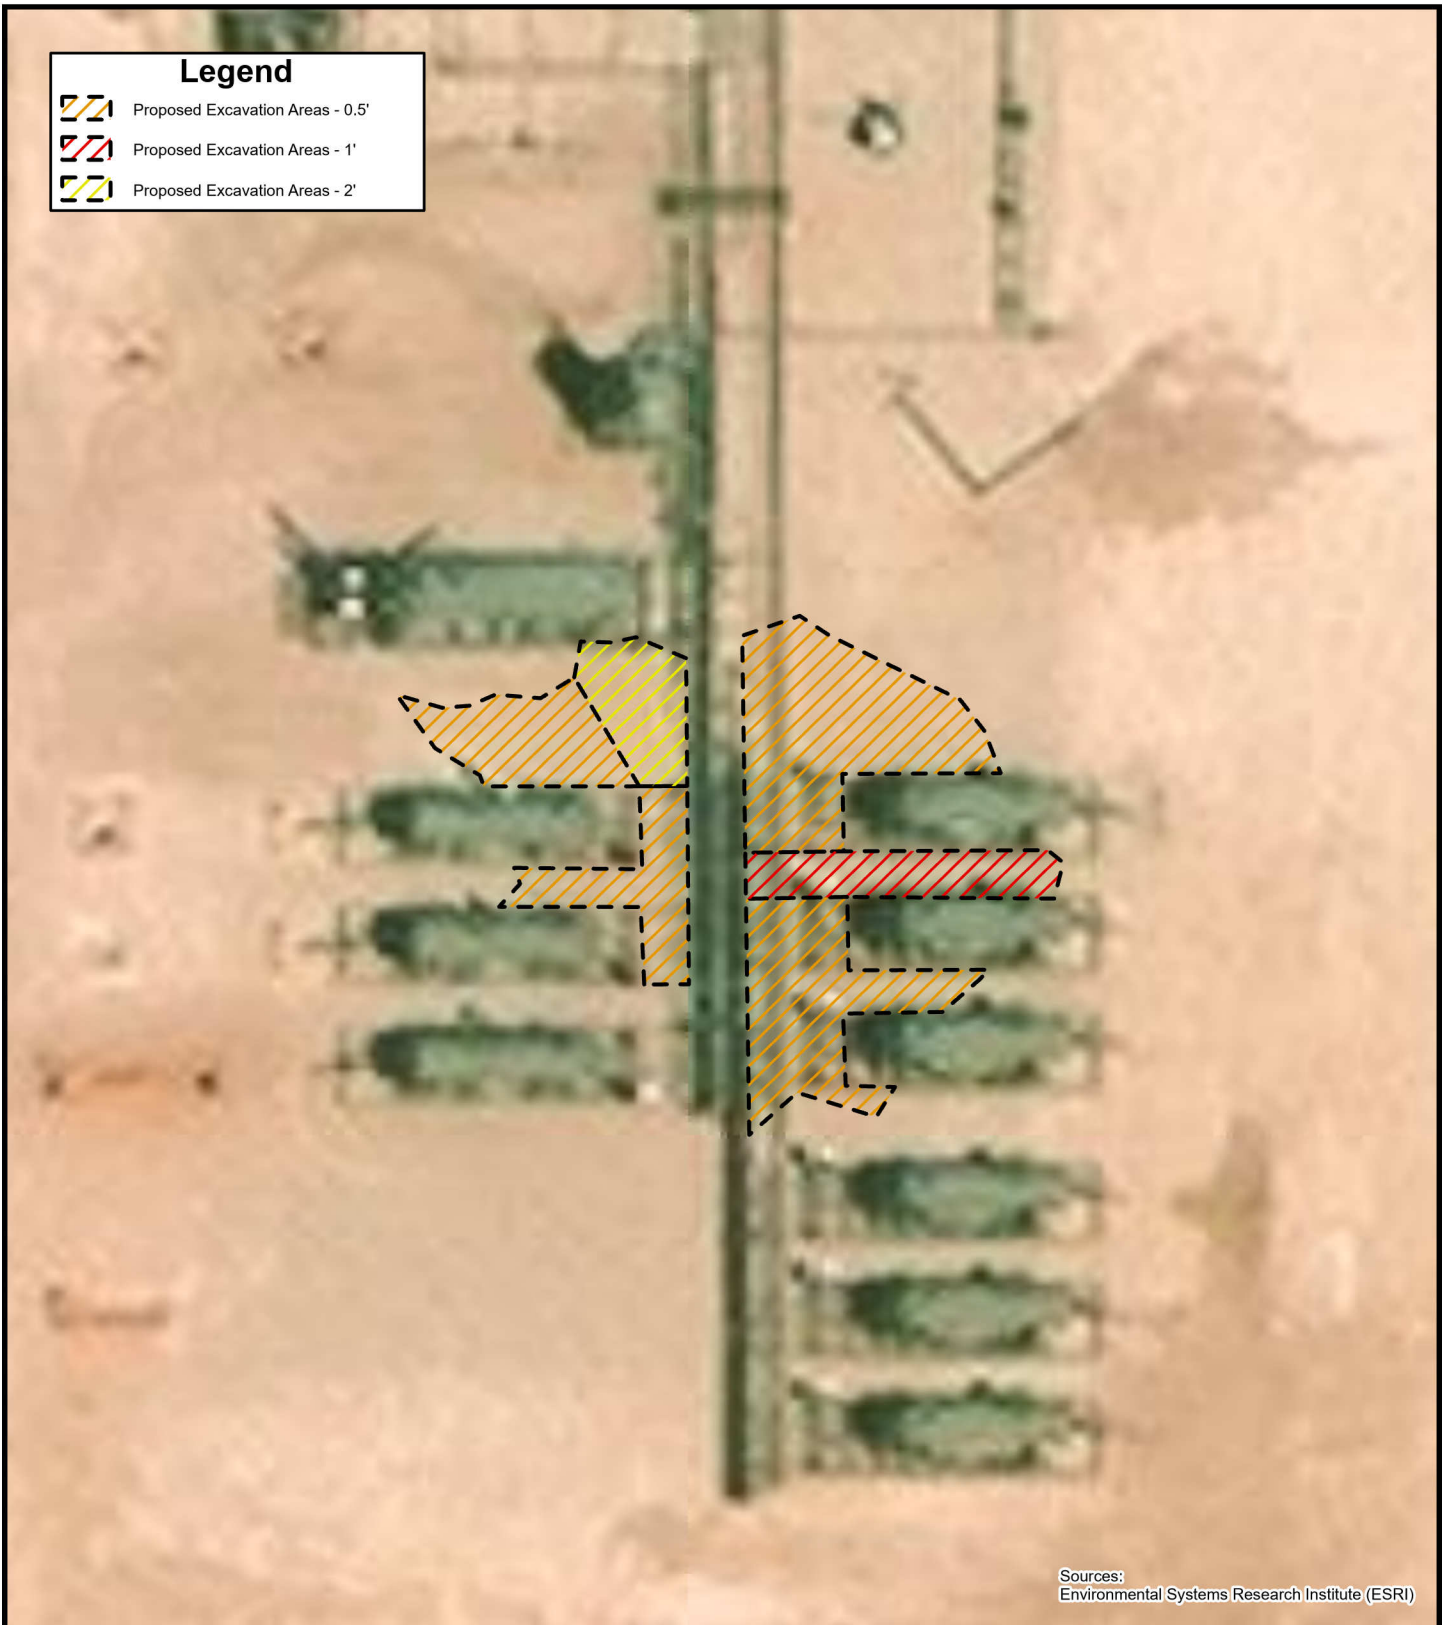


FIGURE 4

Proposed Excavation Areas

Devon Energy Production Company, LP
Flagler 8 CTB 1
Unit M Sec 8 T25S R33E
Lea County, New Mexico



APPENDIX B

Referenced Well Records



WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER

www.ose.state.nm.us

1. GENERAL AND WELL LOCATION	OSE POD NO. (WELL NO.) POD 1 (TW-1)		WELL TAG ID NO. N/A		OSE FILE NO(S). C-4627			
	WELL OWNER NAME(S) Devon Energy				PHONE (OPTIONAL) 575-748-1838			
	WELL OWNER MAILING ADDRESS 6488 7 Rivers Hwy				CITY Artesia	STATE ZIP NM 88210		
	WELL LOCATION (FROM GPS)	DEGREES LATITUDE	MINUTES 8	SECONDS 20.92	N	* ACCURACY REQUIRED: ONE TENTH OF A SECOND * DATUM REQUIRED: WGS 84		
	LONGITUDE	103	35	36.25	W			
DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS - PLSS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE SW SW SE Sec.8 T25S R33S NMPM								
2. DRILLING & CASING INFORMATION	LICENSE NO. 1249		NAME OF LICENSED DRILLER Jackie D. Atkins			NAME OF WELL DRILLING COMPANY Atkins Engineering Associates, Inc.		
	DRILLING STARTED 6/7/2022		DRILLING ENDED 6/7/2022		DEPTH OF COMPLETED WELL (FT) Temporary Well		BORE HOLE DEPTH (FT) ±55	
	DEPTH WATER FIRST ENCOUNTERED (FT) N/A				DATE STATIC MEASURED 6/13/2022			
	COMPLETED WELL IS: <input type="checkbox"/> ARTESIAN <input checked="" type="checkbox"/> DRY HOLE <input type="checkbox"/> SHALLOW (UNCONFINED)				STATIC WATER LEVEL IN COMPLETED WELL (FT) N/A			
	DRILLING FLUID: <input type="checkbox"/> AIR <input type="checkbox"/> MUD ADDITIVES - SPECIFY:						DATE STATIC MEASURED	
	DRILLING METHOD: <input type="checkbox"/> ROTARY <input type="checkbox"/> HAMMER <input type="checkbox"/> CABLE TOOL <input checked="" type="checkbox"/> OTHER - SPECIFY: Hollow Stem Auger					CHECK HERE IF PITLESS ADAPTER IS INSTALLED <input type="checkbox"/>		
	DEPTH (feet bgl)		BORE HOLE DIAM (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE (add coupling diameter)	CASING INSIDE DIAM. (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	FROM	TO						
	0	55	±6.5	Boring-HSA	--	--	--	--
3. ANNULAR MATERIAL	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL	AMOUNT (cubic feet)	METHOD OF PLACEMENT		
	FROM	TO						

USE DIT JUN 16 2022 PM 3:10

FOR OSE INTERNAL USE		WR-20 WELL RECORD & LOG (Version 01/28/2022)			
FILE NO. <u>C-4627-POD 1</u>	POD NO. <u>1</u>	TRN NO. <u>726174</u>			
LOCATION <u>25.33.08.334</u>	WELL TAG ID NO. <u> </u>	PAGE 1 OF 2			

4. HYDROGEOLOGIC LOG OF WELL	DEPTH (feet bgl)		THICKNESS (feet)	COLOR AND TYPE OF MATERIAL ENCOUNTERED - INCLUDE WATER-BEARING CAVITIES OR FRACTURE ZONES (attach supplemental sheets to fully describe all units)	WATER BEARING? (YES / NO)		ESTIMATED YIELD FOR WATER-BEARING ZONES (gpm)
	FROM	TO			Y	N	
	0	7	7	Sand, Fine-grained, poorly graded, 2.5 YR 3/6, Dark Red	Y	✓ N	
	7	24	17	Caliche, with Fine-grained sand, 7.5 YR 7/4, Pink	Y	✓ N	
	24	55	31	Caliche, with Fine-grained sand, well consolidated, 7.5 YR 7/4, Pink	Y	✓ N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
					Y	N	
METHOD USED TO ESTIMATE YIELD OF WATER-BEARING STRATA: <input type="checkbox"/> PUMP <input type="checkbox"/> AIR LIFT <input type="checkbox"/> BAILER <input type="checkbox"/> OTHER - SPECIFY:					TOTAL ESTIMATED WELL YIELD (gpm): 0.00		

5. TEST; RIG SUPERVISION	WELL TEST	TEST RESULTS - ATTACH A COPY OF DATA COLLECTED DURING WELL TESTING, INCLUDING DISCHARGE METHOD, START TIME, END TIME, AND A TABLE SHOWING DISCHARGE AND DRAWDOWN OVER THE TESTING PERIOD.
		MISCELLANEOUS INFORMATION: Temporary well material removed and soil boring backfilled using drill cuttings from total depth to ten feet below ground surface(bgs), then hydrated bentonite chips ten feet bgs to surface. 26 Flagler 8 Fed 20 OSE DTI JUN 16 2022 PM3:10
		PRINT NAME(S) OF DRILL RIG SUPERVISOR(S) THAT PROVIDED ONSITE SUPERVISION OF WELL CONSTRUCTION OTHER THAN LICENSEE: Shane Eldridge, Cameron Pruitt

6. SIGNATURE	THE UNDERSIGNED HEREBY CERTIFIES THAT, TO THE BEST OF HIS OR HER KNOWLEDGE AND BELIEF, THE FOREGOING IS A TRUE AND CORRECT RECORD OF THE ABOVE DESCRIBED HOLE AND THAT HE OR SHE WILL FILE THIS WELL RECORD WITH THE STATE ENGINEER AND THE PERMIT HOLDER WITHIN 30 DAYS AFTER COMPLETION OF WELL DRILLING:	
	<i>Jackie D. Atkins</i> SIGNATURE OF DRILLER / PRINT SIGNEE NAME	Jackie D. Atkins DATE 6/16/2022

FOR OSE INTERNAL USE		WR-20 WELL RECORD & LOG (Version 01/28/2022)	
FILE NO. <i>C-4627-POD 1</i>	POD NO. <i>1</i>	TRN NO. <i>726174</i>	
LOCATION <i>25.33.08.334</i>	WELL TAG ID NO. <i>---</i>	PAGE 2 OF 2	

Mike A. Hamman, P.E.
State Engineer



Roswell Office
1900 WEST SECOND STREET
ROSWELL, NM 88201

**STATE OF NEW MEXICO
OFFICE OF THE STATE ENGINEER**

Trn Nbr: 726174
File Nbr: C 04627
Well File Nbr: C 04627 POD1

Jun. 18, 2022

DALE WOODALL
DEVON ENERGY
6488 7 RIVERS HWY
ARTESIA, NM 88210

Greetings:

The above numbered permit was issued in your name on 05/24/2022.

The Well Record was received in this office on 06/18/2022, stating that it had been completed on 06/07/2022, and was a dry well. The well is to be plugged according to 19.27.4.30 NMAC.

Please note that another well can be drilled under this permit if the well is completed and the well log filed on or before 05/24/2023.

If you have any questions, please feel free to contact us.

Sincerely,

A handwritten signature in blue ink, appearing to read "Maret Amaral".

Maret Amaral
(575) 622-6521

drywell



2904 W 2nd St.
Roswell, NM 88201
voice: 575.624.2420
fax: 575.624.2421
www.atkinseng.com

June 8, 2022

DII-NMOSE
1900 W 2nd Street
Roswell, NM 88201

Hand Delivered to the DII Office of the State Engineer

Re: Well Record C-4627 Pod1 at Flagler 8 Fed 20

To whom it may concern:

Attached please find a well log & record and a plugging record, in duplicate, for a one (1) soil borings, C-4627 Pod1.

If you have any questions, please contact me at 575.499.9244 or lucas@atkinseng.com.

Sincerely,

A handwritten signature in black ink that reads "Lucas Middleton". The signature is written in a cursive style.

Lucas Middleton

Enclosures: as noted above

OSE DII JUN 16 2022 PM3:10

APPENDIX C

Soil Sampling Logs



Sample Name: BH01	Date: 09/25/2025
Site Name: Flagler 8 CTB 1	
Incident Number: nAPP2521623297 & nAPP2524723254	
Job Number: 22781, 22931	

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB	Method: Hand Auger
Delineation Soil Sample Coordinates: 32.1402503, -103.6010214	Hole Diameter: 3.75 inches
	Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	11,424	0.0	Yes	BH01	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, some staining, no odor. @1' no staining.
Dry	7,484	0.0	No	BH01	1	1		
Dry	116	0.0	No	BH01	2	2	SP-SM	(2') SAND, dry, brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH02	Date: 09/25/2025
Site Name: Flagler 8 CTB 1	
Incident Number: nAPP2521623297 & nAPP2524723254	
Job Number: 22781, 22931	

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB	Method: Hand Auger
Delineation Soil Sample Coordinates: 32.1402476, -103.6009492	Hole Diameter: 3.75 inches
	Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	10,292	0.6	Yes	BH02	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, some staining, no odor. @1' no staining.
Dry	6,740	0.0	No	BH02	1	1		
Dry	<116	0.2	No	BH02	2	2	SP-SM	(2') SAND, dry, brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH03 Date: 09/25/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1402004, -103.6010188 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	2,748	0.3	Yes	BH03	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, some staining, no odor. @1' no staining.
Dry	2,748	0.1	No	BH03	1	1		
Dry	116	0.2	No	BH03	2	2	SP-SM	(2') SAND, dry, brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH04 Date: 09/25/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1402047, -103.6009736 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	548	0.3	No	BH04	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	412	0.3	No	BH04	1	1		
Dry	<116	0.1	No	BH04	2	2	SP-SM	

Total Depth



Sample Name: BH05 Date: 09/25/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1402964, -103.6010911 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	7,440	0.1	Yes	BH05	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, some staining, no odor.
Dry	5,400	0.2	Yes	BH05	1	1		
Dry	140	0.1	No	BH05	2	2	SP-SM	(2') SAND, dry, brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH06 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1402411, -103.6010869 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	3,888	0.3	No	BH06	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	3,276	0.4	No	BH06	1	1		
Dry	501	0.2	No	BH06	2	2	SP-SM	

Total Depth



Sample Name: BH07 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1401990, -103.6011261 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	1,872	0.3	No	BH07	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	1,884	0.2	No	BH07	1	1		
Dry	460	0.3	No	BH07	2	2	SP-SM	(2') SAND, dry, brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH08 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1403503, -103.6010263 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	<116	0.1	No	BH08	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	<116	0.1	No	BH08	1	1		
Dry	<116	0.0	No	BH08	2	2		(2') CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH09 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1402991, -103.6009611 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	156	0.2	No	BH09	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	<116	0.0	No	BH09	1	1		
Dry	<116	0.1	No	BH09	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH10 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1402542, -103.6008934 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	156	0.0	No	BH10	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	<116	0.0	No	BH10	1	1		
Dry	<116	0.0	No	BH10	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH11 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1402055, -103.6009257 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	116	0.2	No	BH11	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	<116	0.2	No	BH11	1	1		
Dry	<116	0.1	No	BH11	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH12 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1401532, -103.6010080 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	184	0.0	No	BH12	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	116	0.0	No	BH12	1	1		
Dry	<116	0.1	No	BH12	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH13 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1401552, -103.6011013 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	<116	0.1	No	BH13	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	<116	0.0	No	BH13	1	1		
Dry	<116	0.0	No	BH13	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH14 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1401993, -103.6011932 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	<116	0.2	No	BH14	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	<116	0.1	No	BH14	1	1		
Dry	<116	0.0	No	BH14	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH15 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1402923, -103.6012041 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	184	0.0	No	BH15	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	<116	0.0	No	BH15	1	1		
Dry	<116	0.1	No	BH15	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH16 Date: 09/26/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: HB Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1403166, -103.6011518 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	<116	0.0	No	BH16	0.5	0.5	CCHE	(0-2') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	<116	0.0	No	BH16	1	1		
Dry	<116	0.0	No	BH16	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH17 Date: 12/15/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: SA Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1403166, -103.6011518
 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	204	0.4	No	BH17	0.5	0.5	CCHE	(0-1.5') PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	204	0.1	No	BH17	1	1		
Dry	<128	0.3	No	BH17	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth



Sample Name: BH18 Date: 12/15/2025
 Site Name: Flagler 8 CTB 1
 Incident Number: nAPP2521623297 & nAPP2524723254
 Job Number: 22781, 22931

LITHOLOGIC / SOIL SAMPLING LOG

Logged By: SA Method: Hand Auger
 Delineation Soil Sample Coordinates: 32.1403166, -103.6011518 Hole Diameter: 3.75 inches Total Depth: 2 feet

Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water.

Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (feet bgs)	Depth (feet bgs)	USCS/Rock Symbol	Lithologic Descriptions/Notes
Dry	344	0.5	No	BH18	0.5	0.5	CCHE	(0-1.5") PAD CALICHE, dry, tan, well graded with silt, fine to coarse grain, some gravel, low plasticity, low cohesiveness, no staining, no odor.
Dry	<128	0.5	No	BH18	1	1		
Dry	<128	0.5	No	BH18	2	2	SP-SM	(2') SAND, dry, reddish brown, poorly graded with trace clay, very fine to fine grain, low plasticity, low cohesiveness, no staining, no odor.

Total Depth

APPENDIX D

Photographic Log



PHOTOGRAPHIC LOG

Devon Energy Production Company, LP
Flagler 8 CTB 1

Incident Numbers: nAPP2521623297 and nAPP2524723254



Position: +032.140331 / -103.61087 (±15.3ft)
Altitude: 3472ft (±26.2ft)
Datum: WGS-84
Azimuth Bearing: 137° S43E 243mils True (±11°)
Elevation Angle: -23.8°
Horizon Angle: +00.7°
Zoom: 1.0X
Flagler 8



Position: +032.140271 / -103.60104 (±15.6ft)
Altitude: 3448ft (±26.2ft)
Datum: WGS-84
Azimuth Bearing: 092° S86E 167mils True (±12°)
Elevation Angle: -42.8°
Horizon Angle: +01.5°
Zoom: 0.5X
Flagler 8

Photograph 1 Date: 09/25/2025
Description: Southeastern view of delineation activities.

Photograph 2 Date: 09/25/2025
Description: Southeastern view of delineation activities.



Position: +032.140155 / -103.60193 (±15.9ft)
Altitude: 3472ft (±29.3ft)
Datum: WGS-84
Azimuth Bearing: 226° S29W 4782mils True (±11°)
Elevation Angle: -18.6°
Horizon Angle: +01.9°
Zoom: 1.0X
Flagler 8

Photograph 3 Date: 09/26/2025
Description: Southwestern view of delineation activities.



Position: +032.140155 / -103.60111 (±15.6ft)
Altitude: 3481ft (±13.2ft)
Datum: WGS-84
Azimuth Bearing: 151° S29E 2684mils True (±12°)
Elevation Angle: -55.9°
Horizon Angle: +01.4°
Zoom: 0.5X
Flagler 8

Photograph 4 Date: 09/26/2025
Description: Southeastern view of delineation activities.



PHOTOGRAPHIC LOG

Devon Energy Production Company, LP
Flagler 8 CTB 1

Incident Numbers: nAPP2521623297 and nAPP2524723254



Photograph 5 **Date: 12/15/2025**
Description: Southeastern view of delineation activities.



Photograph 6 **Date: 12/15/2025**
Description: Southwestern view of delineation activities.



Photograph 7 **Date: 12/15/2025**
Description: Northwestern view of confirmation activities.



Photograph 8 **Date: 12/15/2025**
Description: Northwestern view of confirmation activities.

APPENDIX E

Tables



Table 1
SOIL SAMPLE ANALYTICAL RESULTS
 Devon Energy Permian Co, LP
 Flagler 8 CTB 1
 Lea County, New Mexico

Sample I.D.	Sample Date	Sample Depth (feet bgs)	Benzene (mg/kg)	Total BTEX (mg/kg)	TPH GRO (mg/kg)	TPH DRO (mg/kg)	TPH ORO (mg/kg)	DRO+GRO (mg/kg)	Total TPH (mg/kg)	Chloride (mg/kg)
NMOCDC Table I Closure Criteria for Soils Impacted by a Release (NMAC 19.15.29)			10	50	NE	NE	NE	1,000	2,500	10,000
Delineation Soil Samples - Incident Number nAPP2521623297 & nAPP2524723254										
BH01	09/25/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	17,800
BH01	09/25/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	6,800
BH01	09/25/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	154
BH02	09/25/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	15,300
BH02	09/25/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	8,900
BH02	09/25/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	174
BH03	09/25/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	3,800
BH03	09/25/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	4,490
BH03	09/25/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	133
BH04	09/25/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	774
BH04	09/25/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	60.7
BH04	09/25/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	247
BH05	09/25/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	10,900
BH05	09/25/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	11,600
BH05	09/25/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	1,370
BH06	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	4,910
BH06	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	4,920
BH06	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	691
BH07	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	3,890
BH07	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	2,910
BH07	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	544
BH08	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	58.0
BH08	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	36.9
BH08	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	41.8
BH09	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	212
BH09	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	176
BH09	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	669
BH10	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	37.7
BH10	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	64.2
BH10	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	45.2



Table 1
SOIL SAMPLE ANALYTICAL RESULTS
Devon Energy Permian Co, LP
Flagler 8 CTB 1
Lea County, New Mexico

Sample I.D.	Sample Date	Sample Depth (feet bgs)	Benzene (mg/kg)	Total BTEX (mg/kg)	TPH GRO (mg/kg)	TPH DRO (mg/kg)	TPH ORO (mg/kg)	DRO+GRO (mg/kg)	Total TPH (mg/kg)	Chloride (mg/kg)
NMOCDC Table I Closure Criteria for Soils Impacted by a Release (NMAC 19.15.29)			10	50	NE	NE	NE	1,000	2,500	10,000
BH11	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	222
BH11	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	70.2
BH11	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	34.7
BH12	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	271
BH12	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	127
BH12	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	42.5
BH13	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	86.6
BH13	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	109
BH13	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	42.3
BH14	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	242
BH14	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	104
BH14	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	43.9
BH15	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	247
BH15	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	116
BH15	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	40.9
BH16	09/26/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	240
BH16	09/26/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	199
BH16	09/26/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	48.6
BH17	12/15/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	331
BH17	12/15/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	213
BH17	12/15/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	59.9
BH18	12/15/2025	0.5	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	473
BH18	12/15/2025	1	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	99.8
BH18	12/15/2025	2	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	59.7
Confirmation Soil Samples - Incident Number nAPP2521623297 & nAPP2524723254										
FS01	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	18,300
FS02	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	26,500
FS03	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	45,200
FS04	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	20,300
FS05	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	11,200
FS06	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	31.8	<50.0	31.8	31.8	3,850



**Table 1
SOIL SAMPLE ANALYTICAL RESULTS
Devon Energy Permian Co, LP
Flagler 8 CTB 1
Lea County, New Mexico**

Sample I.D.	Sample Date	Sample Depth (feet bgs)	Benzene (mg/kg)	Total BTEX (mg/kg)	TPH GRO (mg/kg)	TPH DRO (mg/kg)	TPH ORO (mg/kg)	DRO+GRO (mg/kg)	Total TPH (mg/kg)	Chloride (mg/kg)
NMOCD Table I Closure Criteria for Soils Impacted by a Release (NMAC 19.15.29)			10	50	NE	NE	NE	1,000	2,500	10,000
FS07	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	25.6	<50.0	25.6	25.6	39,700
FS08	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	81.6	64.5	146	146	16,600
FS09	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	18,300
SW01	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	244
SW02	12/15/2025	0-0.25	<0.0250	<0.0500	<20.0	<25.0	<50.0	<25.0	<50.0	145

Notes:
 bgs: below ground surface
 mg/kg: milligrams per kilogram
 BTEX: Benzene, Toluene, Ethylbenzene, and Xylenes
 GRO: Gasoline Range Organics
 DRO: Diesel Range Organics
 ORO: Oil Range Organics
 TPH: Total Petroleum Hydrocarbon
 NMOCD: New Mexico Oil Conservation Division
 NMAC: New Mexico Administrative Code
 Text in "grey" represents excavated soil samples
 Concentrations in **bold** exceed the NMOCD Table I Closure Criteria and/or Reclamation Standard¹ for Soils Impacted by a Release
 * * *Soil sample was collected in the top 4 feet of areas to be immediately reclaimed following remediation pursuant to NMAC 19.15.17.13, if exceeding the reclamation concentration requirements of 600 mg/kg chloride and 100 mg/kg TPH.

APPENDIX F

Laboratory Analytical Reports & Chain-of-Custody Documentation

Report to:
Erick Herrera



envirotech

Practical Solutions for a Better Tomorrow

Analytical Report

Devon Energy - Carlsbad

Project Name: FLAGLER 8 CTB 1

Work Order: E509340

Job Number: 01058-0007

Received: 10/1/2025

Revision: 1

Report Reviewed By:

Walter Hinchman
Laboratory Director
10/7/25

5796 U.S. Hwy 64
Farmington, NM 87401

Phone: (505) 632-1881
Envirotech-inc.com



Envirotech Inc. certifies the test results meet all requirements of TNI unless noted otherwise.
Statement of Data Authenticity: Envirotech Inc, attests the data reported has not been altered in any way.
Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech Inc.
Envirotech Inc, holds the Utah TNI certification NM00979 for data reported.
Envirotech Inc, holds the Texas TNI certification T104704557 for data reported.



Date Reported: 10/7/25

Erick Herrera
333 W Sheridan Avenue
Oklahoma City, OK 73102-5010

Project Name: FLAGLER 8 CTB 1
Workorder: E509340
Date Received: 10/1/2025 7:30:00AM

Erick Herrera,

Thank you for choosing Envirotech, Inc. as your analytical testing laboratory for the sample(s) received on, 10/1/2025 7:30:00AM, under the Project Name: FLAGLER 8 CTB 1.

The analytical test results summarized in this report with the Project Name: FLAGLER 8 CTB 1 apply to the individual samples collected, identified and submitted bearing the project name on the enclosed chain-of-custody. Subcontracted sample analyses not conducted by Envirotech, Inc., are attached in full as issued by the subcontract laboratory.

Please review the Chain-of-Custody (COC) and Sample Receipt Checklist (SRC) for any issues regarding sample receipt temperature, containers, preservation etc. To best understand your test results, review the entire report summarizing your sample data and the associated quality control batch data.

All reported data in this analytical report were analyzed according to the referenced method(s) and are in compliance with the latest NELAC/TNI standards, unless otherwise noted. Samples or analytical quality control parameters not meeting specific QC criteria are qualified with a data flag. Data flag definitions are located in the Notes and Definitions section of this analytical report.

If you have any questions concerning this report, please feel free to contact Envirotech, Inc.

Respectfully,

Walter Hinchman
Laboratory Director
Office: 505-632-1881
Cell: 775-287-1762
whinchman@envirotech-inc.com

Raina Schwanz
Laboratory Administrator
Office: 505-632-1881
rainaschwanz@envirotech-inc.com

Field Offices:

Southern New Mexico Area

Lynn Jarboe
Laboratory Technical Representative
Office: 505-421-LABS(5227)
Cell: 505-320-4759
ljjarboe@envirotech-inc.com

Michelle Gonzales
Client Representative
Office: 505-421-LABS(5227)
Cell: 505-947-8222
mgonzales@envirotech-inc.com

Envirotech Web Address: www.envirotech-inc.com

Table of Contents

Title Page	1
Cover Page	2
Table of Contents	3
Sample Summary	5
Sample Data	6
BH01 0.5'	6
BH01 1'	7
BH01 2'	8
BH02 0.5'	9
BH02 1'	10
BH02 2'	11
BH03 0.5'	12
BH03 1'	13
BH03 2'	14
BH04 0.5'	15
BH04 1'	16
BH04 2'	17
BH05 0.5'	18
BH05 1'	19
BH05 2'	20
QC Summary Data	21
QC - Volatile Organics by EPA 8021B	21
QC - Nonhalogenated Organics by EPA 8015D - GRO	22
QC - Nonhalogenated Organics by EPA 8015D - DRO/ORO	23
QC - Anions by EPA 300.0/9056A	24

Table of Contents (continued)

Definitions and Notes	25
Chain of Custody etc.	26

Sample Summary

Devon Energy - Carlsbad
333 W Sheridan Avenue
Oklahoma City OK, 73102-5010

Project Name: FLAGLER 8 CTB 1
Project Number: 01058-0007
Project Manager: Erick Herrera

Reported:
10/07/25 14:03

Client Sample ID	Lab Sample ID	Matrix	Sampled	Received	Container
BH01 0.5'	E509340-01A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH01 1'	E509340-02A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH01 2'	E509340-03A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH02 0.5'	E509340-04A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH02 1'	E509340-05A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH02 2'	E509340-06A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH03 0.5'	E509340-07A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH03 1'	E509340-08A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH03 2'	E509340-09A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH04 0.5'	E509340-10A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH04 1'	E509340-11A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH04 2'	E509340-12A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH05 0.5'	E509340-13A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH05 1'	E509340-14A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.
BH05 2'	E509340-15A	Soil	09/25/25	10/01/25	Glass Jar, 2 oz.



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH01 0.5'
E509340-01

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		112 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		118 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		98.2 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	17800	400	20	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH01 1'
E509340-02

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		116 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		118 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		101 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	6800	200	10	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH01 2'
E509340-03

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		112 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		124 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		98.9 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	154	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH02 0.5'

E509340-04

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		115 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		119 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		102 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	15300	200	10	10/01/25	10/01/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH02 1'
E509340-05

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		119 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		116 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		99.3 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	8900	200	10	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH02 2'
E509340-06

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		118 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		119 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		97.2 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	174	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH03 0.5'

E509340-07

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		118 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		114 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>						
		99.3 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	3800	100	5	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH03 1'
E509340-08

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		114 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		119 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		100 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	4490	100	5	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH03 2'

E509340-09

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		119 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		119 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		97.9 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	133	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH04 0.5'

E509340-10

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		121 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		116 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		105 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	774	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH04 1'
E509340-11

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		115 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		120 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		102 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	60.7	20.0	1	10/01/25	10/02/25	

Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH04 2'
E509340-12

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		117 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		119 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		101 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	247	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH05 0.5'

E509340-13

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		114 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		119 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		99.0 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	10900	200	10	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH05 1'
E509340-14

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		117 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		120 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		97.1 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	11600	200	10	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

BH05 2'
E509340-15

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		116 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540066
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		122 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540069
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		97.5 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540080
Chloride	1370	20.0	1	10/01/25	10/02/25	



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	----------------------------------

Volatile Organics by EPA 8021B

Analyst: SL

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540066-BLK1)

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	ND	0.0250							
Ethylbenzene	ND	0.0250							
Toluene	ND	0.0250							
o-Xylene	ND	0.0250							
p,m-Xylene	ND	0.0500							
Total Xylenes	ND	0.0250							
Surrogate: 4-Bromochlorobenzene-PID	9.31		8.00		116	70-130			

LCS (2540066-BS1)

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	4.33	0.0250	5.00		86.6	70-130			
Ethylbenzene	4.29	0.0250	5.00		85.8	70-130			
Toluene	4.32	0.0250	5.00		86.4	70-130			
o-Xylene	4.29	0.0250	5.00		85.7	70-130			
p,m-Xylene	8.70	0.0500	10.0		87.0	70-130			
Total Xylenes	13.0	0.0250	15.0		86.5	70-130			
Surrogate: 4-Bromochlorobenzene-PID	9.12		8.00		114	70-130			

Matrix Spike (2540066-MS1)

Source: E509340-04

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	4.31	0.0250	5.00	ND	86.3	70-130			
Ethylbenzene	4.27	0.0250	5.00	ND	85.4	70-130			
Toluene	4.31	0.0250	5.00	ND	86.2	70-130			
o-Xylene	4.27	0.0250	5.00	ND	85.4	70-130			
p,m-Xylene	8.66	0.0500	10.0	ND	86.6	70-130			
Total Xylenes	12.9	0.0250	15.0	ND	86.2	70-130			
Surrogate: 4-Bromochlorobenzene-PID	9.13		8.00		114	70-130			

Matrix Spike Dup (2540066-MSD1)

Source: E509340-04

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	4.69	0.0250	5.00	ND	93.9	70-130	8.40	27	
Ethylbenzene	4.65	0.0250	5.00	ND	93.0	70-130	8.49	26	
Toluene	4.68	0.0250	5.00	ND	93.6	70-130	8.27	20	
o-Xylene	4.62	0.0250	5.00	ND	92.5	70-130	7.95	25	
p,m-Xylene	9.42	0.0500	10.0	ND	94.2	70-130	8.39	23	
Total Xylenes	14.0	0.0250	15.0	ND	93.6	70-130	8.25	26	
Surrogate: 4-Bromochlorobenzene-PID	8.99		8.00		112	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

Nonhalogenated Organics by EPA 8015D - GRO

Analyst: SL

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540066-BLK1)

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	ND	20.0							
Surrogate: 1-Chloro-4-fluorobenzene-FID	9.88		8.00		123	70-130			

LCS (2540066-BS2)

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	52.6	20.0	50.0		105	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	9.93		8.00		124	70-130			

Matrix Spike (2540066-MS2)

Source: E509340-04

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	52.4	20.0	50.0	ND	105	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	10.1		8.00		127	70-130			

Matrix Spike Dup (2540066-MSD2)

Source: E509340-04

Prepared: 10/01/25 Analyzed: 10/03/25

Gasoline Range Organics (C6-C10)	50.6	20.0	50.0	ND	101	70-130	3.57	20	
Surrogate: 1-Chloro-4-fluorobenzene-FID	8.69		8.00		109	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

Nonhalogenated Organics by EPA 8015D - DRO/ORO

Analyst: KH

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540069-BLK1)

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	ND	25.0							
Oil Range Organics (C28-C36)	ND	50.0							
Surrogate: <i>n</i> -Nonane	48.4		50.0		96.8	61-141			

LCS (2540069-BS1)

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	250	25.0	250		100	66-144			
Surrogate: <i>n</i> -Nonane	49.7		50.0		99.4	61-141			

Matrix Spike (2540069-MS1)

Source: E509340-12

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	247	25.0	250	ND	98.7	56-156			
Surrogate: <i>n</i> -Nonane	49.4		50.0		98.9	61-141			

Matrix Spike Dup (2540069-MSD1)

Source: E509340-12

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	243	25.0	250	ND	97.3	56-156	1.49	20	
Surrogate: <i>n</i> -Nonane	48.4		50.0		96.7	61-141			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 2:03:14PM
--	---	---

Anions by EPA 300.0/9056A

Analyst: DT

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540080-BLK1)

Prepared: 10/01/25 Analyzed: 10/01/25

Chloride	ND	20.0							
----------	----	------	--	--	--	--	--	--	--

LCS (2540080-BS1)

Prepared: 10/01/25 Analyzed: 10/01/25

Chloride	253	20.0	250		101	90-110			
----------	-----	------	-----	--	-----	--------	--	--	--

Matrix Spike (2540080-MS1)

Source: E509340-04

Prepared: 10/01/25 Analyzed: 10/02/25

Chloride	19100	200	250	15300	NR	80-120			M4
----------	-------	-----	-----	-------	----	--------	--	--	----

Matrix Spike Dup (2540080-MSD1)

Source: E509340-04

Prepared: 10/01/25 Analyzed: 10/02/25

Chloride	18400	200	250	15300	NR	80-120	3.94	20	M4
----------	-------	-----	-----	-------	----	--------	------	----	----

QC Summary Report Comment:

Calculations are based off of the raw (non-rounded) data. However, for reporting purposes all QC data is rounded to three significant figures. Therefore, hand calculated values may differ slightly.



Definitions and Notes

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/07/25 14:03
--	---	------------------------------------

M4 Matrix spike recovery value is suspect since the analyte concentration in the sample is disproportionate to the spike level. The associated LCS spike recovery was acceptable.

ND Analyte NOT DETECTED at or above the reporting limit

NR Not Reported

RPD Relative Percent Difference

DNI Did Not Ignite

DNR Did not react with the addition of acid or base.

Note (1): Methods marked with ** are non-accredited methods.

Note (2): Soil data is reported on an "as received" weight basis, unless reported otherwise.



Released to Imaging: 3/12/2026 3:07:21 PM

Page 26 of 28

Received by OCD: 1/28/2026 2:39:03 PM

Client Information				Invoice Information				Lab Use Only				TAT				State			
Client: Devon Energy Production Company, LP				Company: Devon Energy Production Company, LP				Lab WO#		Job Number		1D	2D	3D	Std	NM	CO	UT	TX
Project: Flagler 8 CTB 1				Address: 5315 Buena Vista Dr.				E509340		01058-0007					x	x			
Project Manager: Erick Herrera				City, State, Zip: Carlsbad, NM, 88220															
Address: 13000 W County Rd 100				Phone: 575-885-7502															
City, State, Zip: Odessa, TX, 79765				Email: jim.raley@dvn.com															
Phone: 432-305-6415				Miscellaneous: WO: 21663733 & 21686668; PN: 22781 & 22931 IN: nAPP2521623297 & nAPP2524723254															
Email: NMTXGeoGroup@etechenv.com																			

Sample Information							Analysis and Method								EPA Program				
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Depth	Lab Number	DRO/ORO by 8015	GRO/DRO by 8015	BTEX by 8021	VOC by 8260	Chloride 300.0	TCEQ 1005 - TX	RCRA 8 Metals	BGDOC - NM	BGDOC - TX	SDWA	CWA	RCRA	
																Compliance	Y	or	N
																PWSID #			
																Sample Temp			Remarks
10:40	9/25/2025	S	1	BH01	0.5'	1								X		3.2			
10:50	9/25/2025	S	1	BH01	1'	2								X		3.0			
11:00	9/25/2025	S	1	BH01	2'	3								X		2.6			
11:30	9/25/2025	S	1	BH02	0.5'	4								X		2.4			
11:40	9/25/2025	S	1	BH02	1'	5								X		2.8			
11:50	9/25/2025	S	1	BH02	2'	6								X		3.2			
12:20	9/25/2025	S	1	BH03	0.5'	7								X		3.2			
12:30	9/25/2025	S	1	BH03	1'	8								X		2.8			
12:40	9/25/2025	S	1	BH03	2'	9								X		2.6			
13:15	9/25/2025	S	1	BH04	0.5'	10								X		2.4			

Additional Instructions:

I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.

Sampled by: <u>Haleigh Blume</u>						Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: <input checked="" type="radio"/> Y <input type="radio"/> N					
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time						
<u>Jim Raley</u>	<u>09/29/2025</u>	<u>9:30</u>	<u>Michelle Gonzales</u>	<u>9.30.25</u>	<u>0930</u>						
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time						
<u>Michelle Gonzales</u>	<u>9.30.25</u>	<u>1500</u>	<u>Matthew Isomple</u>	<u>9.30.25</u>	<u>1500</u>						
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time						
<u>Matthew Isomple</u>	<u>9.30.25</u>	<u>1940</u>	<u>Andrew Musso</u>	<u>9.30.25</u>	<u>1940</u>						
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time						
<u>Andrew Musso</u>	<u>10-1-25</u>	<u>0115</u>	<u>Caitlynn</u>	<u>10-1-25</u>	<u>730</u>						

Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other _____ Container Type: g - glass, p - poly/plastic, ag - amber glass, v - VOA

Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.

Page 72 of 202

Client Information	Invoice Information	Lab Use Only	TAT	State
Client: Devon Energy Production Company, LP Project: Flagler 8 CTB 1 Project Manager: Erick Herrera Address: 13000 W County Rd 100 City, State, Zip: Odessa, TX, 79765 Phone: 432-305-6415 Email: NMTXGeoGroup@etechnv.com	Company: Devon Energy Production Company, L Address: 5315 Buena Vista Dr. City, State, Zip: Carlsbad, NM, 88220 Phone: 575-885-7502 Email: jim.raley@dv.com Miscellaneous: WO: 21663733 & 21686668; PN: 22781 & 22931 IN: nAPP2521623297 & nAPP2524723254	Lab WO# E509340 Job Number 01058-0007	1D <input type="checkbox"/> 2D <input type="checkbox"/> 3D <input type="checkbox"/> Std <input checked="" type="checkbox"/>	NM <input checked="" type="checkbox"/> CO <input type="checkbox"/> UT <input type="checkbox"/> TX <input type="checkbox"/>

Sample Information							Analysis and Method								EPA Program				
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Depth	Lab Number	DRO/ORO by 8015	GRO/DRO by 8015	BTEX by 8021	VOC by 8260	Chloride 300.0	TCEQ.1005 - TX	RCRA 8 Metals	BGDOC - NM	BGDOC - TX	SDWA	CWA	RCRA	
13:30	9/25/2025	S	1	BH04	1'	11								X					
13:45	9/25/2025	S	1	BH04	2'	12								X					
14:15	9/25/2025	S	1	BH05	0.5'	13								X					
14:30	9/25/2025	S	1	BH05	1'	14								X					
14:45	9/25/2025	S	1	BH05	2'	15								X					

Additional Instructions:

I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.
 Sampled by: Haleigh Blume

Relinquished by: (Signature) <i>Haleigh Blume</i> Date: <i>9/29/2025</i> Time: <i>930</i>	Received by: (Signature) <i>Michelle Gonzales</i> Date: <i>9.30.25</i> Time: <i>0930</i>	Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: <input checked="" type="radio"/> Y <input type="radio"/> N
Relinquished by: (Signature) <i>Michelle Gonzales</i> Date: <i>9.30.25</i> Time: <i>1500</i>	Received by: (Signature) <i>Miriam Gonzalez</i> Date: <i>9.30.25</i> Time: <i>1500</i>	
Relinquished by: (Signature) <i>Miriam Gonzalez</i> Date: <i>9.30.25</i> Time: <i>1940</i>	Received by: (Signature) <i>Andrew Musso</i> Date: <i>9.30.25</i> Time: <i>1940</i>	
Relinquished by: (Signature) <i>Andrew Musso</i> Date: <i>10.1.25</i> Time: <i>0115</i>	Received by: (Signature) <i>Carla Han</i> Date: <i>10.1.25</i> Time: <i>130</i>	

Sample Matrix: **S** - Soil, **Sd** - Solid, **Sg** - Sludge, **A** - Aqueous, **O** - Other _____ Container Type: **g** - glass, **p** - poly/plastic, **ag** - amber glass, **v** - VOA
 Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.

Envirotech Analytical Laboratory

Printed: 10/1/2025 9:54:46AM

Sample Receipt Checklist (SRC)

Instructions: Please take note of any NO checkmarks.

If we receive no response concerning these items within 24 hours of the date of this notice, all the samples will be analyzed as requested.

Client:	Devon Energy - Carlsbad	Date Received:	10/01/25 07:30	Work Order ID:	E509340
Phone:	(575) 748-0176	Date Logged In:	09/30/25 16:04	Logged In By:	Caitlin Mars
Email:		Due Date:	10/07/25 17:00 (4 day TAT)		

Chain of Custody (COC)

- 1. Does the sample ID match the COC? Yes
- 2. Does the number of samples per sampling site location match the COC? Yes
- 3. Were samples dropped off by client or carrier? Yes
- 4. Was the COC complete, i.e., signatures, dates/times, requested analyses? Yes
- 5. Were all samples received within holding time? Yes

Carrier: Courier

Note: Analysis, such as pH which should be conducted in the field, i.e, 15 minute hold time, are not included in this discussion.

Comments/Resolution

Sample Turn Around Time (TAT)

- 6. Did the COC indicate standard TAT, or Expedited TAT? Yes

Sample Cooler

- 7. Was a sample cooler received? Yes
- 8. If yes, was cooler received in good condition? Yes
- 9. Was the sample(s) received intact, i.e., not broken? Yes
- 10. Were custody/security seals present? No
- 11. If yes, were custody/security seals intact? NA
- 12. Was the sample received on ice? Yes

Note: Thermal preservation is not required, if samples are received within 15 minutes of sampling

- 13. See COC for individual sample temps. Samples outside of 0°C-6°C will be recorded in comments.

Sample Container

- 14. Are aqueous VOC samples present? No
- 15. Are VOC samples collected in VOA Vials? NA
- 16. Is the head space less than 6-8 mm (pea sized or less)? NA
- 17. Was a trip blank (TB) included for VOC analyses? NA
- 18. Are non-VOC samples collected in the correct containers? Yes
- 19. Is the appropriate volume/weight or number of sample containers collected? Yes

Field Label

- 20. Were field sample labels filled out with the minimum information:
 - Sample ID? Yes
 - Date/Time Collected? Yes
 - Collectors name? Yes

Sample Preservation

- 21. Does the COC or field labels indicate the samples were preserved? No
- 22. Are sample(s) correctly preserved? NA
- 24. Is lab filtration required and/or requested for dissolved metals? No

Multiphase Sample Matrix

- 26. Does the sample have more than one phase, i.e., multiphase? No
- 27. If yes, does the COC specify which phase(s) is to be analyzed? NA

Subcontract Laboratory

- 28. Are samples required to get sent to a subcontract laboratory? No
- 29. Was a subcontract laboratory specified by the client and if so who? NA Subcontract Lab: NA

Client Instruction



Signature of client authorizing changes to the COC or sample disposition.

Date



envirotech Inc.

Report to:
Erick Herrera

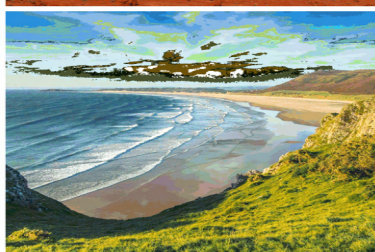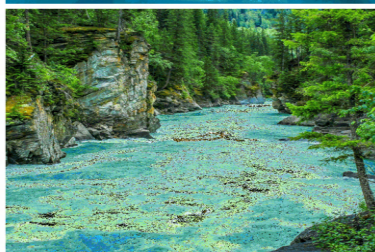

envirotech

Practical Solutions for a Better Tomorrow

Analytical Report

Devon Energy - Carlsbad

Project Name: FLAGLER 8 CTB 1

Work Order: E509339

Job Number: 01058-0007

Received: 10/1/2025

Revision: 1

Report Reviewed By:

Walter Hinchman
Laboratory Director
10/7/25

5796 U.S. Hwy 64
Farmington, NM 87401

Phone: (505) 632-1881
Envirotech-inc.com



Envirotech Inc. certifies the test results meet all requirements of TNI unless noted otherwise.
Statement of Data Authenticity: Envirotech Inc, attests the data reported has not been altered in any way.
Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech Inc.
Envirotech Inc, holds the Utah TNI certification NM00979 for data reported.
Envirotech Inc, holds the Texas TNI certification T104704557 for data reported.



Date Reported: 10/7/25

Erick Herrera
333 W Sheridan Avenue
Oklahoma City, OK 73102-5010

Project Name: FLAGLER 8 CTB 1
Workorder: E509339
Date Received: 10/1/2025 7:30:00AM

Erick Herrera,

Thank you for choosing Envirotech, Inc. as your analytical testing laboratory for the sample(s) received on, 10/1/2025 7:30:00AM, under the Project Name: FLAGLER 8 CTB 1.

The analytical test results summarized in this report with the Project Name: FLAGLER 8 CTB 1 apply to the individual samples collected, identified and submitted bearing the project name on the enclosed chain-of-custody. Subcontracted sample analyses not conducted by Envirotech, Inc., are attached in full as issued by the subcontract laboratory.

Please review the Chain-of-Custody (COC) and Sample Receipt Checklist (SRC) for any issues regarding sample receipt temperature, containers, preservation etc. To best understand your test results, review the entire report summarizing your sample data and the associated quality control batch data.

All reported data in this analytical report were analyzed according to the referenced method(s) and are in compliance with the latest NELAC/TNI standards, unless otherwise noted. Samples or analytical quality control parameters not meeting specific QC criteria are qualified with a data flag. Data flag definitions are located in the Notes and Definitions section of this analytical report.

If you have any questions concerning this report, please feel free to contact Envirotech, Inc.

Respectfully,

Walter Hinchman
Laboratory Director
Office: 505-632-1881
Cell: 775-287-1762
whinchman@envirotech-inc.com

Raina Schwanz
Laboratory Administrator
Office: 505-632-1881
rainaschwanz@envirotech-inc.com

Field Offices:

Southern New Mexico Area

Lynn Jarboe
Laboratory Technical Representative
Office: 505-421-LABS(5227)
Cell: 505-320-4759
ljjarboe@envirotech-inc.com

Michelle Gonzales
Client Representative
Office: 505-421-LABS(5227)
Cell: 505-947-8222
mgonzales@envirotech-inc.com

Envirotech Web Address: www.envirotech-inc.com

Table of Contents

Title Page	1
Cover Page	2
Table of Contents	3
Sample Summary	4
Sample Data	5
BH06 0.5'	5
BH06 1'	6
BH06 2'	7
BH07 0.5'	8
BH07 1'	9
BH07 2'	10
QC Summary Data	11
QC - Volatile Organics by EPA 8021B	11
QC - Nonhalogenated Organics by EPA 8015D - GRO	12
QC - Nonhalogenated Organics by EPA 8015D - DRO/ORO	13
QC - Anions by EPA 300.0/9056A	14
Definitions and Notes	15
Chain of Custody etc.	16

Sample Summary

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/07/25 10:11
--	---	------------------------------------

Client Sample ID	Lab Sample ID	Matrix	Sampled	Received	Container
BH06 0.5'	E509339-01A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH06 1'	E509339-02A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH06 2'	E509339-03A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH07 0.5'	E509339-04A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH07 1'	E509339-05A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH07 2'	E509339-06A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	--

BH06 0.5'
E509339-01

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Benzene	ND	0.0250	1	10/01/25	10/01/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/01/25	
Toluene	ND	0.0250	1	10/01/25	10/01/25	
o-Xylene	ND	0.0250	1	10/01/25	10/01/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/01/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/01/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		114 %	70-130	10/01/25	10/01/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/01/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		89.5 %	70-130	10/01/25	10/01/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540070
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		94.8 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540076
Chloride	4910	200	10	10/01/25	10/01/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	--

BH06 1'
E509339-02

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Benzene	ND	0.0250	1	10/01/25	10/01/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/01/25	
Toluene	ND	0.0250	1	10/01/25	10/01/25	
o-Xylene	ND	0.0250	1	10/01/25	10/01/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/01/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/01/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		113 %	70-130	10/01/25	10/01/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/01/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		90.1 %	70-130	10/01/25	10/01/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540070
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		97.2 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540076
Chloride	4920	100	5	10/01/25	10/01/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	-----------------------------------

BH06 2'

E509339-03

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Benzene	ND	0.0250	1	10/01/25	10/01/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/01/25	
Toluene	ND	0.0250	1	10/01/25	10/01/25	
o-Xylene	ND	0.0250	1	10/01/25	10/01/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/01/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/01/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		113 %	70-130	10/01/25	10/01/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/01/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		89.9 %	70-130	10/01/25	10/01/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540070
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		96.5 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540076
Chloride	691	20.0	1	10/01/25	10/01/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	--

BH07 0.5'

E509339-04

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Benzene	ND	0.0250	1	10/01/25	10/01/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/01/25	
Toluene	ND	0.0250	1	10/01/25	10/01/25	
o-Xylene	ND	0.0250	1	10/01/25	10/01/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/01/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/01/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		113 %	70-130	10/01/25	10/01/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/01/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		90.8 %	70-130	10/01/25	10/01/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540070
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		97.0 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540076
Chloride	3890	100	5	10/01/25	10/01/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	-----------------------------------

BH07 1'

E509339-05

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		115 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		90.2 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540070
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		96.0 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540076
Chloride	2910	100	5	10/01/25	10/01/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	--

BH07 2'

E509339-06

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		115 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: SL		Batch: 2540065
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		89.9 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540070
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		96.3 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540076
Chloride	544	20.0	1	10/01/25	10/01/25	



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	-----------------------------------

Volatile Organics by EPA 8021B

Analyst: SL

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540065-BLK1)

Prepared: 10/01/25 Analyzed: 10/01/25

Benzene	ND	0.0250							
Ethylbenzene	ND	0.0250							
Toluene	ND	0.0250							
o-Xylene	ND	0.0250							
p,m-Xylene	ND	0.0500							
Total Xylenes	ND	0.0250							
Surrogate: 4-Bromochlorobenzene-PID	9.35		8.00		117	70-130			

LCS (2540065-BS1)

Prepared: 10/01/25 Analyzed: 10/01/25

Benzene	4.62	0.0250	5.00		92.5	70-130			
Ethylbenzene	4.67	0.0250	5.00		93.3	70-130			
Toluene	4.61	0.0250	5.00		92.2	70-130			
o-Xylene	4.73	0.0250	5.00		94.6	70-130			
p,m-Xylene	9.47	0.0500	10.0		94.7	70-130			
Total Xylenes	14.2	0.0250	15.0		94.7	70-130			
Surrogate: 4-Bromochlorobenzene-PID	9.27		8.00		116	70-130			

Matrix Spike (2540065-MS1)

Source: E509337-02

Prepared: 10/01/25 Analyzed: 10/01/25

Benzene	5.13	0.0250	5.00	ND	103	70-130			
Ethylbenzene	5.14	0.0250	5.00	ND	103	70-130			
Toluene	5.11	0.0250	5.00	ND	102	70-130			
o-Xylene	5.21	0.0250	5.00	ND	104	70-130			
p,m-Xylene	10.4	0.0500	10.0	ND	104	70-130			
Total Xylenes	15.6	0.0250	15.0	ND	104	70-130			
Surrogate: 4-Bromochlorobenzene-PID	9.18		8.00		115	70-130			

Matrix Spike Dup (2540065-MSD1)

Source: E509337-02

Prepared: 10/01/25 Analyzed: 10/01/25

Benzene	4.82	0.0250	5.00	ND	96.3	70-130	6.40	27	
Ethylbenzene	4.84	0.0250	5.00	ND	96.8	70-130	6.03	26	
Toluene	4.80	0.0250	5.00	ND	96.0	70-130	6.34	20	
o-Xylene	4.90	0.0250	5.00	ND	98.1	70-130	6.13	25	
p,m-Xylene	9.80	0.0500	10.0	ND	98.0	70-130	6.04	23	
Total Xylenes	14.7	0.0250	15.0	ND	98.0	70-130	6.07	26	
Surrogate: 4-Bromochlorobenzene-PID	9.13		8.00		114	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	--

Nonhalogenated Organics by EPA 8015D - GRO

Analyst: SL

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540065-BLK1)

Prepared: 10/01/25 Analyzed: 10/01/25

Gasoline Range Organics (C6-C10)	ND	20.0							
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.27		8.00		90.9	70-130			

LCS (2540065-BS2)

Prepared: 10/01/25 Analyzed: 10/01/25

Gasoline Range Organics (C6-C10)	48.5	20.0	50.0		97.0	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.36		8.00		91.9	70-130			

Matrix Spike (2540065-MS2)

Source: E509337-02

Prepared: 10/01/25 Analyzed: 10/01/25

Gasoline Range Organics (C6-C10)	50.5	20.0	50.0	ND	101	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.30		8.00		91.3	70-130			

Matrix Spike Dup (2540065-MSD2)

Source: E509337-02

Prepared: 10/01/25 Analyzed: 10/01/25

Gasoline Range Organics (C6-C10)	46.2	20.0	50.0	ND	92.5	70-130	8.92	20	
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.26		8.00		90.7	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	--

Nonhalogenated Organics by EPA 8015D - DRO/ORO

Analyst: KH

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540070-BLK1)

Prepared: 10/01/25 Analyzed: 10/02/25

Diesel Range Organics (C10-C28)	ND	25.0							
Oil Range Organics (C28-C36)	ND	50.0							
Surrogate: <i>n</i> -Nonane	46.2		50.0		92.4	61-141			

LCS (2540070-BS1)

Prepared: 10/01/25 Analyzed: 10/02/25

Diesel Range Organics (C10-C28)	253	25.0	250		101	66-144			
Surrogate: <i>n</i> -Nonane	48.0		50.0		96.0	61-141			

Matrix Spike (2540070-MS1)

Source: E509341-06

Prepared: 10/01/25 Analyzed: 10/02/25

Diesel Range Organics (C10-C28)	271	25.0	250	ND	108	56-156			
Surrogate: <i>n</i> -Nonane	51.7		50.0		103	61-141			

Matrix Spike Dup (2540070-MSD1)

Source: E509341-06

Prepared: 10/01/25 Analyzed: 10/02/25

Diesel Range Organics (C10-C28)	273	25.0	250	ND	109	56-156	0.796	20	
Surrogate: <i>n</i> -Nonane	51.1		50.0		102	61-141			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 10:11:51AM
--	---	--

Anions by EPA 300.0/9056A

Analyst: TP

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540076-BLK1)

Prepared: 10/01/25 Analyzed: 10/01/25

Chloride ND 20.0

LCS (2540076-BS1)

Prepared: 10/01/25 Analyzed: 10/01/25

Chloride 250 20.0 250 100 90-110

Matrix Spike (2540076-MS1)

Source: E509338-03

Prepared: 10/01/25 Analyzed: 10/01/25

Chloride 2710 40.0 250 2410 119 80-120

Matrix Spike Dup (2540076-MSD1)

Source: E509338-03

Prepared: 10/01/25 Analyzed: 10/01/25

Chloride 2940 40.0 250 2410 212 80-120 8.28 20 M4

QC Summary Report Comment:

Calculations are based off of the raw (non-rounded) data. However, for reporting purposes all QC data is rounded to three significant figures. Therefore, hand calculated values may differ slightly.



Definitions and Notes

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/07/25 10:11
--	---	------------------------------------

M4 Matrix spike recovery value is suspect since the analyte concentration in the sample is disproportionate to the spike level. The associated LCS spike recovery was acceptable.

ND Analyte NOT DETECTED at or above the reporting limit

NR Not Reported

RPD Relative Percent Difference

DNI Did Not Ignite

DNR Did not react with the addition of acid or base.

Note (1): Methods marked with ** are non-accredited methods.

Note (2): Soil data is reported on an "as received" weight basis, unless reported otherwise.



Client Information		Invoice Information		Lab Use Only				TAT				State			
Client: Devon Energy Production Company, LP		Company: Devon Energy Production Company, LP		Lab WO#		Job Number		1D	2D	3D	Std	NM	CO	UT	TX
Project: Flagler 8 CTB 1		Address: 5315 Buena Vista Dr.		E 504339		0658-0007						x			
Project Manager: Erick Herrera		City, State, Zip: Carlsbad, NM, 88220													
Address: 13000 W County Rd 100		Phone: 575-885-7502													
City, State, Zip: Odessa, TX, 79765		Email: jim.raley@divn.com													
Phone: 432-305-6415		Miscellaneous: WO: 21663733 & 21686668; PN: 22781 &													
Email: NMTXGeoGroup@etechnv.com		22931 IN: nAPP2521623297 & nAPP2524723254													

Sample Information							Analysis and Method										EPA Program		
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Depth	Lab Number	DRO/ORO by 8015	GRO/DRO by 8015	BTEX by 8021	VOC by 8260	Chloride 300.0	TCEQ 1005 - TX	RCRA 8 Metals	BGDOC - NM	BGDOC - TX	SDWA	CWA	RCRA	
9:00	9/26/2025	S	1	BH06	0.5'	1								X					
9:10	9/26/2025	S	1	BH06	1'	2								X					
9:20	9/26/2025	S	1	BH06	2'	3								X					
10:00	9/26/2025	S	1	BH07	0.5'	4								X					
10:10	9/26/2025	S	1	BH07	1'	5								X					
10:20	9/26/2025	S	1	BH07	2'	6								X					

Additional Instructions:

I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.

Sampled by: Haleigh Blume										Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: (Y/N)											
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Relinquished by: (Signature)	Date	Time	Received by: (Signature)											Date	Time
<i>Haleigh Blume</i>	09/24/2025	930	<i>Michelle Gonzales</i>	9-30-25	0930	<i>Michelle Gonzales</i>	9-30-25	1500	<i>Andrew Musso</i>											9-30-25	1500
<i>Michelle Gonzales</i>	9-30-25	1500	<i>Andrew Musso</i>	9-30-25	1940	<i>Andrew Musso</i>	9-30-25	1940	<i>Christina</i>											10-1-25	730
<i>Andrew Musso</i>	9-30-25	1940	<i>Christina</i>	10-1-25	0115																

Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other _____ Container Type: g - glass, p - poly/plastic, ag - amber glass, v - VOA

Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.

Envirotech Analytical Laboratory

Printed: 10/1/2025 9:53:56AM

Sample Receipt Checklist (SRC)

Instructions: Please take note of any NO checkmarks.

If we receive no response concerning these items within 24 hours of the date of this notice, all the samples will be analyzed as requested.

Client: Devon Energy - Carlsbad	Date Received: 10/01/25 07:30	Work Order ID: E509339
Phone: (575) 748-0176	Date Logged In: 09/30/25 16:04	Logged In By: Caitlin Mars
Email:	Due Date: 10/07/25 17:00 (4 day TAT)	

Chain of Custody (COC)

- 1. Does the sample ID match the COC? Yes
- 2. Does the number of samples per sampling site location match the COC? Yes
- 3. Were samples dropped off by client or carrier? Yes
- 4. Was the COC complete, i.e., signatures, dates/times, requested analyses? Yes
- 5. Were all samples received within holding time? Yes

Carrier: Courier

Note: Analysis, such as pH which should be conducted in the field, i.e, 15 minute hold time, are not included in this discussion.

Comments/Resolution

Sample Turn Around Time (TAT)

- 6. Did the COC indicate standard TAT, or Expedited TAT? Yes

Sample Cooler

- 7. Was a sample cooler received? Yes
- 8. If yes, was cooler received in good condition? Yes
- 9. Was the sample(s) received intact, i.e., not broken? Yes
- 10. Were custody/security seals present? No
- 11. If yes, were custody/security seals intact? NA
- 12. Was the sample received on ice? Yes

Note: Thermal preservation is not required, if samples are received within 15 minutes of sampling

- 13. See COC for individual sample temps. Samples outside of 0°C-6°C will be recorded in comments.

Sample Container

- 14. Are aqueous VOC samples present? No
- 15. Are VOC samples collected in VOA Vials? NA
- 16. Is the head space less than 6-8 mm (pea sized or less)? NA
- 17. Was a trip blank (TB) included for VOC analyses? NA
- 18. Are non-VOC samples collected in the correct containers? Yes
- 19. Is the appropriate volume/weight or number of sample containers collected? Yes

Field Label

- 20. Were field sample labels filled out with the minimum information:
 - Sample ID? Yes
 - Date/Time Collected? Yes
 - Collectors name? Yes

Sample Preservation

- 21. Does the COC or field labels indicate the samples were preserved? No
- 22. Are sample(s) correctly preserved? NA
- 24. Is lab filtration required and/or requested for dissolved metals? No

Multiphase Sample Matrix

- 26. Does the sample have more than one phase, i.e., multiphase? No
- 27. If yes, does the COC specify which phase(s) is to be analyzed? NA

Subcontract Laboratory

- 28. Are samples required to get sent to a subcontract laboratory? No
- 29. Was a subcontract laboratory specified by the client and if so who? NA Subcontract Lab: NA

Client Instruction

Signature of client authorizing changes to the COC or sample disposition.

Date



envirotech Inc.

Report to:
Erick Herrera



envirotech

Practical Solutions for a Better Tomorrow

Analytical Report

Devon Energy - Carlsbad

Project Name: FLAGLER 8 CTB 1

Work Order: E509342

Job Number: 01058-0007

Received: 10/1/2025

Revision: 1

Report Reviewed By:

Walter Hinchman
Laboratory Director
10/7/25

5796 U.S. Hwy 64
Farmington, NM 87401

Phone: (505) 632-1881
Envirotech-inc.com



Envirotech Inc. certifies the test results meet all requirements of TNI unless noted otherwise.
Statement of Data Authenticity: Envirotech Inc, attests the data reported has not been altered in any way.
Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech Inc.
Envirotech Inc, holds the Utah TNI certification NM00979 for data reported.
Envirotech Inc, holds the Texas TNI certification T104704557 for data reported.



Date Reported: 10/7/25

Erick Herrera
333 W Sheridan Avenue
Oklahoma City, OK 73102-5010

Project Name: FLAGLER 8 CTB 1
Workorder: E509342
Date Received: 10/1/2025 7:30:00AM

Erick Herrera,

Thank you for choosing Envirotech, Inc. as your analytical testing laboratory for the sample(s) received on, 10/1/2025 7:30:00AM, under the Project Name: FLAGLER 8 CTB 1.

The analytical test results summarized in this report with the Project Name: FLAGLER 8 CTB 1 apply to the individual samples collected, identified and submitted bearing the project name on the enclosed chain-of-custody. Subcontracted sample analyses not conducted by Envirotech, Inc., are attached in full as issued by the subcontract laboratory.

Please review the Chain-of-Custody (COC) and Sample Receipt Checklist (SRC) for any issues regarding sample receipt temperature, containers, preservation etc. To best understand your test results, review the entire report summarizing your sample data and the associated quality control batch data.

All reported data in this analytical report were analyzed according to the referenced method(s) and are in compliance with the latest NELAC/TNI standards, unless otherwise noted. Samples or analytical quality control parameters not meeting specific QC criteria are qualified with a data flag. Data flag definitions are located in the Notes and Definitions section of this analytical report.

If you have any questions concerning this report, please feel free to contact Envirotech, Inc.

Respectfully,

Walter Hinchman
Laboratory Director
Office: 505-632-1881
Cell: 775-287-1762
whinchman@envirotech-inc.com

Raina Schwanz
Laboratory Administrator
Office: 505-632-1881
rainaschwanz@envirotech-inc.com

Field Offices:

Southern New Mexico Area

Lynn Jarboe
Laboratory Technical Representative
Office: 505-421-LABS(5227)
Cell: 505-320-4759
ljjarboe@envirotech-inc.com

Michelle Gonzales
Client Representative
Office: 505-421-LABS(5227)
Cell: 505-947-8222
mgonzales@envirotech-inc.com

Envirotech Web Address: www.envirotech-inc.com

Table of Contents

Title Page	1
Cover Page	2
Table of Contents	3
Sample Summary	5
Sample Data	6
BH08 0.5'	6
BH08 1'	7
BH08 2'	8
BH09 0.5'	9
BH09 1'	10
BH09 2'	11
BH10 0.5'	12
BH10 1'	13
BH10 2'	14
BH11 0.5'	15
BH11 1'	16
BH11 2'	17
BH12 0.5'	18
BH12 1'	19
BH12 2'	20
BH13 0.5'	21
BH13 1'	22
BH13 2'	23
BH14 0.5'	24
BH14 1'	25

Table of Contents (continued)

BH14 2'	26
BH15 0.5'	27
BH15 1'	28
BH15 2'	29
BH16 0.5'	30
BH16 1'	31
BH16 2'	32
QC Summary Data	33
QC - Volatile Organics by EPA 8021B	33
QC - Nonhalogenated Organics by EPA 8015D - GRO	35
QC - Nonhalogenated Organics by EPA 8015D - DRO/ORO	37
QC - Anions by EPA 300.0/9056A	39
Definitions and Notes	41
Chain of Custody etc.	42

Sample Summary

Devon Energy - Carlsbad
333 W Sheridan Avenue
Oklahoma City OK, 73102-5010

Project Name: FLAGLER 8 CTB 1
Project Number: 01058-0007
Project Manager: Erick Herrera

Reported:
10/07/25 12:09

Client Sample ID	Lab Sample ID	Matrix	Sampled	Received	Container
BH08 0.5'	E509342-01A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH08 1'	E509342-02A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH08 2'	E509342-03A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH09 0.5'	E509342-04A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH09 1'	E509342-05A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH09 2'	E509342-06A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH10 0.5'	E509342-07A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH10 1'	E509342-08A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH10 2'	E509342-09A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH11 0.5'	E509342-10A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH11 1'	E509342-11A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH11 2'	E509342-12A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH12 0.5'	E509342-13A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH12 1'	E509342-14A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH12 2'	E509342-15A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH13 0.5'	E509342-16A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH13 1'	E509342-17A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH13 2'	E509342-18A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH14 0.5'	E509342-19A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH14 1'	E509342-20A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH14 2'	E509342-21A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH15 0.5'	E509342-22A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH15 1'	E509342-23A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH15 2'	E509342-24A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH16 0.5'	E509342-25A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH16 1'	E509342-26A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.
BH16 2'	E509342-27A	Soil	09/26/25	10/01/25	Glass Jar, 2 oz.



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH08 0.5'
E509342-01

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		93.6 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		86.2 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>						
		104 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	58.0	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH08 1'
E509342-02

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		93.8 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		87.1 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		104 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	36.9	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH08 2'

E509342-03

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		95.5 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		89.7 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		107 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	41.8	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH09 0.5'

E509342-04

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		94.3 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		87.5 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>						
		108 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	212	40.0	2	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH09 1'

E509342-05

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		94.6 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		89.4 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>						
		105 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	176	40.0	2	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH09 2'

E509342-06

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		96.0 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		87.3 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		102 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	669	40.0	2	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH10 0.5'
E509342-07

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		96.6 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		91.3 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		105 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	37.7	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH10 1'
E509342-08

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		94.4 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		94.2 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>						
		105 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	64.2	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH10 2'
E509342-09

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		94.4 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		94.4 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		104 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	45.2	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH11 0.5'
E509342-10

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		94.8 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		94.0 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>						
		108 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	222	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH11 1'
E509342-11

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		95.6 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: RKS		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		94.8 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>						
		105 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	70.2	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH11 2'
E509342-12

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		95.1 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		96.9 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>						
		104 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	34.7	20.0	1	10/01/25	10/02/25	

Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH12 0.5'

E509342-13

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		93.6 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		94.6 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>						
		107 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	271	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH12 1'
E509342-14

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		94.8 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		93.9 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>						
		105 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	127	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH12 2'
E509342-15

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		93.1 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		92.7 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		104 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	42.5	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH13 0.5'

E509342-16

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		92.0 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		95.2 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>						
		104 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	86.6	40.0	2	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH13 1'
E509342-17

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		94.7 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		96.6 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>						
		105 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	109	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH13 2'
E509342-18

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		95.9 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		95.8 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>						
		104 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	42.3	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH14 0.5'

E509342-19

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		93.7 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		92.5 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>		108 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	242	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH14 1'
E509342-20

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		96.5 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540068
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		96.8 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2540071
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/02/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/02/25	
<i>Surrogate: n-Nonane</i>						
		105 %	61-141	10/01/25	10/02/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2540084
Chloride	104	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH14 2'
E509342-21

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		117 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		96.1 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: NV		Batch: 2540074
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		98.7 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540082
Chloride	43.9	20.0	1	10/01/25	10/01/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH15 0.5'

E509342-22

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		117 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		97.0 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: NV		Batch: 2540074
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>						
		98.6 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: TP		Batch: 2540082
Chloride	247	40.0	2	10/01/25	10/01/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH15 1'
E509342-23

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		117 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		97.4 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: NV		Batch: 2540074
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		95.9 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540082
Chloride	116	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH15 2'
E509342-24

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		120 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		25.3 %	70-130	10/01/25	10/02/25	S3
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: NV		Batch: 2540074
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>						
		97.2 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: TP		Batch: 2540082
Chloride	40.9	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH16 0.5'
E509342-25

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		120 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		97.3 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: NV		Batch: 2540074
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		99.9 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540082
Chloride	240	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH16 1'
E509342-26

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		121 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		98.0 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: NV		Batch: 2540074
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>						
		99.0 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: TP		Batch: 2540082
Chloride	199	20.0	1	10/01/25	10/02/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

BH16 2'
E509342-27

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Benzene	ND	0.0250	1	10/01/25	10/02/25	
Ethylbenzene	ND	0.0250	1	10/01/25	10/02/25	
Toluene	ND	0.0250	1	10/01/25	10/02/25	
o-Xylene	ND	0.0250	1	10/01/25	10/02/25	
p,m-Xylene	ND	0.0500	1	10/01/25	10/02/25	
Total Xylenes	ND	0.0250	1	10/01/25	10/02/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		123 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2540067
Gasoline Range Organics (C6-C10)	ND	20.0	1	10/01/25	10/02/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		97.6 %	70-130	10/01/25	10/02/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: NV		Batch: 2540074
Diesel Range Organics (C10-C28)	ND	25.0	1	10/01/25	10/01/25	
Oil Range Organics (C28-C36)	ND	50.0	1	10/01/25	10/01/25	
<i>Surrogate: n-Nonane</i>		101 %	61-141	10/01/25	10/01/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2540082
Chloride	48.6	20.0	1	10/01/25	10/02/25	



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	-----------------------------------

Volatile Organics by EPA 8021B

Analyst: BA

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540067-BLK1)

Prepared: 10/01/25 Analyzed: 10/07/25

Benzene	ND	0.0250							
Ethylbenzene	ND	0.0250							
Toluene	ND	0.0250							
o-Xylene	ND	0.0250							
p,m-Xylene	ND	0.0500							
Total Xylenes	ND	0.0250							
Surrogate: 4-Bromochlorobenzene-PID	8.98		8.00		112	70-130			

LCS (2540067-BS1)

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	5.12	0.0250	5.00		102	70-130			
Ethylbenzene	5.10	0.0250	5.00		102	70-130			
Toluene	5.09	0.0250	5.00		102	70-130			
o-Xylene	5.19	0.0250	5.00		104	70-130			
p,m-Xylene	10.3	0.0500	10.0		103	70-130			
Total Xylenes	15.5	0.0250	15.0		103	70-130			
Surrogate: 4-Bromochlorobenzene-PID	9.18		8.00		115	70-130			

Matrix Spike (2540067-MS1)

Source: E509341-10

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	5.01	0.0250	5.00	ND	100	70-130			
Ethylbenzene	5.01	0.0250	5.00	ND	100	70-130			
Toluene	4.99	0.0250	5.00	ND	99.7	70-130			
o-Xylene	5.09	0.0250	5.00	ND	102	70-130			
p,m-Xylene	10.1	0.0500	10.0	ND	101	70-130			
Total Xylenes	15.2	0.0250	15.0	ND	102	70-130			
Surrogate: 4-Bromochlorobenzene-PID	9.30		8.00		116	70-130			

Matrix Spike Dup (2540067-MSD1)

Source: E509341-10

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	4.90	0.0250	5.00	ND	97.9	70-130	2.30	27	
Ethylbenzene	4.89	0.0250	5.00	ND	97.8	70-130	2.47	26	
Toluene	4.87	0.0250	5.00	ND	97.3	70-130	2.41	20	
o-Xylene	4.98	0.0250	5.00	ND	99.5	70-130	2.34	25	
p,m-Xylene	9.89	0.0500	10.0	ND	98.9	70-130	2.52	23	
Total Xylenes	14.9	0.0250	15.0	ND	99.1	70-130	2.46	26	
Surrogate: 4-Bromochlorobenzene-PID	9.45		8.00		118	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	-----------------------------------

Volatile Organics by EPA 8021B

Analyst: RKS

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540068-BLK1)

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	ND	0.0250							
Ethylbenzene	ND	0.0250							
Toluene	ND	0.0250							
o-Xylene	ND	0.0250							
p,m-Xylene	ND	0.0500							
Total Xylenes	ND	0.0250							
Surrogate: 4-Bromochlorobenzene-PID	7.55		8.00		94.4	70-130			

LCS (2540068-BS1)

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	4.88	0.0250	5.00		97.5	70-130			
Ethylbenzene	4.73	0.0250	5.00		94.7	70-130			
Toluene	4.82	0.0250	5.00		96.3	70-130			
o-Xylene	4.79	0.0250	5.00		95.8	70-130			
p,m-Xylene	9.56	0.0500	10.0		95.6	70-130			
Total Xylenes	14.3	0.0250	15.0		95.6	70-130			
Surrogate: 4-Bromochlorobenzene-PID	7.58		8.00		94.8	70-130			

Matrix Spike (2540068-MS1)

Source: E509342-05

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	4.76	0.0250	5.00	ND	95.3	70-130			
Ethylbenzene	4.60	0.0250	5.00	ND	91.9	70-130			
Toluene	4.69	0.0250	5.00	ND	93.9	70-130			
o-Xylene	4.65	0.0250	5.00	ND	93.0	70-130			
p,m-Xylene	9.29	0.0500	10.0	ND	92.9	70-130			
Total Xylenes	13.9	0.0250	15.0	ND	92.9	70-130			
Surrogate: 4-Bromochlorobenzene-PID	7.53		8.00		94.1	70-130			

Matrix Spike Dup (2540068-MSD1)

Source: E509342-05

Prepared: 10/01/25 Analyzed: 10/02/25

Benzene	4.96	0.0250	5.00	ND	99.3	70-130	4.11	27	
Ethylbenzene	4.80	0.0250	5.00	ND	96.0	70-130	4.30	26	
Toluene	4.90	0.0250	5.00	ND	98.0	70-130	4.25	20	
o-Xylene	4.85	0.0250	5.00	ND	97.1	70-130	4.29	25	
p,m-Xylene	9.68	0.0500	10.0	ND	96.8	70-130	4.15	23	
Total Xylenes	14.5	0.0250	15.0	ND	96.9	70-130	4.20	26	
Surrogate: 4-Bromochlorobenzene-PID	7.67		8.00		95.9	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

Nonhalogenated Organics by EPA 8015D - GRO

Analyst: BA

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540067-BLK1)

Prepared: 10/01/25 Analyzed: 10/07/25

Gasoline Range Organics (C6-C10)	ND	20.0							
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.58		8.00		94.7	70-130			

LCS (2540067-BS2)

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	47.1	20.0	50.0		94.2	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.40		8.00		92.5	70-130			

Matrix Spike (2540067-MS2)

Source: E509341-10

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	48.7	20.0	50.0	ND	97.4	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.26		8.00		90.7	70-130			

Matrix Spike Dup (2540067-MSD2)

Source: E509341-10

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	47.5	20.0	50.0	ND	95.0	70-130	2.53	20	
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.29		8.00		91.1	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

Nonhalogenated Organics by EPA 8015D - GRO

Analyst: RKS

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec % %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	---------------	--------------------	----------	-------------------	-------

Blank (2540068-BLK1)

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	ND	20.0							
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.08		8.00		88.6	70-130			

LCS (2540068-BS2)

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	45.8	20.0	50.0		91.5	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	6.92		8.00		86.4	70-130			

Matrix Spike (2540068-MS2)

Source: E509342-05

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	48.0	20.0	50.0	ND	95.9	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	6.92		8.00		86.5	70-130			

Matrix Spike Dup (2540068-MSD2)

Source: E509342-05

Prepared: 10/01/25 Analyzed: 10/02/25

Gasoline Range Organics (C6-C10)	50.7	20.0	50.0	ND	101	70-130	5.63	20	
Surrogate: 1-Chloro-4-fluorobenzene-FID	6.90		8.00		86.2	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

Nonhalogenated Organics by EPA 8015D - DRO/ORO

Analyst: KH

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540071-BLK1)

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	ND	25.0							
Oil Range Organics (C28-C36)	ND	50.0							
Surrogate: <i>n</i> -Nonane	50.2		50.0		100	61-141			

LCS (2540071-BS1)

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	248	25.0	250		99.1	66-144			
Surrogate: <i>n</i> -Nonane	50.6		50.0		101	61-141			

Matrix Spike (2540071-MS1)

Source: E509342-09

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	257	25.0	250	ND	103	56-156			
Surrogate: <i>n</i> -Nonane	52.4		50.0		105	61-141			

Matrix Spike Dup (2540071-MSD1)

Source: E509342-09

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	253	25.0	250	ND	101	56-156	1.23	20	
Surrogate: <i>n</i> -Nonane	51.7		50.0		103	61-141			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

Nonhalogenated Organics by EPA 8015D - DRO/ORO

Analyst: NV

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540074-BLK1)

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	ND	25.0							
Oil Range Organics (C28-C36)	ND	50.0							
Surrogate: <i>n</i> -Nonane	47.7		50.0		95.5	61-141			

LCS (2540074-BS1)

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	245	25.0	250		97.9	66-144			
Surrogate: <i>n</i> -Nonane	46.0		50.0		92.1	61-141			

Matrix Spike (2540074-MS1)

Source: E509342-24

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	251	25.0	250	ND	101	56-156			
Surrogate: <i>n</i> -Nonane	48.1		50.0		96.3	61-141			

Matrix Spike Dup (2540074-MSD1)

Source: E509342-24

Prepared: 10/01/25 Analyzed: 10/01/25

Diesel Range Organics (C10-C28)	255	25.0	250	ND	102	56-156	1.49	20	
Surrogate: <i>n</i> -Nonane	49.0		50.0		98.1	61-141			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

Anions by EPA 300.0/9056A

Analyst: TP

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540082-BLK1)

Prepared: 10/01/25 Analyzed: 10/01/25

Chloride ND 20.0

LCS (2540082-BS1)

Prepared: 10/01/25 Analyzed: 10/01/25

Chloride 251 20.0 250 101 90-110

Matrix Spike (2540082-MS1)

Source: E509341-05

Prepared: 10/01/25 Analyzed: 10/02/25

Chloride 424 200 250 ND 170 80-120 M2

Matrix Spike Dup (2540082-MSD1)

Source: E509341-05

Prepared: 10/01/25 Analyzed: 10/02/25

Chloride 434 200 250 ND 174 80-120 2.24 20 M2



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/7/2025 12:09:23PM
--	---	--

Anions by EPA 300.0/9056A

Analyst: DT

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2540084-BLK1)

Prepared: 10/01/25 Analyzed: 10/02/25

Chloride ND 20.0

LCS (2540084-BS1)

Prepared: 10/01/25 Analyzed: 10/02/25

Chloride 256 20.0 250 102 90-110

Matrix Spike (2540084-MS1)

Source: E509342-04

Prepared: 10/01/25 Analyzed: 10/02/25

Chloride 478 40.0 250 212 107 80-120

Matrix Spike Dup (2540084-MSD1)

Source: E509342-04

Prepared: 10/01/25 Analyzed: 10/02/25

Chloride 424 40.0 250 212 85.0 80-120 12.0 20

QC Summary Report Comment:

Calculations are based off of the raw (non-rounded) data. However, for reporting purposes all QC data is rounded to three significant figures. Therefore, hand calculated values may differ slightly.



Definitions and Notes

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Erick Herrera	Reported: 10/07/25 12:09
--	---	------------------------------------

M2 Matrix spike recovery was outside quality control limits. The associated LCS spike recovery was acceptable.

S3 Surrogate spike recovery was outside acceptance limits. LCS spike recovery was acceptable.

ND Analyte NOT DETECTED at or above the reporting limit

NR Not Reported

RPD Relative Percent Difference

DNI Did Not Ignite

DNR Did not react with the addition of acid or base.

Note (1): Methods marked with ** are non-accredited methods.

Note (2): Soil data is reported on an "as received" weight basis, unless reported otherwise.



Client Information				Invoice Information				Lab Use Only				TAT				State					
Client: Devon Energy Production Company, LP				Company: Devon Energy Production Company, LP				Lab WO#		Job Number		1D	2D	3D	Std	NM	CO	UT	TX		
Project: Flagler 8 CTB 1				Address: 5315 Buena Vista Dr.				E509342		01058-0007					x	x					
Project Manager: Erick Herrera				City, State, Zip: Carlsbad, NM, 88220																	
Address: 13000 W County Rd 100				Phone: 575-885-7502																	
City, State, Zip: Odessa, TX, 79765				Email: jim.raley@divn.com																	
Phone: 432-305-6415				Miscellaneous: WO: 21663733 & 21686668; PN: 22781 & 22931 IN: nAPP2521623297 & nAPP2524723254																	
Email: NMTXGeoGroup@etechnv.com																					
Sample Information										Analysis and Method						EPA Program					
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Depth	Lab Number	DRO/DRO by 8015	GRO/DRO by 8015	BTEX by 8021	VOC by 8260	Chloride 300.0	TCEQ 1005 - TX	RCRA 8 Metals	BGDOC - NM	BGDOC - TX	SDWA	CWA	RCRA			
																Compliance	Y	or	N		
																PWSID #					
																Sample Temp			Remarks		
10:50	9/26/2025	S	1	BH08	0.5'	1								X		3.2					
11:00	9/26/2025	S	1	BH08	1'	2								X		3.0					
11:10	9/26/2025	S	1	BH08	2'	3								X		2.6					
11:40	9/26/2025	S	1	BH09	0.5'	4								X		2.4					
11:50	9/26/2025	S	1	BH09	1'	5								X		1.8					
12:00	9/26/2025	S	1	BH09	2'	6								X		1.9					
12:40	9/26/2025	S	1	BH10	0.5'	7								X		2.0					
12:50	9/26/2025	S	1	BH10	1'	8								X		2.0					
13:00	9/26/2025	S	1	BH10	2'	9								X		2.4					
13:40	9/26/2025	S	1	BH11	0.5'	10								X		2.2					
Additional Instructions:																					
I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.																					
Sampled by: Haleigh Blume																					
Relinquished by: (Signature) <i>Haleigh Blume</i>				Date 9/29/2025		Time 9:30		Received by: (Signature) <i>Michelle Gonzales</i>				Date 9.30.25		Time 0930		Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days.					
Relinquished by: (Signature) <i>Michelle Gonzales</i>				Date 9.30.25		Time 1500		Received by: (Signature) <i>Matthew Draper</i>				Date 9.30.25		Time 1500							
Relinquished by: (Signature) <i>Matthew Draper</i>				Date 9.30.25		Time 1940		Received by: (Signature) <i>Andrew Musso</i>				Date 9.30.25		Time 1940							
Relinquished by: (Signature) <i>Andrew Musso</i>				Date 10.1.25		Time 0115		Received by: (Signature) <i>Caitlynn</i>				Date 10.1.25		Time 730							
Relinquished by: (Signature)				Date		Time		Received by: (Signature)				Date		Time		Lab Use Only Received on ice: <input checked="" type="radio"/> Y <input type="radio"/> N					
Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other										Container Type: g - glass, p - poly/plastic, ag - amber glass, v - VOA											
Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.																					

Client Information		Invoice Information		Lab Use Only				TAT				State			
Client: Devon Energy Production Company, LP		Company: Devon Energy Production Company, LP		Lab WO#		Job Number		1D	2D	3D	Std	NM	CO	UT	TX
Project: Flagler 8 CTB 1		Address: 5315 Buena Vista Dr.		E809342		21058-007					x	x			
Project Manager: Erick Herrera		City, State, Zip: Carlsbad, NM, 88220													
Address: 13000 W County Rd 100		Phone: 575-885-7502													
City, State, Zip: Odessa, TX, 79765		Email: jim.raley@dnv.com													
Phone: 432-305-6415		Miscellaneous: WO: 21663733 & 21686668; PN: 22781 &													
Email: NMTXGeoGroup@etechenv.com		22931 IN: nAPP2521623297 & nAPP2524723254													

Sample Information							Analysis and Method										EPA Program		
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Depth	Lab Number	DRO/ORO by 8015	GRO/DRO by 8015	BTEX by 8021	VOC by 8260	Chloride 300.0	TCEQ 1005 - TX	RCRA 8 Metals	BGDOC - NM	BGDOC - TX	SDWA	CWA	RCRA	
13:50	9/26/2025	S	1	BH11	1'	11								X					
14:00	9/26/2025	S	1	BH11	2'	12								X					
14:20	9/26/2025	S	1	BH12	0.5'	13								X					
14:25	9/26/2025	S	1	BH12	1'	14								X					
14:30	9/26/2025	S	1	BH12	2'	15								X					
14:35	9/26/2025	S	1	BH13	0.5'	16								X					
14:40	9/26/2025	S	1	BH13	1'	17								X					
14:45	9/26/2025	S	1	BH13	2'	18								X					
14:50	9/26/2025	S	1	BH14	0.5'	19								X					
14:55	9/26/2025	S	1	BH14	1'	20								X					

Additional Instructions:

I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.

Sampled by: Haleigh Blume

Relinquished by: (Signature) <i>Haleigh Blume</i>	Date 9/29/2025	Time 930	Received by: (Signature) <i>Michelle Gonzales</i>	Date 9-30-25	Time 0930	Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: (Y/N)
Relinquished by: (Signature) <i>Michelle Gonzales</i>	Date 9-30-25	Time 1500	Received by: (Signature) <i>Andrew Musso</i>	Date 9-30-25	Time 1500	
Relinquished by: (Signature) <i>Michelle Gonzales</i>	Date 9-30-25	Time 1940	Received by: (Signature) <i>Andrew Musso</i>	Date 9-30-25	Time 1940	
Relinquished by: (Signature) <i>Andrew Musso</i>	Date 10-1-25	Time 0115	Received by: (Signature) <i>Caitlynn</i>	Date 10-1-25	Time 730	
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	

Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other _____ Container Type: g - glass, p - poly/plastic, ag - amber glass, v - VOA

Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.

Client Information				Invoice Information				Lab Use Only				TAT				State			
Client: Devon Energy Production Company, LP				Company: Devon Energy Production Company, LP				Lab WO#		Job Number		1D	2D	3D	Std	NM	CO	UT	TX
Project: Flagler 8 CTB 1				Address: 5315 Buena Vista Dr.				E509342		01058007						x			
Project Manager: Erick Herrera				City, State, Zip: Carlsbad, NM, 88220															
Address: 13000 W County Rd 100				Phone: 575-885-7502															
City, State, Zip: Odessa, TX, 79765				Email: jim.raley@dvn.com															
Phone: 432-305-6415				Miscellaneous: WO: 21663733 & 21686668; PN: 22781 &															
Email: NMTXGeoGroup@etechenv.com				22931 IN: nAPP2521623297 & nAPP2524723254															

Sample Information							Analysis and Method								EPA Program			
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Depth	Lab Number	DRO/DRO by 8015	GRO/DRO by 8015	BTEX by 8021	VOC by 8260	Chloride 300.0	TCEQ 1005 - TX	RCRA & Metals	BGDOC - NM	BGDOC - TX	SDWA	CWA	RCRA
15:00	9/26/2025	S	1	BH14	2'	21								X				
15:05	9/26/2025	S	1	BH15	0.5'	22								X				
15:10	9/26/2025	S	1	BH15	1'	23								X				
15:15	9/26/2025	S	1	BH15	2'	24								X				
15:20	9/26/2025	S	1	BH16	0.5'	25								X				
15:25	9/26/2025	S	1	BH16	1'	26								X				
15:30	9/26/2025	S	1	BH16	2'	27								X				

Additional Instructions:

I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.

Sampled by: Haleigh Blume						Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N					
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time						
<i>Haleigh Blume</i>	9/29/2025	9:30	<i>Michelle Gonzales</i>	9-30-25	0930						
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time						
<i>Michelle Gonzales</i>	9-30-25	1500	<i>Matthew Dransfield</i>	9-30-25	1500						
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time						
<i>Matthew Dransfield</i>	9-30-25	1940	<i>Andrew Musso</i>	9-30-25	1940						
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time						
<i>Andrew Musso</i>	10-1-25	0915	<i>Curtis Han</i>	10-1-25	730						

Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other
 Container Type: g - glass, p - poly/plastic, ag - amber glass, v - VOA

Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.

Envirotech Analytical Laboratory

Printed: 10/1/2025 9:56:57AM

Sample Receipt Checklist (SRC)

Instructions: Please take note of any NO checkmarks.

If we receive no response concerning these items within 24 hours of the date of this notice, all the samples will be analyzed as requested.

Client: Devon Energy - Carlsbad	Date Received: 10/01/25 07:30	Work Order ID: E509342
Phone: (575) 748-0176	Date Logged In: 09/30/25 16:05	Logged In By: Caitlin Mars
Email:	Due Date: 10/07/25 17:00 (4 day TAT)	

Chain of Custody (COC)

- 1. Does the sample ID match the COC? Yes
- 2. Does the number of samples per sampling site location match the COC? Yes
- 3. Were samples dropped off by client or carrier? Yes
- 4. Was the COC complete, i.e., signatures, dates/times, requested analyses? Yes
- 5. Were all samples received within holding time? Yes

Carrier: Courier

Note: Analysis, such as pH which should be conducted in the field, i.e, 15 minute hold time, are not included in this discussion.

Comments/Resolution

Sample Turn Around Time (TAT)

- 6. Did the COC indicate standard TAT, or Expedited TAT? Yes

Sample Cooler

- 7. Was a sample cooler received? Yes
- 8. If yes, was cooler received in good condition? Yes
- 9. Was the sample(s) received intact, i.e., not broken? Yes
- 10. Were custody/security seals present? No
- 11. If yes, were custody/security seals intact? NA
- 12. Was the sample received on ice? Yes

Note: Thermal preservation is not required, if samples are received within 15 minutes of sampling

- 13. See COC for individual sample temps. Samples outside of 0°C-6°C will be recorded in comments.

Sample Container

- 14. Are aqueous VOC samples present? No
- 15. Are VOC samples collected in VOA Vials? NA
- 16. Is the head space less than 6-8 mm (pea sized or less)? NA
- 17. Was a trip blank (TB) included for VOC analyses? NA
- 18. Are non-VOC samples collected in the correct containers? Yes
- 19. Is the appropriate volume/weight or number of sample containers collected? Yes

Field Label

- 20. Were field sample labels filled out with the minimum information:
 - Sample ID? Yes
 - Date/Time Collected? Yes
 - Collectors name? Yes

Sample Preservation

- 21. Does the COC or field labels indicate the samples were preserved? No
- 22. Are sample(s) correctly preserved? NA
- 24. Is lab filtration required and/or requested for dissolved metals? No

Multiphase Sample Matrix

- 26. Does the sample have more than one phase, i.e., multiphase? No
- 27. If yes, does the COC specify which phase(s) is to be analyzed? NA

Subcontract Laboratory

- 28. Are samples required to get sent to a subcontract laboratory? No
- 29. Was a subcontract laboratory specified by the client and if so who? NA Subcontract Lab: NA

Client Instruction

Signature of client authorizing changes to the COC or sample disposition.

Date



envirotech Inc.

Report to:
Anna Byers



envirotech

Practical Solutions for a Better Tomorrow

Analytical Report

Devon Energy - Carlsbad

Project Name: FLAGLER 8 CTB 1

Work Order: E512152

Job Number: 01058-0007

Received: 12/16/2025

Revision: 1

Report Reviewed By:

Walter Hinchman
Laboratory Director
12/22/25

5796 U.S. Hwy 64
Farmington, NM 87401

Phone: (505) 632-1881
Envirotech-inc.com



Envirotech Inc. certifies the test results meet all requirements of TNI unless noted otherwise.
Statement of Data Authenticity: Envirotech Inc, attests the data reported has not been altered in any way.
Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech Inc.
Envirotech Inc, holds the Utah TNI certification NM00979 for data reported.
Envirotech Inc, holds the Texas TNI certification T104704557 for data reported.



Date Reported: 12/22/25

Anna Byers
333 W Sheridan Avenue
Oklahoma City, OK 73102-5010

Project Name: FLAGLER 8 CTB 1
Workorder: E512152
Date Received: 12/16/2025 7:05:00PM

Anna Byers,

Thank you for choosing Envirotech, Inc. as your analytical testing laboratory for the sample(s) received on, 12/16/2025 7:05:00PM, under the Project Name: FLAGLER 8 CTB 1.

The analytical test results summarized in this report with the Project Name: FLAGLER 8 CTB 1 apply to the individual samples collected, identified and submitted bearing the project name on the enclosed chain-of-custody. Subcontracted sample analyses not conducted by Envirotech, Inc., are attached in full as issued by the subcontract laboratory.

Please review the Chain-of-Custody (COC) and Sample Receipt Checklist (SRC) for any issues regarding sample receipt temperature, containers, preservation etc. To best understand your test results, review the entire report summarizing your sample data and the associated quality control batch data.

All reported data in this analytical report were analyzed according to the referenced method(s) and are in compliance with the latest NELAC/TNI standards, unless otherwise noted. Samples or analytical quality control parameters not meeting specific QC criteria are qualified with a data flag. Data flag definitions are located in the Notes and Definitions section of this analytical report.

If you have any questions concerning this report, please feel free to contact Envirotech, Inc.

Respectfully,

Walter Hinchman
Laboratory Director
Office: 505-632-1881
Cell: 775-287-1762
whinchman@envirotech-inc.com

Raina Schwanz
Laboratory Administrator
Office: 505-632-1881
rainaschwanz@envirotech-inc.com

Field Offices:

Southern New Mexico Area

Lynn Jarboe
Laboratory Technical Representative
Office: 505-421-LABS(5227)
Cell: 505-320-4759
ljjarboe@envirotech-inc.com

Michelle Gonzales
Client Representative
Office: 505-421-LABS(5227)
Cell: 505-947-8222
mgonzales@envirotech-inc.com

Envirotech Web Address: www.envirotech-inc.com

Table of Contents

Title Page	1
Cover Page	2
Table of Contents	3
Sample Summary	4
Sample Data	5
BH17 0.5'	5
BH17 1'	6
BH17 2'	7
BH18 0.5'	8
BH18 1'	9
BH18 2'	10
QC Summary Data	11
QC - Volatile Organics by EPA 8021B	11
QC - Nonhalogenated Organics by EPA 8015D - GRO	12
QC - Nonhalogenated Organics by EPA 8015D - DRO/ORO	13
QC - Anions by EPA 300.0/9056A	14
Definitions and Notes	15
Chain of Custody etc.	16

Sample Summary

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/25 17:09
--	--	------------------------------------

Client Sample ID	Lab Sample ID	Matrix	Sampled	Received	Container
BH17 0.5'	E512152-01A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
BH17 1'	E512152-02A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
BH17 2'	E512152-03A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
BH18 0.5'	E512152-04A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
BH18 1'	E512152-05A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
BH18 2'	E512152-06A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	--

BH17 0.5'

E512152-01

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg	Analyst: BA		Batch: 2551067	
Benzene	ND	0.0250	1	12/17/25	12/18/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/18/25	
Toluene	ND	0.0250	1	12/17/25	12/18/25	
o-Xylene	ND	0.0250	1	12/17/25	12/18/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/18/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/18/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		111 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg	Analyst: BA		Batch: 2551067	
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/18/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		87.7 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg	Analyst: HM		Batch: 2551091	
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		110 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg	Analyst: TP		Batch: 2551073	
Chloride	331	40.0	2	12/17/25	12/19/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	--

BH17 1'

E512152-02

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Benzene	ND	0.0250	1	12/17/25	12/18/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/18/25	
Toluene	ND	0.0250	1	12/17/25	12/18/25	
o-Xylene	ND	0.0250	1	12/17/25	12/18/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/18/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/18/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		110 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/18/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		87.3 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: HM		Batch: 2551091
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		94.6 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2551073
Chloride	213	20.0	1	12/17/25	12/19/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	--

BH17 2'

E512152-03

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Benzene	ND	0.0250	1	12/17/25	12/18/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/18/25	
Toluene	ND	0.0250	1	12/17/25	12/18/25	
o-Xylene	ND	0.0250	1	12/17/25	12/18/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/18/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/18/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		109 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/18/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		87.4 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: HM		Batch: 2551091
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		94.4 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2551073
Chloride	59.9	20.0	1	12/17/25	12/19/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	--

BH18 0.5'

E512152-04

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Benzene	ND	0.0250	1	12/17/25	12/18/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/18/25	
Toluene	ND	0.0250	1	12/17/25	12/18/25	
o-Xylene	ND	0.0250	1	12/17/25	12/18/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/18/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/18/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		109 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/18/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		88.4 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: HM		Batch: 2551091
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		95.8 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2551073
Chloride	473	40.0	2	12/17/25	12/19/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	--

BH18 1'

E512152-05

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Benzene	ND	0.0250	1	12/17/25	12/18/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/18/25	
Toluene	ND	0.0250	1	12/17/25	12/18/25	
o-Xylene	ND	0.0250	1	12/17/25	12/18/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/18/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/18/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		110 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/18/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		87.8 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: HM		Batch: 2551091
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		92.4 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2551073
Chloride	99.8	20.0	1	12/17/25	12/19/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	--

BH18 2'

E512152-06

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Benzene	ND	0.0250	1	12/17/25	12/18/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/18/25	
Toluene	ND	0.0250	1	12/17/25	12/18/25	
o-Xylene	ND	0.0250	1	12/17/25	12/18/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/18/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/18/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		110 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551067
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/18/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		88.5 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: HM		Batch: 2551091
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		110 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: TP		Batch: 2551073
Chloride	59.7	20.0	1	12/17/25	12/19/25	



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	-----------------------------------

Volatile Organics by EPA 8021B

Analyst: BA

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2551067-BLK1)

Prepared: 12/17/25 Analyzed: 12/18/25

Benzene	ND	0.0250							
Ethylbenzene	ND	0.0250							
Toluene	ND	0.0250							
o-Xylene	ND	0.0250							
p,m-Xylene	ND	0.0500							
Total Xylenes	ND	0.0250							
Surrogate: 4-Bromochlorobenzene-PID	8.79		8.00		110	70-130			

LCS (2551067-BS1)

Prepared: 12/17/25 Analyzed: 12/18/25

Benzene	5.35	0.0250	5.00		107	70-130			
Ethylbenzene	5.20	0.0250	5.00		104	70-130			
Toluene	5.29	0.0250	5.00		106	70-130			
o-Xylene	5.33	0.0250	5.00		107	70-130			
p,m-Xylene	10.6	0.0500	10.0		106	70-130			
Total Xylenes	15.9	0.0250	15.0		106	70-130			
Surrogate: 4-Bromochlorobenzene-PID	8.89		8.00		111	70-130			

Matrix Spike (2551067-MS1)

Source: E512149-02

Prepared: 12/17/25 Analyzed: 12/18/25

Benzene	4.75	0.0250	5.00	ND	95.0	70-130			
Ethylbenzene	4.60	0.0250	5.00	ND	92.0	70-130			
Toluene	4.69	0.0250	5.00	ND	93.8	70-130			
o-Xylene	4.71	0.0250	5.00	ND	94.3	70-130			
p,m-Xylene	9.41	0.0500	10.0	ND	94.1	70-130			
Total Xylenes	14.1	0.0250	15.0	ND	94.2	70-130			
Surrogate: 4-Bromochlorobenzene-PID	9.00		8.00		113	70-130			

Matrix Spike Dup (2551067-MSD1)

Source: E512149-02

Prepared: 12/17/25 Analyzed: 12/18/25

Benzene	5.31	0.0250	5.00	ND	106	70-130	11.2	27	
Ethylbenzene	5.17	0.0250	5.00	ND	103	70-130	11.6	26	
Toluene	5.25	0.0250	5.00	ND	105	70-130	11.2	20	
o-Xylene	5.27	0.0250	5.00	ND	105	70-130	11.2	25	
p,m-Xylene	10.5	0.0500	10.0	ND	105	70-130	11.3	23	
Total Xylenes	15.8	0.0250	15.0	ND	105	70-130	11.3	26	
Surrogate: 4-Bromochlorobenzene-PID	8.78		8.00		110	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	--

Nonhalogenated Organics by EPA 8015D - GRO

Analyst: BA

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec % %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	---------------	--------------------	----------	-------------------	-------

Blank (2551067-BLK1)

Prepared: 12/17/25 Analyzed: 12/18/25

Gasoline Range Organics (C6-C10)	ND	20.0							
Surrogate: 1-Chloro-4-fluorobenzene-FID	6.94		8.00		86.7	70-130			

LCS (2551067-BS2)

Prepared: 12/17/25 Analyzed: 12/18/25

Gasoline Range Organics (C6-C10)	54.0	20.0	50.0		108	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.01		8.00		87.6	70-130			

Matrix Spike (2551067-MS2)

Source: E512149-02

Prepared: 12/17/25 Analyzed: 12/18/25

Gasoline Range Organics (C6-C10)	51.4	20.0	50.0	ND	103	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	6.95		8.00		86.9	70-130			

Matrix Spike Dup (2551067-MSD2)

Source: E512149-02

Prepared: 12/17/25 Analyzed: 12/18/25

Gasoline Range Organics (C6-C10)	54.2	20.0	50.0	ND	108	70-130	5.31	20	
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.02		8.00		87.8	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	--

Nonhalogenated Organics by EPA 8015D - DRO/ORO

Analyst: HM

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2551091-BLK1)

Prepared: 12/18/25 Analyzed: 12/18/25

Diesel Range Organics (C10-C28)	ND	25.0							
Oil Range Organics (C28-C36)	ND	50.0							
Surrogate: <i>n</i> -Nonane	45.7		50.0		91.4	61-141			

LCS (2551091-BS1)

Prepared: 12/18/25 Analyzed: 12/18/25

Diesel Range Organics (C10-C28)	223	25.0	250		89.1	66-144			
Surrogate: <i>n</i> -Nonane	45.3		50.0		90.7	61-141			

Matrix Spike (2551091-MS1)

Source: E512152-02

Prepared: 12/18/25 Analyzed: 12/18/25

Diesel Range Organics (C10-C28)	231	25.0	250	ND	92.3	56-156			
Surrogate: <i>n</i> -Nonane	46.7		50.0		93.4	61-141			

Matrix Spike Dup (2551091-MSD1)

Source: E512152-02

Prepared: 12/18/25 Analyzed: 12/18/25

Diesel Range Organics (C10-C28)	231	25.0	250	ND	92.4	56-156	0.103	20	
Surrogate: <i>n</i> -Nonane	46.5		50.0		93.0	61-141			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:09:37PM
--	--	--

Anions by EPA 300.0/9056A

Analyst: TP

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2551073-BLK1)

Prepared: 12/17/25 Analyzed: 12/19/25

Chloride ND 20.0

LCS (2551073-BS1)

Prepared: 12/17/25 Analyzed: 12/19/25

Chloride 261 20.0 250 104 90-110

Matrix Spike (2551073-MS1)

Source: E512143-23

Prepared: 12/17/25 Analyzed: 12/19/25

Chloride 282 200 250 ND 113 80-120

Matrix Spike Dup (2551073-MSD1)

Source: E512143-23

Prepared: 12/17/25 Analyzed: 12/19/25

Chloride 285 200 250 ND 114 80-120 1.14 20

QC Summary Report Comment:

Calculations are based off of the raw (non-rounded) data. However, for reporting purposes all QC data is rounded to three significant figures. Therefore, hand calculated values may differ slightly.



Definitions and Notes

Devon Energy - Carlsbad	Project Name:	FLAGLER 8 CTB 1	
333 W Sheridan Avenue	Project Number:	01058-0007	Reported:
Oklahoma City OK, 73102-5010	Project Manager:	Anna Byers	12/22/25 17:09

ND Analyte NOT DETECTED at or above the reporting limit

NR Not Reported

RPD Relative Percent Difference

DNI Did Not Ignite

DNR Did not react with the addition of acid or base.

Note (1): Methods marked with ** are non-accredited methods.

Note (2): Soil data is reported on an "as received" weight basis, unless reported otherwise.



Client Information				Invoice Information				Lab Use Only				TAT				State			
Client: Devon Energy Production Company, LP				Company: Devon Energy Production Co.				Lab WO#		Job Number		1D	2D	3D	Std	NM	CO	UT	TX
Project: Flagler 8 CTB 1				Address: 5315 Buena Vista Dr.				E512152		2058-0007						x			
Project Manager: Anna Byers				City, State, Zip: Carlsbad, NM, 88220															
Address: 13000 W County Rd 100				Phone: 575-885-7502															
City, State, Zip: Odessa, TX, 79765				Email: jim.raley@dvn.com															
Phone: 432-305-6415				Miscellaneous: WO: 21663733, 21686668; PN: 22781, 22931; IN: nAPP2521623297, nAPP2524723254															
Email: geo@etechnv.com																			
Sample Information										Analysis and Method						EPA Program			
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Depth	Lab Number	DRO/DRO by 8015	GRO/DRO by 8015	BTEX by 8021	VOC by 8260	Chloride 300.0	TEEQ 1005 - TX	RCRA 8 Metals	BGDOC - NM	BGDOC - TX	SDWA	CWA	RCRA	
12:51	12/15/25	S	1	BH17	0.5'	1								X					
13:05	12/15/25	S	1	BH17	1'	2								X					
14:47	12/15/25	S	1	BH17	2'	3								X					
16:45	12/15/25	S	1	BH18	0.5'	4								X					
17:00	12/15/25	S	1	BH18	1'	5								X					
17:03	12/15/25	S	1	BH18	2'	6								X					
Additional Instructions:																			
I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.																			
Sampled by: Savana Anderson																			
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: <input checked="" type="radio"/> Y / <input type="radio"/> N													
<i>Savana Anderson</i>	12/16/25	8:40	<i>Michelle Gonzales</i>	12-16-25	0840														
<i>Michelle Gonzales</i>	12-16-25	1500	<i>Marissa Gonzales</i>	12-16-25	1500														
<i>Marissa Gonzales</i>	12-16-25	1905	<i>Noe Soto</i>	12-16-25	1905														
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time														
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time														
Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other										Container Type: g - glass, p - poly/plastic, ag - amber glass, v - VOA									
Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.																			

Envirotech Analytical Laboratory

Printed: 12/17/2025 9:38:06AM

Sample Receipt Checklist (SRC)

Instructions: Please take note of any NO checkmarks.

If we receive no response concerning these items within 24 hours of the date of this notice, all the samples will be analyzed as requested.

Client: Devon Energy - Carlsbad	Date Received: 12/16/25 19:05	Work Order ID: E512152
Phone: (575) 748-0176	Date Logged In: 12/16/25 16:19	Logged In By: Caitlin Mars
Email: anna@etechnv.com	Due Date: 12/23/25 17:00 (4 day TAT)	

Chain of Custody (COC)

- 1. Does the sample ID match the COC? Yes
- 2. Does the number of samples per sampling site location match the COC? Yes
- 3. Were samples dropped off by client or carrier? Yes
- 4. Was the COC complete, i.e., signatures, dates/times, requested analyses? Yes
- 5. Were all samples received within holding time? Yes

Carrier: Courier

Note: Analysis, such as pH which should be conducted in the field, i.e, 15 minute hold time, are not included in this discussion.

Sample Turn Around Time (TAT)

- 6. Did the COC indicate standard TAT, or Expedited TAT? Yes

Sample Cooler

- 7. Was a sample cooler received? Yes
- 8. If yes, was cooler received in good condition? Yes
- 9. Was the sample(s) received intact, i.e., not broken? Yes
- 10. Were custody/security seals present? No
- 11. If yes, were custody/security seals intact? NA
- 12. Was the sample received on ice? Yes

Note: Thermal preservation is not required, if samples are received within 15 minutes of sampling

- 13. See COC for individual sample temps. Samples outside of 0°C-6°C will be recorded in comments.

Sample Container

- 14. Are aqueous VOC samples present? No
- 15. Are VOC samples collected in VOA Vials? NA
- 16. Is the head space less than 6-8 mm (pea sized or less)? NA
- 17. Was a trip blank (TB) included for VOC analyses? NA
- 18. Are non-VOC samples collected in the correct containers? Yes
- 19. Is the appropriate volume/weight or number of sample containers collected? Yes

Field Label

- 20. Were field sample labels filled out with the minimum information:
 - Sample ID? Yes
 - Date/Time Collected? Yes
 - Collectors name? Yes

Sample Preservation

- 21. Does the COC or field labels indicate the samples were preserved? No
- 22. Are sample(s) correctly preserved? NA
- 24. Is lab filtration required and/or requested for dissolved metals? No

Multiphase Sample Matrix

- 26. Does the sample have more than one phase, i.e., multiphase? No
- 27. If yes, does the COC specify which phase(s) is to be analyzed? NA

Subcontract Laboratory

- 28. Are samples required to get sent to a subcontract laboratory? No
- 29. Was a subcontract laboratory specified by the client and if so who? NA Subcontract Lab: NA

Comments/Resolution

L-CM
R-NV

Client Instruction

Signature of client authorizing changes to the COC or sample disposition.

Date



envirotech Inc.

Report to:
Anna Byers



envirotech

Practical Solutions for a Better Tomorrow

Analytical Report

Devon Energy - Carlsbad

Project Name: FLAGLER 8 CTB 1

Work Order: E512157

Job Number: 01058-0007

Received: 12/16/2025

Revision: 1

Report Reviewed By:

Walter Hinchman
Laboratory Director
12/22/25

5796 U.S. Hwy 64
Farmington, NM 87401

Phone: (505) 632-1881
Envirotech-inc.com



Envirotech Inc. certifies the test results meet all requirements of TNI unless noted otherwise.
Statement of Data Authenticity: Envirotech Inc, attests the data reported has not been altered in any way.
Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech Inc.
Envirotech Inc, holds the Utah TNI certification NM00979 for data reported.
Envirotech Inc, holds the Texas TNI certification T104704557 for data reported.



Date Reported: 12/22/25

Anna Byers
333 W Sheridan Avenue
Oklahoma City, OK 73102-5010

Project Name: FLAGLER 8 CTB 1
Workorder: E512157
Date Received: 12/16/2025 7:05:00PM

Anna Byers,

Thank you for choosing Envirotech, Inc. as your analytical testing laboratory for the sample(s) received on, 12/16/2025 7:05:00PM, under the Project Name: FLAGLER 8 CTB 1.

The analytical test results summarized in this report with the Project Name: FLAGLER 8 CTB 1 apply to the individual samples collected, identified and submitted bearing the project name on the enclosed chain-of-custody. Subcontracted sample analyses not conducted by Envirotech, Inc., are attached in full as issued by the subcontract laboratory.

Please review the Chain-of-Custody (COC) and Sample Receipt Checklist (SRC) for any issues regarding sample receipt temperature, containers, preservation etc. To best understand your test results, review the entire report summarizing your sample data and the associated quality control batch data.

All reported data in this analytical report were analyzed according to the referenced method(s) and are in compliance with the latest NELAC/TNI standards, unless otherwise noted. Samples or analytical quality control parameters not meeting specific QC criteria are qualified with a data flag. Data flag definitions are located in the Notes and Definitions section of this analytical report.

If you have any questions concerning this report, please feel free to contact Envirotech, Inc.

Respectfully,

Walter Hinchman
Laboratory Director
Office: 505-632-1881
Cell: 775-287-1762
whinchman@envirotech-inc.com

Raina Schwanz
Laboratory Administrator
Office: 505-632-1881
rainaschwanz@envirotech-inc.com

Field Offices:

Southern New Mexico Area

Lynn Jarboe
Laboratory Technical Representative
Office: 505-421-LABS(5227)
Cell: 505-320-4759
ljjarboe@envirotech-inc.com

Michelle Gonzales
Client Representative
Office: 505-421-LABS(5227)
Cell: 505-947-8222
mgonzales@envirotech-inc.com

Envirotech Web Address: www.envirotech-inc.com

Table of Contents

Title Page	1
Cover Page	2
Table of Contents	3
Sample Summary	4
Sample Data	5
FS01 0-0.25'	5
FS02 0-0.25'	6
FS03 0-0.25'	7
FS04 0-0.25'	8
FS05 0-0.25'	9
FS06 0-0.25'	10
FS07 0-0.25'	11
FS08 0-0.25'	12
FS09 0-0.25'	13
SW01 0-0.25'	14
SW02 0-0.25'	15
QC Summary Data	16
QC - Volatile Organics by EPA 8021B	16
QC - Nonhalogenated Organics by EPA 8015D - GRO	17
QC - Nonhalogenated Organics by EPA 8015D - DRO/ORO	18
QC - Anions by EPA 300.0/9056A	19
Definitions and Notes	20
Chain of Custody etc.	21

Sample Summary

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/25 17:12
--	--	------------------------------------

Client Sample ID	Lab Sample ID	Matrix	Sampled	Received	Container
FS01 0-0.25'	E512157-01A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
FS02 0-0.25'	E512157-02A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
FS03 0-0.25'	E512157-03A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
FS04 0-0.25'	E512157-04A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
FS05 0-0.25'	E512157-05A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
FS06 0-0.25'	E512157-06A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
FS07 0-0.25'	E512157-07A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
FS08 0-0.25'	E512157-08A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
FS09 0-0.25'	E512157-09A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
SW01 0-0.25'	E512157-10A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.
SW02 0-0.25'	E512157-11A	Soil	12/15/25	12/16/25	Glass Jar, 2 oz.

Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

FS01 0-0.25'

E512157-01

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B		mg/kg	mg/kg	Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/17/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/17/25	
Toluene	ND	0.0250	1	12/17/25	12/17/25	
o-Xylene	ND	0.0250	1	12/17/25	12/17/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/17/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/17/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		112 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - GRO		mg/kg	mg/kg	Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/17/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		85.7 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO		mg/kg	mg/kg	Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		111 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A		mg/kg	mg/kg	Analyst: DT		Batch: 2551123
Chloride	18300	400	20	12/19/25	12/20/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

FS02 0-0.25'

E512157-02

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/17/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/17/25	
Toluene	ND	0.0250	1	12/17/25	12/17/25	
o-Xylene	ND	0.0250	1	12/17/25	12/17/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/17/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/17/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		111 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/17/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		86.6 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		99.7 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	26500	1000	50	12/19/25	12/19/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

FS03 0-0.25'

E512157-03

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/17/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/17/25	
Toluene	ND	0.0250	1	12/17/25	12/17/25	
o-Xylene	ND	0.0250	1	12/17/25	12/17/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/17/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/17/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		113 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/17/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		85.5 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		98.1 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	45200	2000	100	12/19/25	12/20/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

FS04 0-0.25'

E512157-04

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/17/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/17/25	
Toluene	ND	0.0250	1	12/17/25	12/17/25	
o-Xylene	ND	0.0250	1	12/17/25	12/17/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/17/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/17/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		113 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/17/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		86.0 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		99.5 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	20300	1000	50	12/19/25	12/20/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

FS05 0-0.25'

E512157-05

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/17/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/17/25	
Toluene	ND	0.0250	1	12/17/25	12/17/25	
o-Xylene	ND	0.0250	1	12/17/25	12/17/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/17/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/17/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		112 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/17/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		85.6 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		101 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	11200	200	10	12/19/25	12/20/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

FS06 0-0.25'

E512157-06

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/17/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/17/25	
Toluene	ND	0.0250	1	12/17/25	12/17/25	
o-Xylene	ND	0.0250	1	12/17/25	12/17/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/17/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/17/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		112 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/17/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		84.6 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	31.8	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		101 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	3850	100	5	12/19/25	12/20/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

FS07 0-0.25'

E512157-07

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/17/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/17/25	
Toluene	ND	0.0250	1	12/17/25	12/17/25	
o-Xylene	ND	0.0250	1	12/17/25	12/17/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/17/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/17/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		112 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/17/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		86.0 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	25.6	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		101 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	39700	2000	100	12/19/25	12/20/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

FS08 0-0.25'

E512157-08

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/17/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/17/25	
Toluene	ND	0.0250	1	12/17/25	12/17/25	
o-Xylene	ND	0.0250	1	12/17/25	12/17/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/17/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/17/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		111 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/17/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		85.1 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	81.6	25.0	1	12/18/25	12/18/25	
Oil Range Organics (C28-C36)	64.5	50.0	1	12/18/25	12/18/25	
<i>Surrogate: n-Nonane</i>		99.7 %	61-141	12/18/25	12/18/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	16600	400	20	12/19/25	12/20/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

FS09 0-0.25'

E512157-09

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/17/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/17/25	
Toluene	ND	0.0250	1	12/17/25	12/17/25	
o-Xylene	ND	0.0250	1	12/17/25	12/17/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/17/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/17/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		111 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/17/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		89.0 %	70-130	12/17/25	12/17/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/19/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/19/25	
<i>Surrogate: n-Nonane</i>		101 %	61-141	12/18/25	12/19/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	18300	400	20	12/19/25	12/20/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

SW01 0-0.25'

E512157-10

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/18/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/18/25	
Toluene	ND	0.0250	1	12/17/25	12/18/25	
o-Xylene	ND	0.0250	1	12/17/25	12/18/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/18/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/18/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		112 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - GRO	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/18/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		88.8 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/19/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/19/25	
<i>Surrogate: n-Nonane</i>		100 %	61-141	12/18/25	12/19/25	
Anions by EPA 300.0/9056A	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	244	100	5	12/19/25	12/20/25	



Sample Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

SW02 0-0.25'

E512157-11

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organics by EPA 8021B						
	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Benzene	ND	0.0250	1	12/17/25	12/18/25	
Ethylbenzene	ND	0.0250	1	12/17/25	12/18/25	
Toluene	ND	0.0250	1	12/17/25	12/18/25	
o-Xylene	ND	0.0250	1	12/17/25	12/18/25	
p,m-Xylene	ND	0.0500	1	12/17/25	12/18/25	
Total Xylenes	ND	0.0250	1	12/17/25	12/18/25	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>						
		110 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - GRO						
	mg/kg	mg/kg		Analyst: BA		Batch: 2551080
Gasoline Range Organics (C6-C10)	ND	20.0	1	12/17/25	12/18/25	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>						
		86.7 %	70-130	12/17/25	12/18/25	
Nonhalogenated Organics by EPA 8015D - DRO/ORO						
	mg/kg	mg/kg		Analyst: KH		Batch: 2551111
Diesel Range Organics (C10-C28)	ND	25.0	1	12/18/25	12/19/25	
Oil Range Organics (C28-C36)	ND	50.0	1	12/18/25	12/19/25	
<i>Surrogate: n-Nonane</i>						
		102 %	61-141	12/18/25	12/19/25	
Anions by EPA 300.0/9056A						
	mg/kg	mg/kg		Analyst: DT		Batch: 2551123
Chloride	145	20.0	1	12/19/25	12/20/25	



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	-----------------------------------

Volatile Organics by EPA 8021B

Analyst: BA

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2551080-BLK1)

Prepared: 12/17/25 Analyzed: 12/17/25

Benzene	ND	0.0250							
Ethylbenzene	ND	0.0250							
Toluene	ND	0.0250							
o-Xylene	ND	0.0250							
p,m-Xylene	ND	0.0500							
Total Xylenes	ND	0.0250							
Surrogate: 4-Bromochlorobenzene-PID	8.73		8.00		109	70-130			

LCS (2551080-BS1)

Prepared: 12/17/25 Analyzed: 12/17/25

Benzene	5.11	0.0250	5.00		102	70-130			
Ethylbenzene	4.98	0.0250	5.00		99.6	70-130			
Toluene	5.06	0.0250	5.00		101	70-130			
o-Xylene	5.09	0.0250	5.00		102	70-130			
p,m-Xylene	10.2	0.0500	10.0		102	70-130			
Total Xylenes	15.3	0.0250	15.0		102	70-130			
Surrogate: 4-Bromochlorobenzene-PID	8.61		8.00		108	70-130			

Matrix Spike (2551080-MS1)

Source: E512157-02

Prepared: 12/17/25 Analyzed: 12/17/25

Benzene	5.24	0.0250	5.00	ND	105	70-130			
Ethylbenzene	5.10	0.0250	5.00	ND	102	70-130			
Toluene	5.18	0.0250	5.00	ND	104	70-130			
o-Xylene	5.23	0.0250	5.00	ND	105	70-130			
p,m-Xylene	10.4	0.0500	10.0	ND	104	70-130			
Total Xylenes	15.7	0.0250	15.0	ND	104	70-130			
Surrogate: 4-Bromochlorobenzene-PID	8.87		8.00		111	70-130			

Matrix Spike Dup (2551080-MSD1)

Source: E512157-02

Prepared: 12/17/25 Analyzed: 12/17/25

Benzene	5.23	0.0250	5.00	ND	105	70-130	0.239	27	
Ethylbenzene	5.11	0.0250	5.00	ND	102	70-130	0.319	26	
Toluene	5.19	0.0250	5.00	ND	104	70-130	0.0849	20	
o-Xylene	5.26	0.0250	5.00	ND	105	70-130	0.441	25	
p,m-Xylene	10.5	0.0500	10.0	ND	105	70-130	0.483	23	
Total Xylenes	15.7	0.0250	15.0	ND	105	70-130	0.469	26	
Surrogate: 4-Bromochlorobenzene-PID	9.01		8.00		113	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

Nonhalogenated Organics by EPA 8015D - GRO

Analyst: BA

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2551080-BLK1)

Prepared: 12/17/25 Analyzed: 12/17/25

Gasoline Range Organics (C6-C10)	ND	20.0							
Surrogate: 1-Chloro-4-fluorobenzene-FID	6.86		8.00		85.8	70-130			

LCS (2551080-BS2)

Prepared: 12/17/25 Analyzed: 12/17/25

Gasoline Range Organics (C6-C10)	56.2	20.0	50.0		112	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.00		8.00		87.4	70-130			

Matrix Spike (2551080-MS2)

Source: E512157-02

Prepared: 12/17/25 Analyzed: 12/17/25

Gasoline Range Organics (C6-C10)	63.7	20.0	50.0	ND	127	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	7.06		8.00		88.3	70-130			

Matrix Spike Dup (2551080-MSD2)

Source: E512157-02

Prepared: 12/17/25 Analyzed: 12/17/25

Gasoline Range Organics (C6-C10)	53.9	20.0	50.0	ND	108	70-130	16.7	20	
Surrogate: 1-Chloro-4-fluorobenzene-FID	6.95		8.00		86.9	70-130			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

Nonhalogenated Organics by EPA 8015D - DRO/ORO

Analyst: KH

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2551111-BLK1)

Prepared: 12/18/25 Analyzed: 12/18/25

Diesel Range Organics (C10-C28)	ND	25.0							
Oil Range Organics (C28-C36)	ND	50.0							
Surrogate: <i>n</i> -Nonane	50.1		50.0		100	61-141			

LCS (2551111-BS1)

Prepared: 12/18/25 Analyzed: 12/18/25

Diesel Range Organics (C10-C28)	279	25.0	250		112	66-144			
Surrogate: <i>n</i> -Nonane	51.2		50.0		102	61-141			

Matrix Spike (2551111-MS1)

Source: E512157-06

Prepared: 12/18/25 Analyzed: 12/18/25

Diesel Range Organics (C10-C28)	301	25.0	250	31.8	108	56-156			
Surrogate: <i>n</i> -Nonane	50.8		50.0		102	61-141			

Matrix Spike Dup (2551111-MSD1)

Source: E512157-06

Prepared: 12/18/25 Analyzed: 12/18/25

Diesel Range Organics (C10-C28)	319	25.0	250	31.8	115	56-156	5.95	20	
Surrogate: <i>n</i> -Nonane	53.9		50.0		108	61-141			



QC Summary Data

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/2025 5:12:16PM
--	--	--

Anions by EPA 300.0/9056A

Analyst: DT

Analyte	Result mg/kg	Reporting Limit mg/kg	Spike Level mg/kg	Source Result mg/kg	Rec %	Rec Limits %	RPD %	RPD Limit %	Notes
---------	-----------------	-----------------------------	-------------------------	---------------------------	----------	--------------------	----------	-------------------	-------

Blank (2551123-BLK1)

Prepared: 12/19/25 Analyzed: 12/19/25

Chloride ND 20.0

LCS (2551123-BS1)

Prepared: 12/19/25 Analyzed: 12/19/25

Chloride 259 20.0 250 104 90-110

Matrix Spike (2551123-MS1)

Source: E512157-02

Prepared: 12/19/25 Analyzed: 12/20/25

Chloride 26800 1000 250 26500 85.1 80-120

Matrix Spike Dup (2551123-MSD1)

Source: E512157-02

Prepared: 12/19/25 Analyzed: 12/20/25

Chloride 26300 1000 250 26500 NR 80-120 1.81 20 M4

QC Summary Report Comment:

Calculations are based off of the raw (non-rounded) data. However, for reporting purposes all QC data is rounded to three significant figures. Therefore, hand calculated values may differ slightly.



Definitions and Notes

Devon Energy - Carlsbad 333 W Sheridan Avenue Oklahoma City OK, 73102-5010	Project Name: FLAGLER 8 CTB 1 Project Number: 01058-0007 Project Manager: Anna Byers	Reported: 12/22/25 17:12
--	--	------------------------------------

M4 Matrix spike recovery value is suspect since the analyte concentration in the sample is disproportionate to the spike level. The associated LCS spike recovery was acceptable.

ND Analyte NOT DETECTED at or above the reporting limit

NR Not Reported

RPD Relative Percent Difference

DNI Did Not Ignite

DNR Did not react with the addition of acid or base.

Note (1): Methods marked with ** are non-accredited methods.

Note (2): Soil data is reported on an "as received" weight basis, unless reported otherwise.



Client Information				Invoice Information				Lab Use Only				TAT				State			
Client: Devon Energy Production Company, LP				Company: Devon Energy Production Co.				Lab WO#		Job Number		1D	2D	3D	Std	NM	CO	UT	TX
Project: Flagler 8 CTB 1				Address: 5315 Buena Vista Dr.				E512157		01058-000						x			
Project Manager: Anna Byers				City, State, Zip: Carlsbad, NM, 88220															
Address: 13000 W County Rd 100				Phone: 575-885-7502															
City, State, Zip: Odessa, TX, 79765				Email: jim.raley@dvn.com															
Phone: 432-305-6415				Miscellaneous: WO: 21663733, 21686668; PN: 22781, 22931; IN: nAPP2521623297, nAPP2524723254															
Email: geo@etechnv.com																			

Sample Information										Analysis and Method								EPA Program		
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Depth	Lab Number	DRO/ORO by 8015	GRO/DRO by 8015	BTEX by 8021	VOC by 8260	Chloride 300.0	TEEQ 1005 - TX	RCRA 8 Metals	BGDOC - NM	BGDOC - TX	SDWA	CWA	RCRA		
13:26	12/15/25	S	1	FS01	0-0.25'	1								X						
13:29	12/15/25	S	1	FS02	0-0.25'	2								X						
13:32	12/15/25	S	1	FS03	0-0.25'	3								X						
13:36	12/15/25	S	1	FS04	0-0.25'	4								X						
13:39	12/15/25	S	1	FS05	0-0.25'	5								X						
13:42	12/15/25	S	1	FS06	0-0.25'	6								X						
13:48	12/15/25	S	1	FS07	0-0.25'	7								X						
13:51	12/15/25	S	1	FS08	0-0.25'	8								X						
13:54	12/15/25	S	1	FS09	0-0.25'	9								X						
16:20	12/15/25	S	1	SW01	0-0.25'	10								X						

Additional Instructions:

I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.

Relinquished by: (Signature) <i>[Signature]</i> Date: 12/16/25 Time: 8:40						Received by: (Signature) <i>Michelle Gonzales</i> Date: 12-16-25 Time: 0840						Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: <input checked="" type="radio"/> Y <input type="radio"/> N
Relinquished by: (Signature) <i>Michelle Gonzales</i> Date: 12-16-25 Time: 1500						Received by: (Signature) <i>Marissa Gonzales</i> Date: 12-16-25 Time: 1500						
Relinquished by: (Signature) <i>Marissa Gonzales</i> Date: 12-16-25 Time: 1905						Received by: (Signature) <i>Nbe Sato</i> Date: 12-16-25 Time: 1905						
Relinquished by: (Signature)						Received by: (Signature)						
Relinquished by: (Signature)						Received by: (Signature)						

Sample Matrix: S - Soil, **sd** - Solid, **sg** - Sludge, A - Aqueous, O - Other _____ Container Type: **g** - glass, **p** - poly/plastic, **ag** - amber glass, v - VOA

Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.



Chain of Custody

Client Information				Invoice Information				Lab Use Only				TAT				State			
Client: Devon Energy Production Company, LP Project: Flagler 8 CTB 1 Project Manager: Anna Byers Address: 13000 W County Rd 100 City, State, Zip: Odessa, TX, 79765 Phone: 432-305-6415 Email: geo@etechnv.com				Company: Devon Energy Production Co. Address: 5315 Buena Vista Dr. City, State, Zip: Carlsbad, NM, 88220 Phone: 575-885-7502 Email: jim.raley@dvn.com Miscellaneous: WO: 21663733, 21686668; PN: 22781, 22931; IN: nAPP2521623297, nAPP2524723254				Lab WO# EB212157 Job Number 01058-0007				1D <input type="checkbox"/> 2D <input type="checkbox"/> 3D <input type="checkbox"/> Std <input checked="" type="checkbox"/>				NM <input type="checkbox"/> CO <input type="checkbox"/> UT <input type="checkbox"/> TX <input checked="" type="checkbox"/>			
Sample Information																			
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Depth	Lab Number	DR/ORO by 8015	GRO/DRO by 8015	BTEX by 8021	VOC by 8260	Chloride 300.0	TEC 1005 - TX	RCRA 8 Metals	BGDOC - NM	BGDOC - TX	Sample Temp	Remarks		
16:25	12/15/25	S	1	SW02	0-0.25'	11								X		3.4			
Additional Instructions:																			
I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.																			
Sampled by: Savana Anderson																			
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time		
<i>Savana Anderson</i>	12/14/25	8:40	<i>Michelle Gonzales</i>	12-16-25	0840	<i>Michelle Gonzales</i>	12-16-25	1500	<i>Marissa Gonzales</i>	12-16-25	1500	<i>Noe Soto</i>	12-16-25	1905	<i>Noe Soto</i>	12-16-25	1905		
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time		
<i>Michelle Gonzales</i>	12-16-25	1500	<i>Marissa Gonzales</i>	12-16-25	1500	<i>Noe Soto</i>	12-16-25	1905											
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time		
<i>Marissa Gonzales</i>	12-16-25	1905																	
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time		
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Received by: (Signature)	Date	Time		
Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N																			
Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.																			

SA

Envirotech Analytical Laboratory

Printed: 12/17/2025 9:49:37AM

Sample Receipt Checklist (SRC)

Instructions: Please take note of any NO checkmarks.

If we receive no response concerning these items within 24 hours of the date of this notice, all the samples will be analyzed as requested.

Client: Devon Energy - Carlsbad Date Received: 12/16/25 19:05 Work Order ID: E512157
Phone: (575) 748-0176 Date Logged In: 12/16/25 16:44 Logged In By: Caitlin Mars
Email: anna@etechnv.com Due Date: 12/23/25 17:00 (4 day TAT)

Chain of Custody (COC)

- 1. Does the sample ID match the COC? Yes
2. Does the number of samples per sampling site location match the COC? Yes
3. Were samples dropped off by client or carrier? Yes
4. Was the COC complete, i.e., signatures, dates/times, requested analyses? Yes
5. Were all samples received within holding time? Yes

Carrier: Courier

Note: Analysis, such as pH which should be conducted in the field, i.e, 15 minute hold time, are not included in this discussion.

Sample Turn Around Time (TAT)

- 6. Did the COC indicate standard TAT, or Expedited TAT? Yes

Sample Cooler

- 7. Was a sample cooler received? Yes
8. If yes, was cooler received in good condition? Yes
9. Was the sample(s) received intact, i.e., not broken? Yes
10. Were custody/security seals present? No
11. If yes, were custody/security seals intact? NA
12. Was the sample received on ice? Yes

Note: Thermal preservation is not required, if samples are received within 15 minutes of sampling

- 13. See COC for individual sample temps. Samples outside of 0°C-6°C will be recorded in comments.

Sample Container

- 14. Are aqueous VOC samples present? No
15. Are VOC samples collected in VOA Vials? NA
16. Is the head space less than 6-8 mm (pea sized or less)? NA
17. Was a trip blank (TB) included for VOC analyses? NA
18. Are non-VOC samples collected in the correct containers? Yes
19. Is the appropriate volume/weight or number of sample containers collected? Yes

Field Label

- 20. Were field sample labels filled out with the minimum information:
Sample ID? Yes
Date/Time Collected? Yes
Collectors name? Yes

Sample Preservation

- 21. Does the COC or field labels indicate the samples were preserved? No
22. Are sample(s) correctly preserved? NA
24. Is lab filtration required and/or requested for dissolved metals? No

Multiphase Sample Matrix

- 26. Does the sample have more than one phase, i.e., multiphase? No
27. If yes, does the COC specify which phase(s) is to be analyzed? NA

Subcontract Laboratory

- 28. Are samples required to get sent to a subcontract laboratory? No
29. Was a subcontract laboratory specified by the client and if so who? NA Subcontract Lab: NA

Client Instruction

Empty box for client instruction.

Comments/Resolution

Comments/Resolution box containing L-CM and R-NV.

Signature of client authorizing changes to the COC or sample disposition.

Date



envirotech Inc.

APPENDIX G

Correspondence & Notifications

P.O. Box 62228 Midland • TX • 79711 • Tel: 432-563-2200 • Fax: 432-563-2213



Ethan Jaso

From: Velez, Nelson, EMNRD <Nelson.Velez@emnrd.nm.gov>
Sent: Monday, December 1, 2025 10:03 AM
To: Erick Herrera
Cc: Raley, Jim; geo
Subject: Re: [EXTERNAL] Sampling Variance Request - Flagler 8 CTB Incident Numbers nAPP2521623297 and naPP2524723254

Good morning Erick,

Thanks for the inquiry. My apology for not looking at the attachment you provide last week.

Your alternative sampling plan request not to exceed 400 square feet (ft.²) from the excavation floor and 200 ft.² from the excavation sidewalls for each five (5) point composite per 19.15.29.12D (1b) NMAC is approved. All other provisions addressed in 19.15.29.12D NMAC remain in effect.

Please keep a copy of this communication for inclusion within the appropriate report submittal.

Have a safe and productive day!

Regards,

Nelson Velez • Senior Environmental Scientist
Environmental Bureau | EMNRD - Oil Conservation Division
1000 Rio Brazos Road | Aztec, NM 87410
(505) 469-6146 | nelson.velez@emnrd.nm.gov
<http://www.emnrd.nm.gov/ocd>



From: Erick Herrera <erick@etechnv.com>
Sent: Wednesday, November 19, 2025 12:19 PM
To: Velez, Nelson, EMNRD <Nelson.Velez@emnrd.nm.gov>
Cc: Raley, Jim <jim.ralej@dvn.com>; geo <geo@etechnv.com>
Subject: [EXTERNAL] Sampling Variance Request - Flagler 8 CTB Incident Numbers nAPP2521623297 and naPP2524723254

CAUTION: This email originated outside of our organization. Exercise caution prior to clicking on links or opening attachments.

Good afternoon Nelson,

On behalf of Devon Energy Production Co., LP (Devon), please find the attached Sampling Variance Request (SVR) for a

decreased sampling frequency at the Flagler 8 CTB 1 (Site) for Incident Numbers (nAPP2521623297 & nAPP2524723254) for your review. Due to the large areas of concern (AOCs) totaling approximately 3,539 square feet and the presence of critical surface production equipment within the AOCs, Devon Energy requests a sampling variance for 5-point composite confirmation soil samples, with a maximum of 400 square feet per soil sample collected from the AOCs. As such, 9 confirmation soil samples are anticipated to be collected, compared to the 18 soil samples utilizing a sampling frequency of 200 square feet. Lateral/edge confirmation soil samples will still be collected at a sampling frequency representing no more than 200 square feet per soil sample. Confirmation soil samples will be submitted to an accredited laboratory for analysis of BTEX (Method EPA 8260B), TPH (Method EPA 8015D), and chloride (Method EPA 300.0).

Please let me know if you have any questions or require any additional information.

Thank you,



Erick Herrera
Lead Project Geologist/GIS Manager
Etech Environmental & Safety Solutions, Inc.
W: (432) 305-6416
C: (281) 777-4152

Ethan Jaso

From: Velez, Nelson, EMNRD <Nelson.Velez@emnrd.nm.gov>
Sent: Monday, November 3, 2025 2:19 PM
To: Erick Herrera
Cc: Raley, Jim; geo; Bratcher, Michael, EMNRD; Wells, Shelly, EMNRD
Subject: Re: [EXTERNAL] Devon Energy Extension Request - Flagler 8 CTB 1 (nAPP2521623297)

Some people who received this message don't often get email from nelson.velez@emnrd.nm.gov. [Learn why this is important](#)

Good afternoon Erick,

Thank you for the correspondence.

Your 90-day time extension request is approved. Remediation Due date updated to January 29, 2026.

Please keep a copy of this communication for inclusion within the appropriate report submittal.

The OCD requires a copy of all correspondence related to remedial activities to be included in all proposals and/or final closure reports. Correspondence required to be included in reports may include, but not limited to, notifications for liner inspections, sample events, request for time extensions, an alternative sampling plan, and/or variances.

Regards,

Nelson Velez • Senior Environmental Scientist
Environmental Bureau | EMNRD - Oil Conservation Division
1000 Rio Brazos Road | Aztec, NM 87410
(505) 469-6146 | nelson.velez@emnrd.nm.gov
<http://www.emnrd.nm.gov/oed>



From: Wells, Shelly, EMNRD <Shelly.Wells@emnrd.nm.gov>
Sent: Friday, October 31, 2025 2:11 PM
To: Velez, Nelson, EMNRD <Nelson.Velez@emnrd.nm.gov>
Cc: Bratcher, Michael, EMNRD <mike.bratcher@emnrd.nm.gov>
Subject: FW: [EXTERNAL] Devon Energy Extension Request - Flagler 8 CTB 1 (nAPP2521623297)

From: Erick Herrera <erick@etechenv.com>
Sent: Friday, October 31, 2025 11:41 AM
To: Enviro, OCD, EMNRD <OCD.Enviro@emnrn.nm.gov>; ocdonline, emnrd, EMNRD <emnrn.ocdonline@emnrn.nm.gov>
Cc: Raley, Jim <jim.raley@dmn.com>; geo <geo@etechenv.com>
Subject: [EXTERNAL] Devon Energy Extension Request - Flagler 8 CTB 1 (nAPP2521623297)

CAUTION: This email originated outside of our organization. Exercise caution prior to clicking on links or opening attachments.

Good morning,

On behalf of Devon Energy Production Co., LP (Devon), Etech Environmental & Safety Solutions, Inc. (Etech) respectfully asks for a 90-day extension request for a report currently due on October 31st, 2025, associated with Incident Number nAPP2521623297 at the Flagler 8 CTB 1 (Site). The release extent associated with Incident Number nAPP2521623297 overlaps a portion of a more recent incident, Incident Number nAPP2524723254. Delineation activities addressing both incidents have been completed, but additional soil sampling is warranted to develop a comprehensive remediation plan for both releases.

In order to provide enough time to conduct additional soil sampling activities, review laboratory analytical results, and prepare a complete corrective action report, Devon requests a 90-day extension of the current October 31st, 2025, deadline to April 29th, 2026, for Incident Number nAPP2521623297.

Thank you,



Erick Herrera
Lead Project Geologist/GIS Manager
Etech Environmental & Safety Solutions, Inc.
W: (432) 305-6416
C: (281) 777-4152

Anna Byers

From: Velez, Nelson, EMNRD <Nelson.Velez@emnrd.nm.gov>
Sent: Monday, December 1, 2025 1:07 PM
To: Anna Byers
Cc: Raley, Jim; geo; Bratcher, Michael, EMNRD; Wells, Shelly, EMNRD
Subject: Re: [EXTERNAL] Devon Energy Extension Request - Flagler 8 CTB 1 (nAPP2524723254)

Good afternoon Anna,

Thank you for the correspondence.

Your 90-day time extension request is approved. Remediation Due date has been updated to March 2, 2026.

Please keep a copy of this communication for inclusion within the appropriate report submittal.

The OCD requires a copy of all correspondence related to remedial activities to be included in all proposals and/or final closure reports. Correspondence required to be included in reports may include, but not limited to, notifications for liner inspections, sample events, request for time extensions, an alternative sampling plan, and/or variances.

Regards,

Nelson Velez • Senior Environmental Scientist
Environmental Bureau | EMNRD - Oil Conservation Division
1000 Rio Brazos Road | Aztec, NM 87410
(505) 469-6146 | nelson.velez@emnrd.nm.gov
<http://www.emnrd.nm.gov/ocd>



From: Wells, Shelly, EMNRD <Shelly.Wells@emnrd.nm.gov>
Sent: Monday, December 1, 2025 11:51 AM
To: Velez, Nelson, EMNRD <Nelson.Velez@emnrd.nm.gov>
Cc: Bratcher, Michael, EMNRD <mike.bratcher@emnrd.nm.gov>
Subject: FW: [EXTERNAL] Devon Energy Extension Request - Flagler 8 CTB 1 (nAPP2524723254)

From: Anna Byers <anna@etechenv.com>
Sent: Monday, December 1, 2025 11:50 AM

To: Enviro, OCD, EMNRD <OCD.Enviro@emnrd.nm.gov>; ocdonline, emnrd, EMNRD <emnrd.ocdonline@emnrd.nm.gov>

Cc: Jim.Raley@dmv.com; geo <geo@etechenv.com>

Subject: [EXTERNAL] Devon Energy Extension Request - Flagler 8 CTB 1 (nAPP2524723254)

CAUTION: This email originated outside of our organization. Exercise caution prior to clicking on links or opening attachments.

Good morning,

Etech Environmental & Safety Solutions, Inc. (Etech), on behalf of Devon Energy Production Co., LP (Devon), respectfully requests a 90-day extension for a report due on December 2nd, 2025, associated with Incident Number nAPP2524723254 at the Flagler 8 CTB 1 (Site). An alternative soil sampling plan was recently approved on December 1, 2025, to collect soil samples within an Area of Concern (AOC) with densely configured surface production equipment. Etech is currently in the process of scheduling confirmation soil sampling activities at the Site.

To allow sufficient time for additional soil sampling, review of laboratory results, and prepare a comprehensive corrective action report, Devon requests a 90-day extension of the current December 2, 2025, deadline to March 2, 2026, for Incident Number nAPP2524723254.

Thank you,



Anna Byers
Senior Geologist
Etech Environmental & Safety Solutions, Inc.
C: (432) 305-6415

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505**

QUESTIONS

Action 508138

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 508138
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2521623297
Incident Name	NAPP2521623297 FLAGLER 8 CTB 1 @ 0
Incident Type	Produced Water Release
Incident Status	Initial C-141 Approved
Incident Facility	[fAPP2122855254] FLAGLER 8 CTB 1

Location of Release Source	
Site Name	FLAGLER 8 CTB 1
Date Release Discovered	08/02/2025
Surface Owner	Federal

Sampling Event General Information	
<i>Please answer all the questions in this group.</i>	
What is the sampling surface area in square feet	3,376
What is the estimated number of samples that will be gathered	40
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	09/25/2025
Time sampling will commence	07:00 AM
Please provide any information necessary for observers to contact samplers	Please contact Erick Herrera at 432-305-6416 with any questions.
Please provide any information necessary for navigation to sampling site	From the intersection of Co Rd 2 and Resource Ln, head southeast on Co Rd 2 toward Vaca Ln for 0.1 miles, make a slight right and continue for 2.5 miles, turn right and drive for 2.2 miles. (32.140267, -103.601039)

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 508138

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 508138
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

CONDITIONS

Created By	Condition	Condition Date
jraley	Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.	9/22/2025
jraley	If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.	9/22/2025

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505**

QUESTIONS

Action 508142

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 508142
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2521623297
Incident Name	NAPP2521623297 FLAGLER 8 CTB 1 @ 0
Incident Type	Produced Water Release
Incident Status	Initial C-141 Approved
Incident Facility	[fAPP2122855254] FLAGLER 8 CTB 1

Location of Release Source	
Site Name	FLAGLER 8 CTB 1
Date Release Discovered	08/02/2025
Surface Owner	Federal

Sampling Event General Information	
<i>Please answer all the questions in this group.</i>	
What is the sampling surface area in square feet	3,376
What is the estimated number of samples that will be gathered	40
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	09/26/2025
Time sampling will commence	07:00 AM
Please provide any information necessary for observers to contact samplers	Please contact Erick Herrera at 432-305-6416 with any questions.
Please provide any information necessary for navigation to sampling site	From the intersection of Co Rd 2 and Resource Ln, head southeast on Co Rd 2 toward Vaca Ln for 0.1 miles, make a slight right and continue for 2.5 miles, turn right and drive for 2.2 miles. (32.140267, -103.601039)

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 508142

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 508142
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

CONDITIONS

Created By	Condition	Condition Date
jraley	Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.	9/22/2025
jraley	If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.	9/22/2025

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505**

QUESTIONS

Action 533875

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 533875
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2521623297
Incident Name	NAPP2521623297 FLAGLER 8 CTB 1 @ FAPP2122855254
Incident Type	Produced Water Release
Incident Status	Initial C-141 Approved
Incident Facility	[fAPP2122855254] FLAGLER 8 CTB 1

Location of Release Source	
Site Name	FLAGLER 8 CTB 1
Date Release Discovered	08/02/2025
Surface Owner	Federal

Sampling Event General Information	
<i>Please answer all the questions in this group.</i>	
What is the sampling surface area in square feet	3,376
What is the estimated number of samples that will be gathered	11
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	12/15/2025
Time sampling will commence	07:00 AM
Please provide any information necessary for observers to contact samplers	Please contact Erick Herrera at 432-305-6416 with any questions.
Please provide any information necessary for navigation to sampling site	From the intersection of Co Rd 2 and Resource Ln, head southeast on Co Rd 2 toward Vaca Ln for 0.1 miles, make a slight right and continue for 2.5 miles, turn right and drive for 2.2 miles. (32.140267, -103.601039)

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505**

CONDITIONS

Action 533875

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 533875
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

CONDITIONS

Created By	Condition	Condition Date
jraley	Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.	12/10/2025
jraley	If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.	12/10/2025

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505**

QUESTIONS

Action 508140

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 508140
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2524723254
Incident Name	NAPP2524723254 FLAGLER 8 CTB 1 @ FAPP2122855254
Incident Type	Produced Water Release
Incident Status	Initial C-141 Approved
Incident Facility	[fAPP2122855254] FLAGLER 8 CTB 1

Location of Release Source	
Site Name	FLAGLER 8 CTB 1
Date Release Discovered	09/03/2025
Surface Owner	Federal

Sampling Event General Information	
<i>Please answer all the questions in this group.</i>	
What is the sampling surface area in square feet	3,376
What is the estimated number of samples that will be gathered	40
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	09/25/2025
Time sampling will commence	07:00 AM
Please provide any information necessary for observers to contact samplers	Please contact Erick Herrera at 432-305-6416 with any questions.
Please provide any information necessary for navigation to sampling site	From the intersection of Co Rd 2 and Resource Ln, head southeast on Co Rd 2 toward Vaca Ln for 0.1 miles, make a slight right and continue for 2.5 miles, turn right and drive for 2.2 miles. (32.140267, -103.601039)

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 508140

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 508140
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

CONDITIONS

Created By	Condition	Condition Date
jraley	Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.	9/22/2025
jraley	If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.	9/22/2025

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 508143

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 508143
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2524723254
Incident Name	NAPP2524723254 FLAGLER 8 CTB 1 @ FAPP2122855254
Incident Type	Produced Water Release
Incident Status	Initial C-141 Approved
Incident Facility	[fAPP2122855254] FLAGLER 8 CTB 1

Location of Release Source	
Site Name	FLAGLER 8 CTB 1
Date Release Discovered	09/03/2025
Surface Owner	Federal

Sampling Event General Information	
<i>Please answer all the questions in this group.</i>	
What is the sampling surface area in square feet	3,376
What is the estimated number of samples that will be gathered	40
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	09/26/2025
Time sampling will commence	07:00 AM
Please provide any information necessary for observers to contact samplers	Please contact Erick Herrera at 432-305-6416 with any questions.
Please provide any information necessary for navigation to sampling site	From the intersection of Co Rd 2 and Resource Ln, head southeast on Co Rd 2 toward Vaca Ln for 0.1 miles, make a slight right and continue for 2.5 miles, turn right and drive for 2.2 miles. (32.140267, -103.601039)

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 508143

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 508143
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

CONDITIONS

Created By	Condition	Condition Date
jraley	Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.	9/22/2025
jraley	If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.	9/22/2025

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505**

QUESTIONS

Action 533877

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 533877
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2524723254
Incident Name	NAPP2524723254 FLAGLER 8 CTB 1 @ FAPP2122855254
Incident Type	Produced Water Release
Incident Status	Initial C-141 Approved
Incident Facility	[fAPP2122855254] FLAGLER 8 CTB 1

Location of Release Source	
Site Name	FLAGLER 8 CTB 1
Date Release Discovered	09/03/2025
Surface Owner	Federal

Sampling Event General Information	
<i>Please answer all the questions in this group.</i>	
What is the sampling surface area in square feet	3,376
What is the estimated number of samples that will be gathered	11
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	12/15/2025
Time sampling will commence	07:00 AM
Please provide any information necessary for observers to contact samplers	Please contact Erick Herrera at 432-305-6416 with any questions.
Please provide any information necessary for navigation to sampling site	From the intersection of Co Rd 2 and Resource Ln, head southeast on Co Rd 2 toward Vaca Ln for 0.1 miles, make a slight right and continue for 2.5 miles, turn right and drive for 2.2 miles. (32.140267, -103.601039)

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 533877

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 533877
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

CONDITIONS

Created By	Condition	Condition Date
jraley	Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.	12/10/2025
jraley	If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.	12/10/2025

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 547510

QUESTIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 547510
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2524723254
Incident Name	NAPP2524723254 FLAGLER 8 CTB 1 @ FAPP2122855254
Incident Type	Produced Water Release
Incident Status	Remediation Plan Received
Incident Facility	[fAPP2122855254] FLAGLER 8 CTB 1

Location of Release Source	
<i>Please answer all the questions in this group.</i>	
Site Name	FLAGLER 8 CTB 1
Date Release Discovered	09/03/2025
Surface Owner	Federal

Incident Details	
<i>Please answer all the questions in this group.</i>	
Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release	
<i>Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.</i>	
Crude Oil Released (bbls) Details	Not answered.
Produced Water Released (bbls) Details	Cause: Equipment Failure Dump Line Produced Water Released: 5 BBL Recovered: 3 BBL Lost: 2 BBL.
Is the concentration of chloride in the produced water >10,000 mg/l	Yes
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Pinhole leak developed on water dump line allowing fluids to be released to pad surface.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 547510

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 547510
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	More info needed to determine if this will be treated as a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	No
Reasons why this would be considered a submission for a notification of a major release	<i>Unavailable.</i>

With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	<i>Not answered.</i>

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: James Raley Title: EHS Professional Email: jim.raley@dvn.com Date: 01/28/2026
--	--

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 3

Action 547510

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 547510
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Site Characterization

Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 51 and 75 (ft.)
What method was used to determine the depth to ground water	NM OSE iWaters Database Search
Did this release impact groundwater or surface water	No
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	Between 1 and 5 (mi.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Greater than 5 (mi.)
An occupied permanent residence, school, hospital, institution, or church	Greater than 5 (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Between 1 and 5 (mi.)
Any other fresh water well or spring	Between 1 and 5 (mi.)
Incorporated municipal boundaries or a defined municipal fresh water well field	Greater than 5 (mi.)
A wetland	Between 1 and 5 (mi.)
A subsurface mine	Greater than 5 (mi.)
An (non-karst) unstable area	Greater than 5 (mi.)
Categorize the risk of this well / site being in a karst geology	Low
A 100-year floodplain	Greater than 5 (mi.)
Did the release impact areas not on an exploration, development, production, or storage site	No

Remediation Plan

Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

Requesting a remediation plan approval with this submission	Yes
<i>Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.</i>	
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No

Soil Contamination Sampling: (Provide the highest observable value for each, in milligrams per kilograms.)

Chloride (EPA 300.0 or SM4500 Cl B)	45200
TPH (GRO+DRO+MRO) (EPA SW-846 Method 8015M)	146
GRO+DRO (EPA SW-846 Method 8015M)	146
BTEX (EPA SW-846 Method 8021B or 8260B)	0
Benzene (EPA SW-846 Method 8021B or 8260B)	0

Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.

On what estimated date will the remediation commence	03/27/2026
On what date will (or did) the final sampling or liner inspection occur	05/01/2026
On what date will (or was) the remediation complete(d)	03/27/2026
What is the estimated surface area (in square feet) that will be reclaimed	0
What is the estimated volume (in cubic yards) that will be reclaimed	0
What is the estimated surface area (in square feet) that will be remediated	1961
What is the estimated volume (in cubic yards) that will be remediated	52

These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed.

The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 4

Action 547510

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 547510
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Remediation Plan (continued)

Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:

(Select all answers below that apply.)

(Ex Situ) Excavation and off-site disposal (i.e. dig and haul, hydrovac, etc.)	Yes
Which OCD approved facility will be used for off-site disposal	fEEM0112334510 HALFWAY DISPOSAL AND LANDFILL
OR which OCD approved well (API) will be used for off-site disposal	Not answered.
OR is the off-site disposal site, to be used, out-of-state	Not answered.
OR is the off-site disposal site, to be used, an NMED facility	Not answered.
(Ex Situ) Excavation and on-site remediation (i.e. On-Site Land Farms)	Not answered.
(In Situ) Soil Vapor Extraction	Not answered.
(In Situ) Chemical processing (i.e. Soil Shredding, Potassium Permanganate, etc.)	Not answered.
(In Situ) Biological processing (i.e. Microbes / Fertilizer, etc.)	Not answered.
(In Situ) Physical processing (i.e. Soil Washing, Gypsum, Disking, etc.)	Not answered.
Ground Water Abatement pursuant to 19.15.30 NMAC	Not answered.
OTHER (Non-listed remedial process)	Not answered.

Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: James Raley Title: EHS Professional Email: jim.raley@dvn.com Date: 01/28/2026
--	--

The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 5

Action 547510

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 547510
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Deferral Requests Only	
<i>Only answer the questions in this group if seeking a deferral upon approval this submission. Each of the following items must be confirmed as part of any request for deferral of remediation.</i>	
Requesting a deferral of the remediation closure due date with the approval of this submission	No

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 6

Action 547510

QUESTIONS (continued)

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 547510
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Sampling Event Information	
Last sampling notification (C-141N) recorded	533877
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	12/15/2025
What was the (estimated) number of samples that were to be gathered	11
What was the sampling surface area in square feet	3376

Remediation Closure Request

Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.

Requesting a remediation closure approval with this submission	No
--	-----------

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 547510

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 547510
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

CONDITIONS

Created By	Condition	Condition Date
nvez	Remediation plan is approved as written except with the following conditions; 1. Prior to backfilling the open excavation per 19.15.29.12D (2) NMAC, Devon Energy (Devon) must collect a minimum of one (1) five point composite sample from the media being used as backfill to verify that it meets non-waste containing, uncontaminated, earthen material with chloride concentrations less than 600 mg/kg as analyzed by EPA Method 300.0, or other test methods approved by the division. This is especially important for the material being used within the top four (4) feet from the ground surface. 2. Devon has 90-days (June 10, 2026) to submit to OCD its appropriate or final remediation closure report.	3/12/2026